



Control Panel Message Document (CPMD)

HP Color LaserJet Enterprise M855, flow MFP M880

This document provides error-code troubleshooting information

Control-panel message types

The control-panel messages and event code entries indicate the current printer status or situations that might require action.

Note:

Event log errors do not appear on the control-panel display. Open the event log to view or print the event log errors.

A control-panel message displays temporarily and might require you (or the applicable user) to acknowledge the message by touching the OK button to resume printing or by touching the Stop button to cancel the job.

With certain messages, the job might not finish printing, or the print quality might be affected. If the message is related to printing and the auto-continue feature is on, the printer will attempt to resume printing after the message has appeared for 10 seconds without acknowledgement.

For some messages, restarting the printer might fix the problem. If a critical error persists, the printer might require service.

Printer service information

Last update: April 1, 2020

Service mode PIN numbers:

- M855 : 11085513
- flow MFP 880 : 11088013

Note:

When possible, always update the printer firmware to the latest available version at HP.com as part of the troubleshooting performed for any of the following errors.

After the firmware updates, re-enable autosend through the control panel

10.WX.YZ error messages

10.wx.yz error messages

Errors in the 10.* family are related to toner cartridges and other supply items that require regular replacement as part of routine printer maintenance.

Order replacement supplies and install them as necessary. To order parts, go to <https://www.hp.com/buy/parts>.

Use the following list to identify the supply item affected:

Note:

Not all printers have all of these supplies.

- 10.00.XX = Black toner cartridge
- 10.01.XX = Cyan toner cartridge
- 10.02.XX = Magenta toner cartridge
- 10.03.XX = Yellow toner cartridge
- 10.10.XX = Transfer roller
- 10.22.XX = Transfer Belt
- 10.23.XX = Fuser kit
- 10.31.XX = Toner collection unit
- 10.39.XX = Document feeder kit
- 10.99.XX = One or more supply items have been installed

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

To order parts, go to <https://www.hp.com/buy/parts>.

1. For toner cartridges:
 - a. Remove and reinstall the cartridge.
 - b. Check the electronic chip on the cartridge if it is visible. If the chip is damaged, replace the toner cartridge.

- c. If print quality is unacceptable, or if printing cannot continue, replace the toner cartridge.
2. For the transfer kit:
 - a. Remove and then reinstall the transfer unit.
 - b. If print quality is unacceptable, or if printing cannot continue, replace the transfer kit.
3. For the fuser kit:
 - a. Remove and then reinstall the fuser.

CAUTION:

The fuser might be hot.

- b. If print quality is unacceptable, or if printing cannot continue, replace the fuser kit.
4. For the toner collection unit:
 - a. Remove the toner collection unit and reinstall it.
 - b. If the toner collection unit is nearly full, replace it with a new one. Using a toner collection unit until it is overfilled can damage the printer.
5. For the document feeder kit:
 - a. Open the document feeder top cover and inspect the rollers for obvious dirt or wear. Clean the rollers if necessary.
 - b. Install a new roller kit.

10.0X.00 e-Label Memory Error

The printer is unable to read the toner cartridge or imaging drum memory tag data and a '10.0X.00 <color> toner cartridge' error or '10.0X.00 <color> image drum' error occurs.

10.00.00 Black toner cartridge

10.01.00 Cyan toner cartridge

10.02.00 Magenta toner cartridge

10.03.00 Yellow toner cartridge

10.05.00 Black image drum

10.06.00 Cyan image drum

10.07.00 Magenta image drum

10.08.00 Yellow image drum

This message indicates that the printer has determined that it cannot read or write to one of the e-labels on the toner cartridge or imaging drum.

Caused when the toner cartridge or imaging drum is present but defective.

This error can cause the supplies status feature to become disabled.

Recommended action

1. Open the front door and remove the toner cartridge or imaging drum.
2. Check the e-label. If it is damaged, replace the toner cartridge or imaging drum.
 - Black toner drum part number: CF358A
 - Cyan toner drum part number: CF359A
 - Yellow toner drum part number: CF364A
 - Magenta toner drum part number: CF365A
 - Black toner cartridge part number (M855): CF310A
 - Cyan toner cartridge part number (M855): CF311A
 - Yellow toner cartridge part number (M855): CF312A
 - Magenta toner cartridge part number (M855): CF313A
 - Black toner cartridge part number (M880): CF300A
 - Cyan toner cartridge part number (M880): CF301A
 - Yellow toner cartridge part number (M880): CF302A
 - Magenta toner cartridge part number (M880): CF303A
3. Reinstall the toner cartridge or imaging drum and close the front door.
4. If the error persists, turn the printer off, and then on.
5. If the error persists, replace the memory tag PCA.

Part number: RM2-7009-000CN

6. If the error persists, replace the DC controller.

For instructions: See the Repair Service Manual for this product.

M855 part number: RM2-7005-000CN

M880 part number: RM2-7006-000CN

7. If the error persists, replace the cartridge interface PCA that corresponds to the combination of colors giving the issue.

Part number: A2W79-67902

10.0X.10 e-Label Missing Memory Error

The printer is unable to detect one or more of the e-labels.

This error can cause the supplies status feature to become disabled.

When this error occurs, a question mark appears on the gas gauge of the supply or supplies with the error.

If multiple supplies have this error, a 10.0X.10 error for the first supply detected with the error displays. After the user resolves the error that corresponds to the first supply, another 10.0X.Y0 error displays for the next supply. This continues for all supplies memory errors.

10.00.10 Black toner cartridge

10.01.10 Cyan toner cartridge

10.02.10 Magenta toner cartridge

10.03.10 Yellow toner cartridge

10.05.10 Black imaging drum

10.06.10 Cyan imaging drum

10.07.10 Magenta imaging drum

10.08.10 Yellow imaging drum

Recommended action

1. Open the front door and remove the toner cartridge or the imaging drum.
2. Check the e-label on the supply. If it is damaged, replace the toner cartridge or imaging drum.
 - Black toner drum part number: CF358A
 - Cyan toner drum part number: CF359A
 - Yellow toner drum part number: CF364A
 - Magenta toner drum part number: CF365A
 - Black toner cartridge part number (M855): CF310A
 - Cyan toner cartridge part number (M855): CF311A
 - Yellow toner cartridge part number (M855): CF312A
 - Magenta toner cartridge part number (M855): CF313A
 - Black toner cartridge part number (M880): CF300A
 - Cyan toner cartridge part number (M880): CF301A
 - Yellow toner cartridge part number (M880): CF302A
 - Magenta toner cartridge part number (M880): CF303A
3. Reinstall the toner cartridge or imaging drum, and then close the front door.
4. If the error persists, replace the memory tag PCA.

Part number: RM2-7009-000CN

5. If the error persists, replace the DC controller.

For instructions: See the Repair Service Manual for this product.

M855 part number: RM2-7005-000CN

M880 part number: RM2-7006-000CN

6. If the error persists, replace the cartridge interface PCA that corresponds to the combination of colors giving the issue.

Part number: A2W79-67902

10.0X.15 Install <supply> (event code)

The indicated supply has been removed or is installed incorrectly.

10.00.15 Black toner cartridge (event code)

10.01.15 Cyan toner cartridge (event code)

10.02.15 Magenta toner cartridge (event code)

10.03.15 Yellow toner cartridge (event code)

10.23.15 Fuser kit (event code)

10.31.15 Toner collection unit (TCU) (event code)

Recommended action

1. Remove and reinstall the indicated supply, and ensure that it is seated correctly.
2. If the error persists, replace the fuser kit, toner cartridge, toner collection kit (toner drum or ITB), or other indicated supply.
 - For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

- Fuser (220V) part number: C1N58-67901
- For instructions: [Removal and replacement: ITB Transfer roller](#)

ITB unit part number: RY7-5211-000CN

- Black toner drum part number: CF358A
- Cyan toner drum part number: CF359A
- Yellow toner drum part number: CF364A

- Magenta toner drum part number: CF365A
- Black toner cartridge part number (M855): CF310A
- Cyan toner cartridge part number (M855): CF311A
- Yellow toner cartridge part number (M855): CF312A
- Magenta toner cartridge part number (M855): CF313A
- Black toner cartridge part number (M880): CF300A
- Cyan toner cartridge part number (M880): CF301A
- Yellow toner cartridge part number (M880): CF302A
- Magenta toner cartridge part number (M880): CF303A

10.0X.25 Wrong cartridge in <color> slot

The indicated toner cartridge is installed in the wrong position.

10.00.25 Black toner cartridge (event code)

10.01.25 Cyan toner cartridge (event code)

10.02.25 Magenta toner cartridge (event code)

10.03.25 Yellow toner cartridge (event code)

Recommended action

Install the indicated cartridge in the correct position. From left to right, the correct cartridge order is as follows:

- Yellow
- Magenta
- Cyan
- Black

10.0X.34 Used Supply in use

The indicated toner cartridge is used.

10.00.34 Black toner cartridge (event code)

10.01.34 Cyan toner cartridge (event code)

10.02.34 Magenta toner cartridge (event code)

10.03.34 Yellow toner cartridge (event code)

Recommended action

Ensure that the toner cartridge is a genuine HP supply.

Note:

Removing a toner cartridge from one printer and then installing it in a different printer (for testing functionality) will cause this message and event code.

10.0X.35 Incompatible <supply>

The indicated supply is not compatible with this printer.

10.00.35 Black toner cartridge (event code)

10.01.35 Cyan toner cartridge (event code)

10.02.35 Magenta toner cartridge (event code)

10.03.35 Yellow toner cartridge (event code)

Recommended action

Install a supply that is designed for this printer.

10.0X.40 Genuine HP supplies installed

More than one genuine HP toner cartridge has been installed.

10.00.40 Black toner cartridge (event code)

10.01.40 Cyan toner cartridge (event code)

10.02.40 Magenta toner cartridge (event code)

10.03.40 Yellow toner cartridge (event code)

Recommended action

No action necessary.

10.0X.41 Unsupported Supply in use

The indicated toner cartridge is for a different printer.

10.00.41 Black toner cartridge (event code)

10.01.41 Cyan toner cartridge (event code)

10.02.41 Magenta toner cartridge (event code)

10.03.41 Yellow toner cartridge (event code)

Recommended action

Remove the indicated supply, and then install the correct supply for this printer.

10.0X.60 <Supply> low

The printer indicates when a supply level is low. Actual toner cartridge life might vary. You do not need to replace the toner cartridge at this time unless print quality is no longer acceptable.

The 10.WX.60 is an event log only message, it will not show on the control panel. The only message to display will be <Supply> low.

- **10.00.60** Black toner cartridge (event code)
- **10.01.60** Cyan toner cartridge (event code)
- **10.02.60** Magenta toner cartridge (event code)
- **10.03.60** Yellow toner cartridge (event code)
- **10.05.60** Black imaging drum event code)
- **10.06.60** Cyan imaging drum very low (event code)
- **10.07.60** Magenta imaging drum very low (event code)
- **10.08.60** Yellow imaging drum very low (event code)

Recommended action

If the print quality is no longer acceptable, replace the toner cartridge or imaging drum.

Note:

HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

- Black toner drum part number: CF358A
- Cyan toner drum part number: CF359A
- Yellow toner drum part number: CF364A
- Magenta toner drum part number: CF365A

- Black toner cartridge part number (M855): CF310A
- Cyan toner cartridge part number (M855): CF311A
- Yellow toner cartridge part number (M855): CF312A
- Magenta toner cartridge part number (M855): CF313A

- Black toner cartridge part number (M880): CF300A
- Cyan toner cartridge part number (M880): CF301A
- Yellow toner cartridge part number (M880): CF302A
- Magenta toner cartridge part number (M880): CF303A

10.0X.69 <Supply> very low

The printer indicates when a supply level is very low. Actual toner cartridge life might vary. Consider having a replacement toner cartridge available to install when print quality is no longer acceptable. You do not need to replace the toner cartridge at this time unless the print quality is no longer acceptable.

The 10.WX.69 is an event log only message, it will not show on the control panel. The only message to display will be <Supply> very low .

- **10.00.69** Black toner cartridge very low (event code)
- **10.01.69** Cyan toner cartridge very low (event code)
- **10.02.69** Magenta toner cartridge very low (event code)
- **10.03.69** Yellow toner cartridge very low (event code)
- **10.05.69** Black imaging drum event code)
- **10.06.69** Cyan imaging drum very low (event code)
- **10.07.69** Magenta imaging drum very low (event code)
- **10.08.69** Yellow imaging drum very low (event code)

Recommended action

If the print quality is no longer acceptable, replace the toner cartridge or imaging drum.

Note:

HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

- Black toner drum part number: CF358A
 - Cyan toner drum part number: CF359A
 - Yellow toner drum part number: CF364A
 - Magenta toner drum part number: CF365A
-
- Black toner cartridge part number (M855): CF310A
 - Cyan toner cartridge part number (M855): CF311A
 - Yellow toner cartridge part number (M855): CF312A
 - Magenta toner cartridge part number (M855): CF313A
-
- Black toner cartridge part number (M880): CF300A
 - Cyan toner cartridge part number (M880): CF301A
 - Yellow toner cartridge part number (M880): CF302A
 - Magenta toner cartridge part number (M880): CF303A

10.0X.70 Printing past very low

The printer indicates when one of the supplies is very low. The actual remaining supply life might vary. You do not need to replace the toner cartridge at this time unless the print quality is no longer acceptable.

The 10.WX.70 is an event log only message, it will not show on the control panel. The only message to display will be a warning message <Supply> very low .

10.00.70 Black toner cartridge very low (event code)

10.01.70 Cyan toner cartridge (event code)

10.02.70 Magenta toner cartridge (event code)

10.03.70 Yellow toner cartridge (event code)

10.05.70 Black imaging drum very low (event code)

10.06.70 Cyan imaging drum (event code)

10.07.70 Magenta imaging drum (event code)

10.08.70 Yellow imaging drum (event code)

Recommended action

If the print quality is no longer acceptable, the customer must purchase and replace the toner cartridge or imaging drum.

Note:

HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

- Black toner drum part number: CF358A
- Cyan toner drum part number: CF359A
- Yellow toner drum part number: CF364A
- Magenta toner drum part number: CF365A

- Black toner cartridge part number (M855): CF310A
- Cyan toner cartridge part number (M855): CF311A
- Yellow toner cartridge part number (M855): CF312A
- Magenta toner cartridge part number (M855): CF313A

- Black toner cartridge part number (M880): CF300A
- Cyan toner cartridge part number (M880): CF301A

- Yellow toner cartridge part number (M880): CF302A
- Magenta toner cartridge part number (M880): CF303A

10.0X.90 or 10.0X.91 <Color> cartridge error

A problem has occurred with the indicated toner cartridge.

10.0X.90 — A toner replenishment malfunction occurred and the toner concentration in the imaging drum dropped below 30%. This applies to both HP and non-HP toner cartridges.

OR

The error occurs when the toner cartridge has been used past the end-of-life to the point the reservoir in the imaging drum no longer has enough toner to safely continue printing.

10.0X.91 Toner cartridge motor stall.

Cause 1

The toner gate located on the toner cartridge or imaging drum might be out of synchronization.

The correct position of the gates for all supplies is **closed** when the toner cartridges or imaging drums are out of the printer.

If one of the gates is in the **open** position when the cartridge or drum is out of the printer, then that gate will close when installing the cartridge or drum into the printer. This will cause the toner to not flow from the toner cartridge into the imaging drum and a 10.WX.90 or 10.WX.91 error message gets generated.

Note:

The 10.XY.90 message is expected behavior that occurs normally when the toner cartridge is used in a past Very Low or 'Over Ride' condition. In this case, the message indicates that the toner cartridge must be replaced. If the 10.XY.90 error has been generated as a result of running the toner cartridge beyond a very low state, then the issue is **not** considered a warranty or defect issue. Inform the customer that they must order and pay for a new toner cartridge. Do **not** troubleshoot further.

Cause 2

The toner seal inside the toner cartridge or imaging drum fails to get removed automatically. No toner will flow from the toner cartridges or no toner will get into the imaging drum.

10.00.90 Black toner cartridge (event code)

10.01.90 Cyan toner cartridge (event code)

10.02.90 Magenta toner cartridge (event code)

10.03.90 Yellow toner cartridge (event code)

10.00.91 Black toner cartridge (event code)

10.01.91 Cyan toner cartridge (event code)

10.02.91 Magenta toner cartridge (event code)

10.03.91 Yellow toner cartridge (event code)

Recommended action for customers

1. From the Home screen on the control panel, touch Supplies.
2. Verify that the Very low message is present (a yellow triangle with an exclamation point inside).
3. If the cartridge level status is Not Very low, skip to the next step. If the level status of a supply is Very low, replace the toner cartridge or imaging drum.

Note:

The supply replacement should correct the error and no further troubleshooting is necessary.

- Black toner drum part number: CF358A
 - Cyan toner drum part number: CF359A
 - Yellow toner drum part number: CF364A
 - Magenta toner drum part number: CF365A
 - Black toner cartridge part number (M855): CF310A
 - Cyan toner cartridge part number (M855): CF311A
 - Yellow toner cartridge part number (M855): CF312A
 - Magenta toner cartridge part number (M855): CF313A
 - Black toner cartridge part number (M880): CF300A
 - Cyan toner cartridge part number (M880): CF301A
 - Yellow toner cartridge part number (M880): CF302A
 - Magenta toner cartridge part number (M880): CF303A
4. Go to this support document: [HP Color LaserJet Enterprise M855 and HP Color LaserJet Enterprise flow M880 Multifunction Printers - 10.0x.90 and 10.0x.91 Errors](#)

Recommended action for call agents

1. Check the event log for active low warnings.

Note:

The 10.XY.90 message is expected behavior that occurs normally when the toner cartridge is used in a past Very Low or 'Over Ride' condition. In this case, the message indicates that the toner cartridge must be replaced. If the 10.XY.90 error has been generated as a result of running the toner cartridge beyond a very low state, then the issue is **not** considered a warranty or defect issue. Inform the customer that they must order and pay for a new toner cartridge. Do **not** troubleshoot further.

2. Check the toner cartridges and toner gate position.
 - a. To see a short video demonstrating the this procedure, go to [Resolving 10.XY.90 or 10.XY.91 Error Messages on HP Color LaserJet and MFP Flow Printers](#)

Note:

If toner gets on clothing, wipe it off by using a dry cloth and wash the clothes in cold water. Hot water sets toner into fabric.

- b. With the printer on, open the front door.
- c. Remove the toner cartridges by grasping the blue handle on top of the toner cartridges and pulling straight out.

Note:

To prevent toner spills, place the toner cartridge upside down on a flat surface.

- d. Remove the imaging drums by grasping the blue handle on top of the imaging drums and pulling straight out.

Note:


To prevent damage to the imaging drums, place them upright on a flat surface.

- e. Close the front door.

Note:

The action of closing the door with the toner cartridges out, and the printer on, clears the error message from the control panel.

- f. Verify that the plastic pins (callout B) on the toner cartridges are not broken. If either one of the pins is broken, replace the toner cartridge.

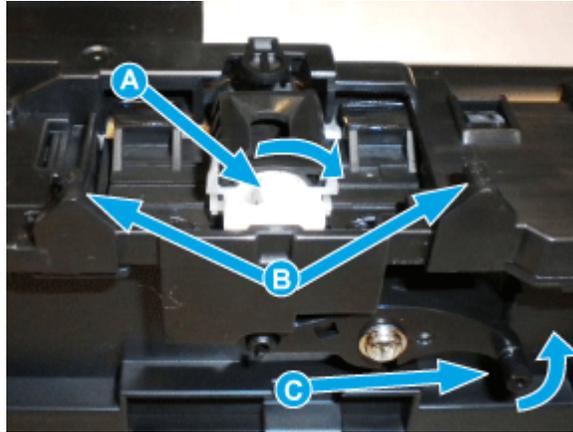

Toner cartridge components


Callout A — White gear


Callout B — Plastic pins

Callout C — Black lever

- Black toner cartridge part number (M855): CF310A
 - Cyan toner cartridge part number (M855): CF311A
 - Yellow toner cartridge part number (M855): CF312A
 - Magenta toner cartridge part number (M855): CF313A
 - Black toner cartridge part number (M880): CF300A
 - Cyan toner cartridge part number (M880): CF301A
 - Yellow toner cartridge part number (M880): CF302A
 - Magenta toner cartridge part number (M880): CF303A
- g. Ensure that the toner gates on the toner cartridges are completely closed.

Toner gate closed correctly (callout 1).

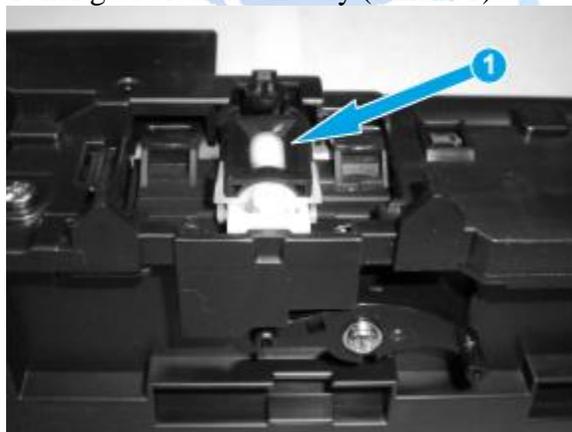

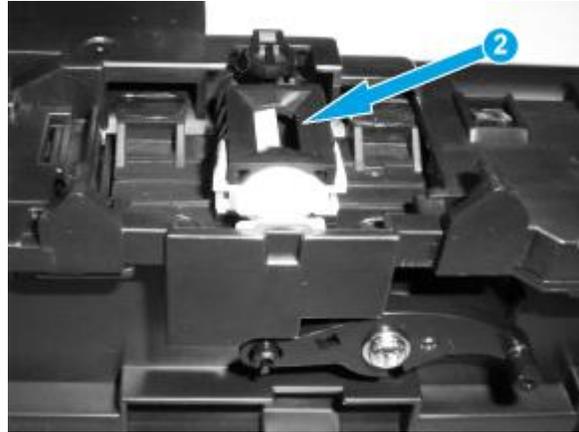

Toner gate partially open (callout 2)

Toner gate completely opened (callout 3)




3. Check the imaging drum cartridge gates. If any of the toner gates are partially or completely open, then perform the following steps:
 - a. Push up and hold the black lever (callout C) to release the white gear.
 - b. Rotate the white gear (callout A) clockwise until the toner gate is completely closed.
 - c. Release the black lever.

Note:


This action will keep the toner gate locked in the closed position when the toner cartridge is out of the printer.

- d. Return the toner cartridge(s) to the flat surface.
- e. Ensure that the toner gates on the imaging drums are completely closed.


Drum unit toner gate closed correctly (callout 1)

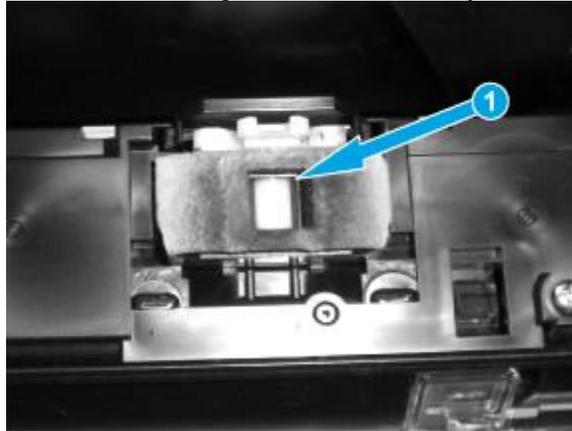


Drum unit toner gate partially open (callout 2)

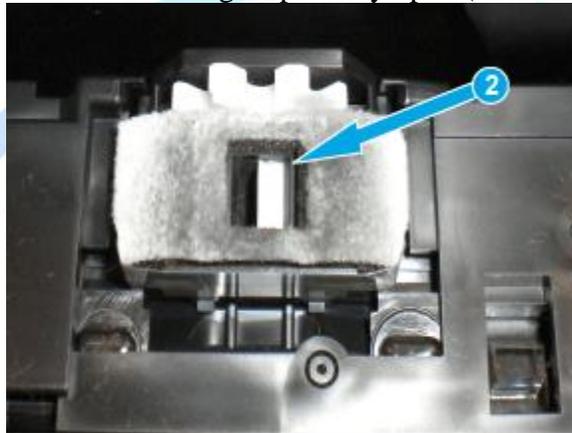

Drum unit toner gate in the incorrect position open (callout 3)

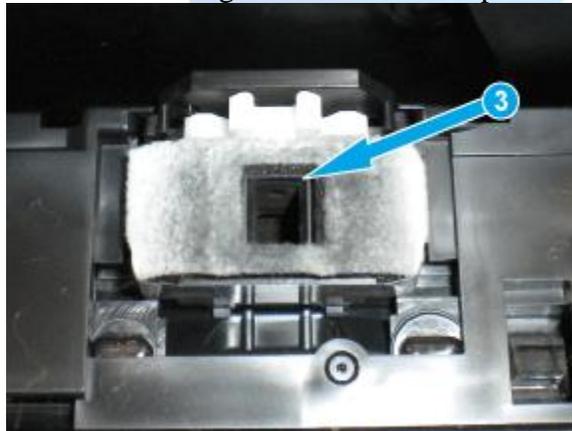

4. If any of the toner gates are partially or completely open, then perform the following steps to close the gates.

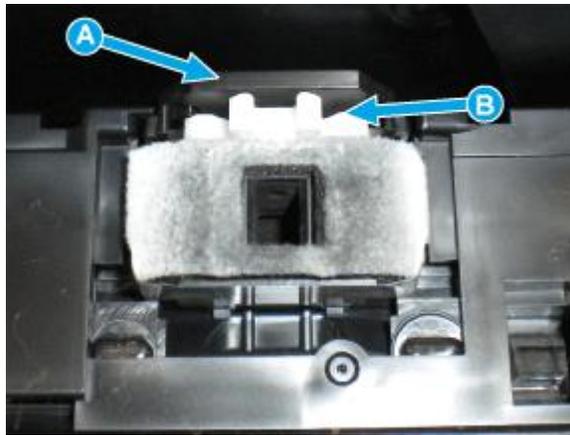

Imaging drum components

Callout A — Black button

Callout B — White gear

- a. Push down and hold the black button to release the white gear (callout A).
- b. Rotate the white gear clockwise until the toner gate is completely closed (callout B).
- c. Release the black button.

Note:

This action will keep the toner gate locked in the closed position when the imaging drum is out of the printer.

- d. Return the imaging drum to the flat surface.
5. Return to the printer and check the control panel for the Install supplies message.

Note:

It is important that the Install supplies message is displayed before opening the door to reinstall the imaging drums and the toner cartridges.

6. Open the front door.
7. Align each imaging drum with its slot, and then re-insert each imaging drum into the printer.

Note:

The imaging drums must be installed before installing the toner cartridges.

8. Align each toner cartridge with its slot, and then insert each toner cartridge into the printer.

Note:

The toner cartridges must be installed after installing the imaging drums.

9. Close the front door.

Recommended action for on-site technicians

1. Check the event log for active low warnings.

Note:

The 10.XY.90 message is expected behavior that occurs normally when the toner cartridge is used in a past Very Low or 'Over Ride' condition. In this case, the message indicates that the toner cartridge must be replaced. If the 10.XY.90 error has been generated as a result of running the toner cartridge beyond a very low state, then the issue is **not** considered a warranty or defect issue. Inform the customer that they must order and pay for a new toner cartridge. Do **not** troubleshoot further.

2. Check the printer toner cartridge and imaging drum slots for excessive toner spill and use a toner vacuum to clean the area as needed.
3. Replace toner cartridge and imaging drum for the color that is causing the issue.
 - o Black toner drum part number: CF358A
 - o Cyan toner drum part number: CF359A
 - o Yellow toner drum part number: CF364A
 - o Magenta toner drum part number: CF365A
 - o Black toner cartridge part number (M855): CF310A
 - o Cyan toner cartridge part number (M855): CF311A
 - o Yellow toner cartridge part number (M855): CF312A
 - o Magenta toner cartridge part number (M855): CF313A
 - o Black toner cartridge part number (M880): CF300A
 - o Cyan toner cartridge part number (M880): CF301A
 - o Yellow toner cartridge part number (M880): CF302A
 - o Magenta toner cartridge part number (M880): CF303A
4. If replacing the imaging drum does not resolve the problem, replace the cartridge interface PCA.

Part number: A2W79-67902

10.0X.92 Cartridge Error

Toner cartridge not engaged.

10.00.92 Black toner cartridge (event log)

10.01.92 Cyan toner cartridge (event log)

10.02.92 Magenta toner cartridge (event log)

10.03.92 Yellow toner cartridge (event log)

Recommended action

1. Open the front door, remove and reinstall the specified toner cartridge.
2. Check the toner cartridge for any damage or defects.
3. Replace toner cartridge.

10.22.60 Transfer Kit low, 10.22.69 Transfer Kit very low

The transfer kit estimated usage life is low or very low.

Recommended action

1. Check the event log for the 10.22.70 code. If this error is listed, the transfer kit is past very low. The customer (at a minimum) must order and pay for a replacement intermediate transfer belt (ITB). However, HP recommends that the customer order and install a maintenance kit at this time.
2. Replace the ITB kit when the print quality becomes unacceptable.

For instructions: [Removal and replacement: ITB Transfer roller](#)

Part number: D7H14-67902

Kit includes ITB, transfer roller and tray rollers.

Note:

HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

10.22.70 Transfer Kit Printing past very low

The transfer kit estimated usage life is very low.

Recommended action

Replace the ITB.

Note:

If print quality is no longer acceptable, the customer (at a minimum) must order and pay for a replacement intermediate transfer belt (ITB). However, HP recommends that the customer order and install a maintenance kit at this time.

For instructions: [Removal and replacement: ITB Transfer roller](#)

Part number: D7H14-67902

Kit includes ITB, transfer roller and tray rollers.

Note:

HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

10.23.15 Install Fuser kit

The fuser is either not installed, or installed incorrectly in the printer or the fuser is improperly seated, defective, or has a poor or broken connection.

Recommended action for customers

1. Remove, and then reinstall the fuser.
2. Ensure that the fuser is seated correctly.

CAUTION:

The fuser might be hot.

For instructions: [Removal and replacement: Fuser](#)

[Fuser Installation Guide](#) - c03823466.

Recommended action for call-center agents and onsite technicians

1. Remove, and then reinstall the fuser.
2. Ensure that the fuser is seated correctly.

CAUTION:

The fuser might be hot.

[Fuser Installation Guide](#) - c03823466.

3. If the error persists, replace the fuser kit, toner cartridge, toner collection kit (toner drum or ITB), or other indicated supply.

- For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

- Fuser (220V) part number: C1N58-67901
- For instructions: [Removal and replacement: ITB Transfer roller](#)

ITB unit part number: RY7-5211-000CN

10.23.35 Incompatible Supply Fuser Kit

The indicated supply is not compatible with this printer.

Recommended action

Install a supply that is designed for this printer.

10.23.60 Fuser Kit low, 10.23.60 Fuser Kit very low

The fuser kit remaining usage life is low.

Recommended action

1. Check the event log for the 10.23.70 code.
 - If a 10.23.70 error is listed, the fuser kit is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part under warranty.

Note:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

2. Replace the fuser.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

3. Reset the fuser page counter by selecting New Fuser Kit in the Reset Supplies menu.

Note:

HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

10.23.70 Printing Past Very Low Fuser Kit

The printer indicates when the fuser kit is at its estimated end of life. The actual life remaining might be different than the estimation. Have a replacement fuser kit available to install when print quality is no longer acceptable.

Recommended action

1. Replace the fuser.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

2. After replacing the fuser kit, select New Fuser Kit in the Reset Supplies menu to reset the fuser page counter.

10.39.50 New Document Feeder Kit

A new document feeder maintenance kit has been installed and New Document Feeder Kit has been selected from the control panel menus.

Recommended action

No action necessary.

10.39.53 ADF kit clean rollers recommended

Document feeder kit recommend clean prompt.

Recommended action

1. Remove the document feeder pick roller, feed roller, and the separation pad assemblies.
2. Clean the rollers and pad with a damp lint free cloth.
3. Reinstall the document feeder pick roller, feed roller, and the separation pad assemblies.

10.39.55 Clean Document Feeder Rollers

The document feeder separation pad and rollers need to be cleaned.

Recommended action

1. Remove the document feeder pick roller, feed roller, and the separation pad assemblies.
2. Clean the rollers and pad with a damp lint free cloth.
3. Reinstall the document feeder pick roller, feed roller, and the separation pad assemblies.

10.39.56

Scanned past document feeder scheduled cleaning prompt.

Recommended action

1. Remove the document feeder pick roller, feed roller, and the separation pad assemblies.
2. Clean the rollers and pad with a damp lint free cloth.
3. Reinstall the document feeder pick roller, feed roller, and the separation pad assemblies.

10.39.60 Document Feeder Kit low

The document feeder pick roller, feed roller, and separation pad are near their end of life.

Recommended action

No action necessary.

10.39.69 Document Feeder Kit very low

The document feeder pick roller, feed roller, and separation pad are at their end of life.

Recommended action

Order and install a document feeder maintenance kit.

Part number: C1P70A

10.39.70 Scanning past very low

The document feeder pick roller, feed roller, and separation pad are at their end of life.

Recommended action

The customer must order and install a document feeder maintenance kit.

Part number: C1P70A

Tip:

HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

10.39.71 Document Feeder has stopped

The document feeder pick roller, feed roller, and separation pad are at their end of life.

Recommended action

The customer must order and install a document feeder maintenance kit.

Part number: C1P70A

Tip:

HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

10.99.31 Non-HP supply in use or Used supply in use

A non-HP supply (a remanufactured or refilled genuine HP or non-HP supply) has been installed.

The 10.99.31 is an event log only message, it will not show on the control panel. The only message to display will be Used supply in use

Recommended action

The toner cartridge or imaging drum has been previously used. Touch OK to continue.

Note:

Removing a cartridge from one printer and then installing it in a different printer (for testing functionality) will cause this event code.

Note:

If the customer purchased a genuine HP supply, go to www.hp.com/go/anticounterfeit.

10.99.34 Used supply in use

A non-HP supply (a remanufactured or refilled genuine HP or non-HP supply) has been installed.

The 10.99.34 is an event log only message, it will not show on the control panel. The only message to display will be `Used supply in use`.

Recommended action

The toner cartridge has been previously used. Touch OK to continue.

Note:

Removing a cartridge from one printer and then installing it in a different printer (for testing functionality) will cause this event code.

Note:

If the customer purchased a genuine HP supply, go to www.hp.com/go/anticounterfeit.

10.99.40 Genuine HP supplies installed

A new toner cartridge or imaging drum has been installed and all toner cartridges or imaging drums are Genuine HP supplies.

Recommended action

Touch the OK to continue.

10.99.41 Unsupported Supply in use

The indicated toner cartridge or imaging drum is for a different printer.

Recommended action

Remove the indicated toner cartridge or imaging drum, and then install the correct toner cartridge or imaging drum for the printer.

10.99.91 Cartridge motor stall, no particular cartridge

Cartridge motor is stalled.

Recommended action

1. If the error persists, run the component test for the imaging drum motor.

2. If the test fails, replace the imaging drum.
 - Black toner drum part number: CF358A
 - Cyan toner drum part number: CF359A
 - Yellow toner drum part number: CF364A
 - Magenta toner drum part number: CF365A
3. If the test passes, replace the toner cartridge.
 - Black toner cartridge part number (M855): CF310A
 - Cyan toner cartridge part number (M855): CF311A
 - Yellow toner cartridge part number (M855): CF312A
 - Magenta toner cartridge part number (M855): CF313A
 - Black toner cartridge part number (M880): CF300A
 - Cyan toner cartridge part number (M880): CF301A
 - Yellow toner cartridge part number (M880): CF302A
 - Magenta toner cartridge part number (M880): CF303A

11.WX.YZ error messages

11.* errors

Errors in the 11.* family are related to the printer real-time clock.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Set the time and date on the printer control panel.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Set the time and date on the printer control panel.
2. If the error persists, remove and reinstall the formatter. Make sure it is fully seated.
3. If the error still persists, replace the formatter.

11.00.01 or 11.00.02 Internal clock error

This message indicates a problem with the real time clock in the formatter.

The real time clock in the printer has experienced an error.

- 01= dead clock

- 02= dead real time clock

Recommended action

1. Turn the printer off, and then on.
2. Set the time and date on the control panel.
3. If the error persists, replace the formatter.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: Formatter](#)

Part number formatter PCA assembly (M855): A2W77-67902

Part number formatter PCA Assembly (M880): A2W75-67903

Part number formatter PCA Assembly (M855 China/India ONLY): A2W77-67903

Part number formatter PCA Assembly (M880 China/India ONLY): A2W75-67902

13.WX.YZ error messages

13.* errors

Errors in the 13.* family are related to jams.

More than 1000 unique error codes are possible. Use the following information to understand the jam code. Not all codes apply to all printers.

Message format: 13.WX.YZ

- W represents the jam location.
- X represents the sensor or door that triggered the jam.
- Y represents the jam condition (delay, stay, wrap, etc.)
- Z represents the paper source, fuser mode, or destination

Potential values for W and X			
W	Jam location	X	Sensor or door
A	Input area	0	Envelope feeder

Potential values for W and X

W	Jam location	X	Sensor or door
A	Input area	1	Tray 1 feed (unless Tray 1 feed is the registration sensor)
A	Input area	2	Tray 2 feed (unless Tray 2 feed is the registration sensor)
A	Input area	3	Tray 3 feed
A	Input area	4	Tray 4 feed
A	Input area	5	Tray 5 feed
A	Input area	6	Tray 6 feed
A	Input area	7	Optional tray exit sensor
A	Input area	A	Door 1
A	Input area	B	Door 2
A	Input area	C	Door 3
A	Input area	D	Door 4
A	Input area	E	Door 5
A	Input area	F	Multiple sensors or doors
B	Image area	0	Media sensor for forbidden transparencies
B	Image area	2	Registration/top of page
B	Image area	3	Top of page
B	Image area	4	Loop
B	Image area	5	Fuser input
B	Image area	9	Fuser output
B	Image area	A	Door 1
B	Image area	B	Door 2
B	Image area	F	Multiple sensors or doors
C	Switchback area (between the fuser and the output bin)	1	Intermediate switchback sensor
C	Switchback area (between the fuser and the output bin)	2	Switchback media stay sensor

Potential values for W and X

W	Jam location	X	Sensor or door
C	Switchback area (between the fuser and the output bin)	3	Paper delivery sensor
D	Duplex area	1	Duplex switchback
D	Duplex area	2	Duplex delivery
D	Duplex area	3	Duplex refeed
D	Duplex area	A	Door 1 (if different than the imaging area)
D	Duplex area	B	Door 2 (if different than the imaging area)
D	Duplex area	F	Multiple sensors or doors
E	Output or intermediate paper transport unit (IPTU) area	1	Output bin full sensor
E	Output or intermediate paper transport unit (IPTU) area	2	IPTU feed sensor 1
E	Output or intermediate paper transport unit (IPTU) area	3	IPTU sensor 2
E	Output or intermediate paper transport unit (IPTU) area	4	IPTU sensor 3
E	Output or intermediate paper transport unit (IPTU) area	5	IPTU bin full sensor 4
E	Output or intermediate paper transport unit (IPTU) area	6	Output sensor
E	Output or intermediate paper transport unit (IPTU) area	A	Door 1
E	Output or intermediate paper transport unit (IPTU) area	F	Multiple sensors or doors
F	Multiple subsystems (occurs when paper is stuck in several areas)	F	Multiple sensors or doors
1	Jetlink input device	4	Tray 4 feed sensor
1	Jetlink Input device	5	Tray 5 feed sensor
1	Jetlink Input device	6	Tray 6 feed sensor
1	Jetlink Input device	7	Tray 7 feed sensor

Potential values for W and X

W	Jam location	X	Sensor or door
1	Jetlink Input device	8	Tray 8 feed sensor
1	Jetlink Input device	9	Tray 9 feed sensor
1	Jetlink Input device	A	Door 1
1	Jetlink Input device	B	Door 2
1	Jetlink Input device	F	Multiple sensors or doors
2	Buffer pass unit	0	Buffer pass inlet sensor
2	Buffer pass unit	9	Buffer pass exit sensor
2	Buffer pass unit	A	Door 1
3	Page insert unit	0	Page insertion inlet sensor
3	Page insert unit	1	Page insertion tray 1 feed sensor
3	Page insert unit	2	Page insertion tray 2 feed sensor
3	Page insert unit	3	Page insertion tray 3 feed sensor
3	Page insert unit	4	Page insertion tray 4 feed sensor
3	Page insert unit	7	Output path feed sensor
3	Page insert unit	9	Page insertion exit sensor
3	Page insert unit	A	Door 1
4	Punch unit	0	Puncher inlet sensor
4	Punch unit	1	Puncher jam sensor
4	Punch unit	9	Puncher exit sensor
4	Punch unit	A	Door 1
5	Folding unit	0	Folder inlet sensor
5	Folding unit	1	Folder sensor
5	Folding unit	9	Folder exit sensor
5	Folding unit	A	Door 1
6	Stacker unit	0	Stacker inlet sensor
6	Stacker unit	4	Stacker outlet sensor
6	Stacker unit	7	Stacker switchback entrance sensor
6	Stacker unit	8	Stacker switchback registration sensor

Potential values for W and X

W	Jam location	X	Sensor or door
6	Stacker unit	9	Stacker switchback lower sensor
7	Multi-bin mailbox (MBM) unit	0	MBM inlet sensor
7	Multi-bin mailbox (MBM) unit	1	MBM middle sensor
7	Multi-bin mailbox (MBM) unit	9	Stapler sensor
7	Multi-bin mailbox (MBM) unit	A	Door 1
7	Multi-bin mailbox (MBM) unit	B	Door 2
7	Multi-bin mailbox (MBM) unit	C	Door 3
7	Multi-bin mailbox (MBM) unit	F	Multiple sensors or doors
8	Stapler/stacker (SS) unit	0	SS inlet sensor
8	Stapler/stacker (SS) unit	1	SS Bin Z
8	Stapler/stacker (SS) unit	3	SS unit middle sensor
8	Stapler/stacker (SS) unit	4	SS unit outlet sensor 1
8	Stapler/stacker (SS) unit	5	SS unit outlet sensor 2
8	Stapler/stacker (SS) unit	9	Stapler sensor
8	Stapler/stacker (SS) unit	A	Door 1
8	Stapler/stacker (SS) unit	B	Door 2
9	Booklet maker unit	0	Booklet maker input sensor
9	Booklet maker unit	2	Booklet maker feed sensor 2
9	Booklet maker unit	2	Booklet maker feed sensor 3
9	Booklet maker unit	4	Booklet maker delivery sensor
9	Booklet maker unit	5	Booklet maker vertical paper path sensor
9	Booklet maker unit	6	Booklet unit front staple sensor
9	Booklet maker unit	7	Booklet unit rear staple sensor
9	Booklet maker unit	8	Booklet unit outlet sensor
9	Booklet maker unit	A	Door 1
9	Booklet maker unit	B	Door 2
9	Booklet maker unit	C	Door 3
9	Booklet maker unit	F	Multiple sensors or doors

Potential values for W and X			
W	Jam location	X	Sensor or door
0	Unknown	0	Unknown
Potential values for Y (jam condition)			
Y	Jam condition		
0	Unknown		
1	Unexpected sheet (duplex)		
2	Staple jam		
3	Jam caused by an open door (duplex)		
4	Stay jam (the page never left the tray – duplex)		
A	Stay jam (the page never left the tray – simplex)		
B	Multifeed		
C	Wrap		
D	Delay (the page did not reach the sensor within the expected time – simplex)		
E	Door open		
F	Residual (paper is detected in the paper path when it should not be there)		

The information represented by the value for Z depends on where the paper is in the paper path.

Potential values for Z (source, fuser mode, or destination)		
Paper location	Z	Source, fuser mode, or destination
When paper has not reached the fuser, Z represents the paper source.	1	Tray 1
Z represents the paper source.	2	Tray 2
Z represents the paper source.	3	Tray 3
Z represents the paper source.	4	Tray 4
Z represents the paper source.	5	Tray 5
Z represents the paper source.	6	Tray 6
Z represents the paper source.	D	Duplexer
Z represents the paper source.	E	Envelope feeder

Potential values for Z (source, fuser mode, or destination)		
Paper location	Z	Source, fuser mode, or destination
<p>When paper has reached the fuser, is in the duplex path, or in the output path, Z represents the fuser mode.</p> <p>Jams can occur when there is a mismatch between the actual paper and the fuser mode setting.</p>	0	Photo 1, 2, or 3 Designated 2 or 3
Z represents the fuser mode.	1	Normal (automatically sensed rather than based on the paper type set at the control panel)
Z represents the fuser mode.	2	Normal (based on the paper type set at the control panel)
Z represents the fuser mode.	3	Light 1, 2, or 3
Z represents the fuser mode.	4	Heavy 1
Z represents the fuser mode.	5	Heavy 2
Z represents the fuser mode.	6	Heavy 3
Z represents the fuser mode.	7	Glossy 1
Z represents the fuser mode.	8	Glossy 2
Z represents the fuser mode.	9	Glossy 3
Z represents the fuser mode.	A	Glossy Film
Z represents the fuser mode.	B	Transparency
Z represents the fuser mode.	C	Label
Z represents the fuser mode.	D	Envelope 1, 2, or 3
Z represents the fuser mode.	E	Rough
<p>When paper has entered the output bin, Z represents the output bin, numbered from top to bottom.</p>	0	Unknown bin
Z represents the output bin	1	Bin 1
Z represents the output bin	2	Bin 2
Z represents the output bin	3	Bin 3
Z represents the output bin	4	Bin 4
Z represents the output bin	5	Bin 5

Potential values for Z (source, fuser mode, or destination)		
Paper location	Z	Source, fuser mode, or destination
Z represents the output bin	6	Bin 6
Z represents the output bin	7	Bin 7
Z represents the output bin	8	Bin 8
Z represents the output bin	9	Bin 9
All paper locations	E	Door open jam
All paper locations	F	Residual jam
All paper locations	0	Forbidden OHT jam (when Y=2)

Recommended action for customers

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Make sure the type and quality of the paper being used meets the HP specifications for the printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. Open all doors and covers and ensure the paper path is completely clear of paper or obstructions.
7. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

To prevent future paper jams in the printer, follow these recommendations:

- Use only paper that meets HP specifications for this printer.

For more information, refer to the printer User Guide or the [HP LaserJet Print Media Guide](#).

- Make sure the printing environment is within recommended specifications.
- Do not use paper that is wrinkled, folded, or damaged.
- Do not overload the tray with paper.
- Make sure that the paper guides in the tray are adjusted correctly for the size of paper.
- Make sure that the tray is fully inserted in the printer.
- If printing on heavy, embossed, or perforated paper, use the manual feed feature and feed sheets one at a time.

- Open the Trays menu on the printer control panel. Verify that the tray is configured correctly for the paper type and size.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Follow the instructions on the control panel to clear the jam. Check for paper in all possible jam locations.
2. Verify that no doors are open.
3. Check the paper tray to make sure paper is loaded correctly. The paper guides should be adjusted to the correct size, and the tray should not be filled above the maximum fill marks or tabs.
4. Verify that the paper meets specifications for this printer.
5. Use a damp, lint-free cloth to clean the rollers in the appropriate tray. Replace rollers that are worn.
6. If the issue persists, open the Administration > Troubleshooting > Diagnostic Tests > Component Test menu, and perform the appropriate pickup/feed motor drive test. Replace the pickup assembly if the test fails.
7. Perform the Tray/Bin Manual Sensor test to verify the sensors are functioning. If the sensors fail the test, first verify that all connections on the DC controller are correctly seated. If possible replace the sensor or assembly it is associated with.
8. If the sensors pass the test, look for blockage or damaged parts and replace any damaged parts.
9. If the error persists, elevate the case using the Standard Support Process.

13.00.00

An unknown jam type occurred.

This jam code is not linked to any specific sensors and usually occurs when a sensor is working correctly.


Recommended action for customers

1. Open the right door and clear any paper found inside the printer.
2. Check the fuser unit for any paper and clear the jam.
3. Close the right door and let the printer auto clear and come to ready.
4. If the error persists, please contact customer support.

Recommended action for call-center agents and onsite technicians

This error has been seen to be the result of a poor service where a rear down inner guide was removed and not re-installed. This resulted in paper not being able to enter the IPTU, so it is left partially through the fuser.

1. Open the right door and clear the paper that is stuck inside the printer.
2. Check the printer engine for a missing cover. Show in the following image.

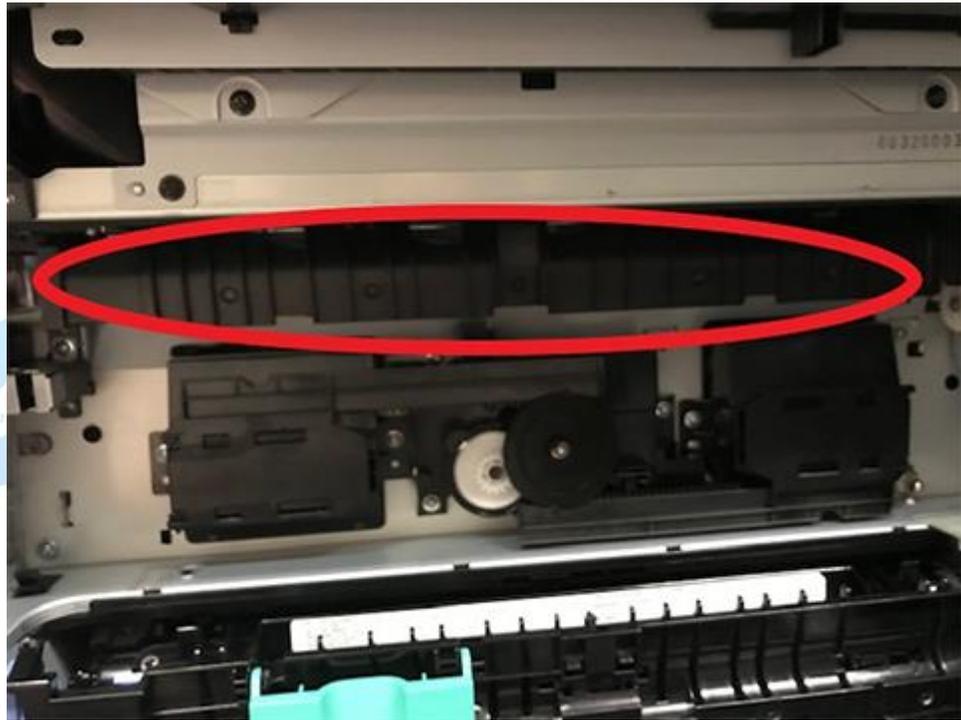

Missing cover

3. If this cover is missing, escalate to the GBU to try to get a replacement from a parts engine.
4. If the cover is present, close the door to allow the printer to attempt to clear the jam.
5. If the error persists, check the entire printer for any paper present in the paper path and remove it.

13.A1.A1 Jam in tray 1

Paper stay jam in tray 1.

This jam occurs when the tray 1 paper feed sensor (SR24) does not detect the trailing edge of the paper within a specified period of time from when the sensor detected the leading edge.

Recommended action

1. Clear the jam in the area indicated.
2. Close the door to allow the printer to attempt to clear the jam.
3. Check tray 1.

- a. Check the tray 1 pickup rollers and replace as needed.

Part number: A2W77-67906

- b. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
- c. Test SR24 to verify that the sensor is functioning correctly.
- d. If the test fails, replace the (tray 1) MP guide assembly.

Part number: RM1-9615-000CN

- e. Run the tray 1 pickup and feed motor drive test to verify that the feed motor is functioning correctly.
- f. If the test fails, replace the (tray 1) MP drive assembly.

Part number: RM1-9843-000CN

4. If tray 1 appears to be functioning correctly, check the T2 roller, the ITB motor, and the ITB.
5. If the error persists, check the event log for the 10.22.70 code and replace any defective parts.
 - If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part or supply under warranty.

For instructions: [Removal and replacement: ITB_Transfer roller](#)

ITB only part number: RY7-5211-000CN

Tray 2 rollers (T2, pickup, feed) only part number: A2W77-67905

Transfer and roller kit part number (contains ITB, T2, pickup, feed): RY7-5213-000CN

ITB motor part number: RM1-4519-000CN

6. Important:
7. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

13.A1.D1 Jam in Tray 1

Paper delay jam in Tray 1.

This jam occurs when the paper does not reach the Tray 1 feed sensor SR24 in the designated amount of time after the start of paper pickup from Tray 1.

This is a no-pick jam from Tray 1.

Recommended action for customers

1. Clear the jam in the area indicated.
2. Close the door to allow the printer to attempt to clear the jam.
3. Check the Tray 1 pickup and feed rollers for wear, damage, or paper dust, and clean or replace the rollers as needed.

Part number: A2W77-67906

Note:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

Recommended action for call-center agents and onsite technicians

1. Clear the jam in the area indicated.
2. Close the door to allow the printer to attempt to clear the jam.
3. Check the Tray 1 pickup and feed rollers for wear, damage, or paper dust, and clean or replace the rollers as needed.

Part number: A2W77-67906

Note:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

4. Check the Tray 1 Sensor.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Tray/Bin Manual Sensor Test

FutureSmart 4

- Support Tools

- Troubleshooting
 - Diagnostic Tests (touch continue)
 - Tray/Bin Manual Sensor Test
- b. Test SR24 to verify that the sensor is functioning correctly.
 - c. If the test fails, replace the (Tray 1) MP guide assembly.

Part number: RM1-9615-000CN

- d. Run the Tray 1 pickup and feed motor drive test to verify that the feed motor is functioning correctly.
- e. If the test fails, replace the (Tray 1) MP drive assembly.

Part number: RM1-9843-000CN

5. If Tray 1 appears to be functioning correctly, check the T2 roller, the ITB motor, and the ITB.
6. If the error persists, check the event log for the 10.22.70 code and replace any defective parts.
 - If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part or supply under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

ITB only part number: RY7-5211-000CN

Tray 2 rollers (T2, pickup, feed) only part number A2W77-67905

Transfer and roller kit part number (contains ITB, T2, pickup, feed) RY7-5213-000CN

ITB motor part number: RM1-4519-000CN

7. Important:
8. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

13.A1.D3, 13.A1.D4, or 13.A1.D5 Paper delay jam

Paper delay jam at sensor SR24.

This jam occurs when the paper does not reach the feed sensor SR24 in the designated amount of time after the start of paper pickup from trays 3, 4, or 5.

This issue is a corner case and happens when heavy, rigid, or extra rough paper is used from the optional paper input trays.


In this unique case, the jams **only** occur when feeding from the optional input device. Jobs printing from tray 1 or 2 will feed normally. This occurs when the plastic rib on the lower right door that is part of the MP paper pickup assembly gets damaged. This issue usually coincides with having engine cycles above 150,000 pages and using heavy paper.

The optional feeder trays take a different path to SR24 than tray 1. The optional feeders use the lower part of right door to help direct the paper up into the feed roller assembly which has the feed rollers and SR24. This area helps send the paper on to registration assembly. Tray 1 feeds directly in to the feed roller assembly.

Recommended action

1. Check the engine cycles for the printed page usage. Make sure that it's over 150,000 pages and is consistent with the cause of this error.
2. Check the type of paper that is being used in the optional feeder trays, and remove any heavy, rigid, or rough paper, and then replace it with regular paper.
3. Run a paper path test from all trays to ensure that the issue is only with the optional input feeder. If tray 1 exhibits a 13.A1.D1 error, skip to the next step. If the issue occurs from the optional input feeder trays only, perform the following steps:
 - a. Open the lower right door.


Lower right door area to check for damage

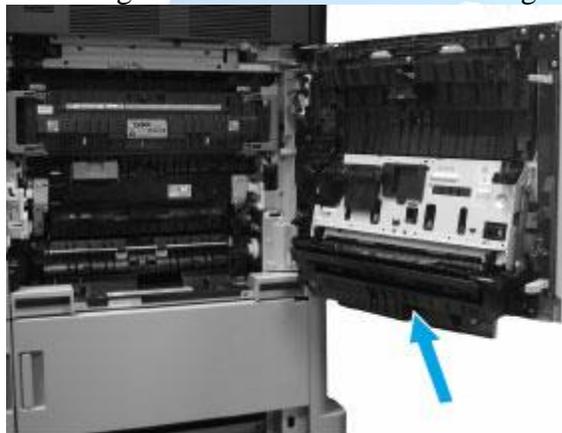

- b. Check all of the lower right door ribs for damage, cracks, or cuts.

Note:

Make sure to check all of the ribs and not only those shown in the call-outs. Small cuts, cracks, or nicks due to heavier than normal paper being constantly fed from the optional input trays can cause the paper to jam.

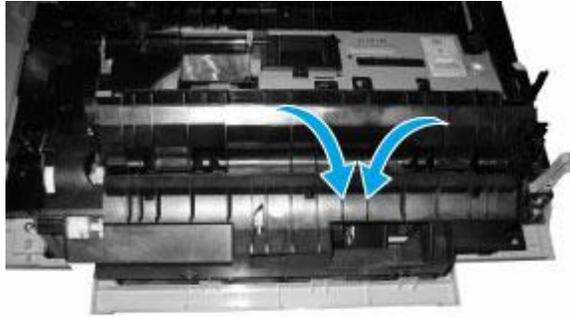

Example of the small ribs

- c. If this damage is seen on the ribs, replace the MP paper pickup assembly that contains the affected rib or ribs.



Close-up of small cracks or nicks on two ribs

Part number: RM1-9644-000CN

Note:

Do not replace parts from the input device or the input device paper path of the printer. These parts will not resolve this issue.

4. Clear the jam in the area indicated.
5. Close the door to allow the printer to attempt to clear the jam.
6. Check tray 1.
 - a. Check the tray 1 pickup and feed rollers for wear, damage, or paper dust, and clean or replace the rollers as needed.

Part number: A2W77-67906

- b. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
- c. Test SR24 to verify that the sensor is functioning correctly.
- d. If the test fails, replace the (tray 1) MP guide assembly.

Part number: RM1-9615-000CN

- e. Run the tray 1 pickup and feed motor drive test to verify that the feed motor is functioning correctly.
- f. If the test fails, replace the (tray 1) MP drive assembly.

Part number: RM1-9843-000CN

7. If tray 1 appears to be functioning correctly, check the T2 roller, the ITB motor, and the ITB.
8. If the error persists, check the event log for the 10.22.70 code and replace any defective parts.
 - If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part or supply under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

ITB only part number: RY7-5211-000CN

Tray 2 rollers (T2, pickup, feed) only part number A2W77-67905

Transfer and roller kit part number (contains ITB, T2, pickup, feed) RY7-5213-000CN

ITB motor part number: RM1-4519-000CN

9. Important:
10. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

13.A1.FF

Residual paper jam in tray 1.

This jam occurs when residual paper is detected at the tray 1 feed sensor (SR24) at power on.

Recommended action

1. Clear the jam in the area indicated.
2. Close the door to allow the printer to attempt to clear the jam.
3. Test SR24 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR24, and then manually move the sensor to ensure that it moves freely and responds correctly to the sensor test.
4. If the sensor test fails or the flag is damaged, replace the (tray 1) MP guide assembly.

Part number: RM1-9615-000CN

5. If the sensor test passes and the error persists, run the tray 1 pickup and feed motor drive test and verify that the feed motor is functioning correctly.
6. If the test fails, replace the (tray 1) MP drive assembly.

Part number: RM1-9843-000CN

13.A2.A2 Jam in tray 2

Paper stay jam in tray 2.

This jam occurs when the tray 2 paper feed sensor (SR22) does not detect the trailing edge of the paper within a specified period of time from when the sensor detected the leading edge.

Recommended action

1. Open tray 2 and remove any jammed paper.
2. Open and close the upper right door to allow the printer to attempt to clear the jam.
3. Check tray 2.
 - a. Make sure the tray 2 pickup, feed, and separation rollers are installed correctly.
 - b. Clean the pickup and feed rollers as needed, and replace any that show damage or wear.

Part number: A2W77-67905

- c. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
- d. Select Manual Sensor Test to test SR22 and verify that the sensor is functioning correctly.
- e. Run the tray 2 pickup and feed motor drive test to verify that the feed motor is functioning correctly.

- f. If either test fails, check the connectors (J110 and J1922) at the sensor, feed motor, and the DC controller PCA.
- g. If the error persists and the connectors are not damaged, replace the paper pickup assembly.

Part number: RM1-9599-000CN

4. If tray 2 appears to be functioning correctly, check the T2 roller, ITB motor, and ITB.
5. If the error persists, check the event log for the 10.22.70 code and replace any defective parts.
 - o If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - o If an active low warning is not listed, replace the part or supply under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

ITB only part number: RY7-5211-000CN

Tray 2 rollers (T2, pickup, feed) only part number: A2W77-67905

Transfer and roller kit part number (contains ITB, T2, pickup, feed): RY7-5213-000CN

ITB motor part number: RM1-4519-000CN

6. Important:
7. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

13.A2.D2 Jam in tray 2

Jam in tray 2.

This jam occurs when the paper does not reach the tray 2 feed sensor (SR22) in the designated amount of time after the start of paper pickup from tray 2.

Recommended action

1. Open tray 2 and remove any jammed paper.
2. Open and close the upper right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 2 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.


Part number: A2W77-67905

Note:

Make sure to use the correct rollers.



Correct rollers inserted in the Tray

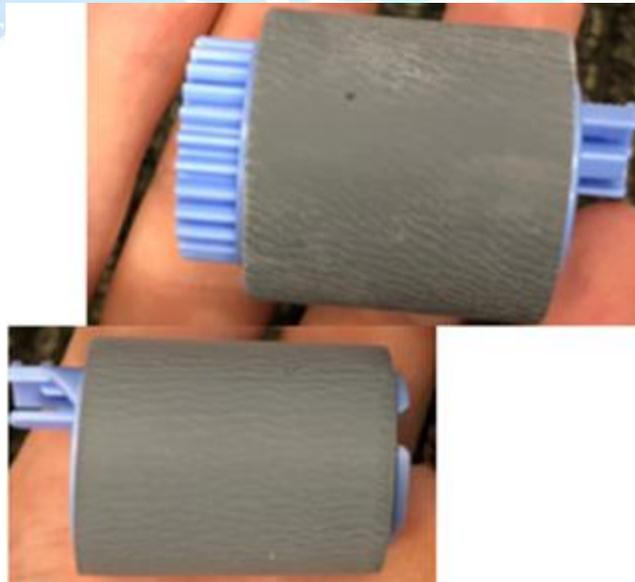

Incorrect rollers

5. Run the tray 2 pickup and feed motor drive test to verify that the feed motor is functioning correctly.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Component Test

FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Component Test
6. If the test fails, test SR22 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR22.
 7. If either test fails, check the connectors (J110 and J1922) at the sensor, feed motor, and the DC controller PCA.
 8. If the error persists, replace the paper pickup assembly.

Part number: RM1-9599-000CN

13.A2.FF Paper Jam

Residual paper Jam in tray 2.

This jam occurs when residual paper is detected at the tray 2 feed sensor (SR22).

Recommended action

1. Open tray 2, remove any jammed paper, and then close the tray.
2. Open and close the upper right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 2 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Check the connectors at the sensor, feed motor, and the DC controller PCA.
6. Test SR22 and verify that the sensor is functioning correctly.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Manual Sensor Test

FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Manual Sensor Test
- b. Select SR22.
7. Run the tray 2 pickup and feed motor drive test to verify that the feed motor is functioning correctly (listen for the motor to activate).
- a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Component Test
8. If either test fails, check the connectors (J110 and J1922) at the sensor, feed motor, and the DC controller PCA.
9. If the error persists, replace the paper pickup assembly.

Part number: RM1-9599-000CN

13.A3.A3 Jam in tray 3

Paper stay jam in tray 3.

1x500 or 3x500 Sheet paper deck

This jam occurs when the tray 3 paper feed sensor (SR112) does not detect the trailing edge of the paper within a specified period of time from when the sensor detected the leading edge.

3,500 sheet high-capacity input (HCI) feeder

This jam occurs when the tray 3 paper feed sensor (PS3302) does not detect the trailing edge of the paper within a specified period of time from when the sensor detected the leading edge.

1x500 or 3x500 sheet paper deck

1. Open tray 3, remove any jammed paper, and then close the tray.
2. Open and close right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 3 pickup, feed and separation roller are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Test SR112 and verify that the sensor is functioning correctly.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Manual Sensor Test

FutureSmart 4

- Support Tools
- Troubleshooting
- Diagnostic Tests (touch Continue).
- Manual Sensor Test

- b. Select SR112.
6. Check the connectors (J8113 and J1982) at the sensor, feed motor, and the HCI controller PCA to ensure that they are seated correctly and are not damaged.
7. If the error persists, replace the paper pickup assembly.

Part number: RM2-0275-000CN

8. Run the tray 3 pickup and feed motor drive test.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Component Test
9. If the test fails, replace the stepping motor DC (M112) (HCI).

Part number: RK2-1331-000CN

3,500 sheet high-capacity input (HCI) feeder

1. Open tray 3, remove any jammed paper, and then close the tray.
2. Open and close right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 3 pickup, feed and separation rollers are installed correctly.
4. Clean the pickup and feed rollers and replace any that show damage or wear.

Part number: A2W77-67905

5. Test PS3302 to verify that the sensor is functioning correctly.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting

- Diagnostic Tests
- Manual Sensor Test

FutureSmart 4

- Support Tools
- Troubleshooting
- Diagnostic Tests (touch Continue).
- Manual Sensor Test

- b. Select PS3302.
6. If the sensor test fails, check the connectors (J3005 and J907) at the sensor, feed motor, and the HCI controller PCA to ensure that they are seated correctly and are not damaged.
7. If the error persists and the connectors are not damaged, replace the cassette paper pickup assembly.

Part number: RM1-8876-000CN

8. Run the tray 3 pickup and feed motor drive test.
9. If the test fails, replace the stepping motor.

Part number: RK2-1331-000CN

10. If the error persists, replace the right cassette paper pickup assembly.

Part number: RM1-8869-000CN

13.A3.D3 Jam in tray 3

Paper delay jam in tray 3.

This is a no-pick jam from tray 3.

- **1x500 or 3x500 Sheet paper deck**

This jam occurs when the paper does not reach the tray 3 feed sensor (SR112) in the designated amount of time after the start of paper pickup from tray 3.

- **3,500 sheet high-capacity input (HCI) feeder**

This jam occurs when the paper does not reach the tray 3 feed sensor (PS3302) in the designated amount of time after the start of paper pickup from tray 3.

1x500 or 3x500 sheet paper deck

1. Open tray 3, remove any jammed paper, and then close the tray.
2. Open and close the door to allow the printer to attempt to clear the jam.

3. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.


Part number: A2W77-67905

Note:

Make sure to use the correct rollers.



Correct rollers inserted in the tray

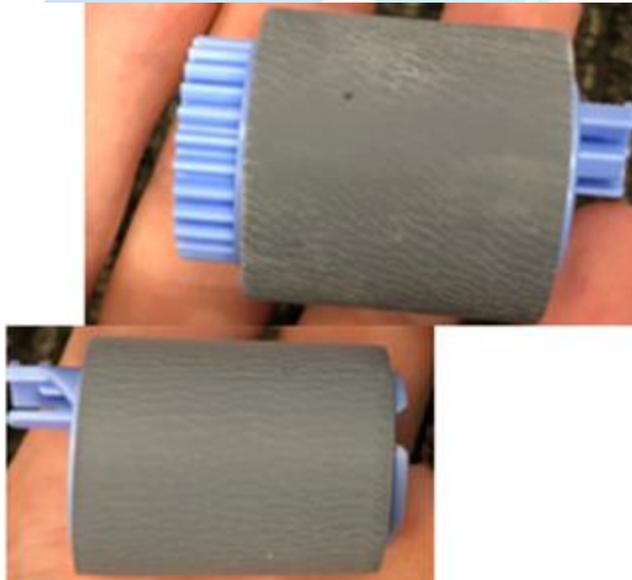

Incorrect rollers

5. Test SR112 to verify that the sensor is functioning correctly.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Sensor Tests

FutureSmart 4

- Support Tools
- Troubleshooting
- Diagnostic Tests (touch Continue).
- Manual Sensor Test

- b. Select SR112.
6. If the test fails, check the connectors (J8113 and J1982) at the sensor, feed motor, and the controller PCA to ensure that they are seated correctly and are not damaged.
7. If the error persists and the connectors are not damaged, replace the paper pickup assembly.

Part number: RM2-0275-000CN

8. If the error persists, use the Component Test to test the tray 3 pickup and feed motor drive.
9. If the test fails, replace the stepping motor.

Part number: RK2-1331-000CN

3,500 sheet high-capacity input (HCI) feeder

1. Open tray 3, remove any jammed paper, and then close the tray.
2. Open and close the HCI right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly.
4. Clean the pickup and feed rollers and replace any that show no damage or wear.


Part number: A2W77-67905

Note:

Make sure to use the correct rollers.



Correct rollers inserted in the tray

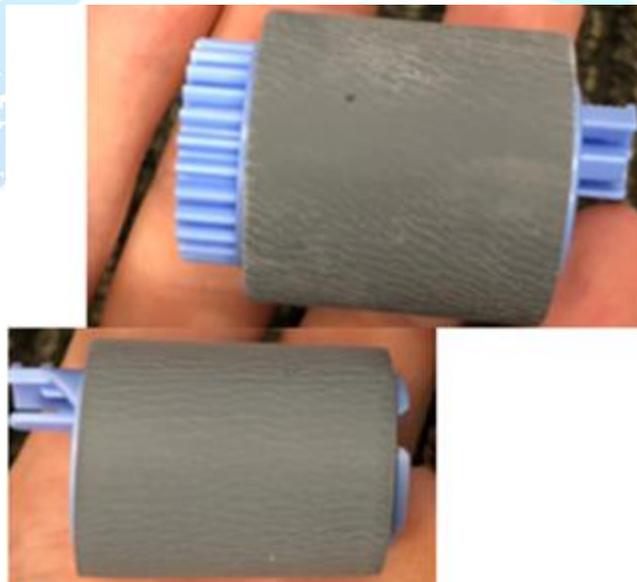

Incorrect rollers

5. Test PS3302 and verify that the sensor is functioning correctly.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Sensor Tests

FutureSmart 4

- Support Tools
- Troubleshooting

- Diagnostic Tests (touch Continue).
 - Manual Sensor Test
- b. Select PS3302.
6. Use the Component Test to test the tray 3 pickup and feed motor drive to verify that the motor is functioning correctly.
 7. If either test fails, check the connectors (J3005 and J907) at the sensor, feed motor, and the HCI controller PCA and test again.
 8. If the error persists and the connectors are not damaged, replace the tray pickup motor (stepping motor).

Part number: RK2-1331-000CN

9. If the error persists, replace the right cassette paper pickup assembly.

Part number: RM1-8869-000CN

13.A3.FF Paper Jam

Residual paper jam in tray 3.

- **1x500 or 3x500 Sheet paper deck**

This jam occurs when residual paper is detected at the tray 3 feed sensor (SR112) at power on.

- **3,500 sheet high-capacity input (HCI) feeder**

This jam occurs when residual paper is detected at the tray 3 feed sensor (PS3302) at power on.

1x500 or 3x500 sheet paper deck

1. Open tray 3, remove any jammed paper, and then close the tray.
2. Open and close the HCI right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Test the SR112 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test

- b. Select the SR112.
6. Use the Component Test to run the tray 3 pickup and feed motor drive test to make sure that the feed motor is functioning correctly.
7. Check the connectors (J8113 and J1982) on the HCI controller PCA to ensure that they are seated correctly and are not damaged.
8. If the error persists, replace the paper pickup assembly.

Part number: RM2-0275-000CN

3,500 sheet high-capacity input (HCI) feeder

1. Open tray 3, remove any jammed paper, and then close the tray.
2. Open and close the HCI right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Test PS3302 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select PS3302.
6. Use the Component Test to run the tray 3 pickup and feed motor drive test and verify that the feed motor is functioning correctly.
7. Check the connectors (J8113 and J1982) to the HCI controller PCA to ensure that they are seated correctly and are not damaged.
8. If the error persists, replace the paper pickup drive assembly (left).

Part number: RM1-8872-000CN

9. If the error persists, replace the paper pickup drive assembly (right).

Part number: RM1-8872-000CN

13.A4.D4 Jam in tray 4

Jam in tray 4.

This is a no-pick jam from tray 4.

- **3x500 Sheet paper deck**

This jam occurs when the paper does not reach the tray 4 feed sensor (SR122) in the designated amount of time after the start of paper pickup from tray 4.

- **3,500 sheet high-capacity input (HCI) feeder**

This jam occurs when the paper does not reach the tray 4 feed sensor (PS3305) in the designated amount of time after the start of paper pickup from tray 4.

3x500 sheet paper deck

1. Open tray 4, remove any jammed paper, and then close the tray.
2. Open and close the HCI right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 4 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Test SR122 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR122.
6. Use the Component Test to run the tray 4 pickup and feed motor drive test and verify that the feed motor is functioning correctly.
7. Check the connectors (J8113 and J1751) on the HCI controller PCA to ensure that they are seated correctly and are not damaged.
8. If the error persists, replace the tray pickup assembly.

Part number: RM2-0275-000CN

3,500 sheet high-capacity input (HCI) feeder

1. Open tray 4, remove any jammed paper, and then close the tray.
2. Open and close the HCI right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 4 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Test PS3305 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration

- Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
- b. Select PS3305.
6. Use the Component Test to run the tray 4 pickup and feed motor drive test and verify that the feed motor is functioning correctly.
 7. Check the connectors (J8113 and J1982) on the HCI controller PCA to ensure that they are seated correctly and are not damaged.
 8. If the error persists and the connectors are not damaged, replace the paper pickup drive assembly.

Part number: RM1-8872-000CN

9. If the error persists, replace the paper pickup assembly (HCI, left).

Part number: RM1-8876-000CN

13.A4.FF Paper Jam

Residual paper jam in tray 4.

- **3X500 Sheet paper deck**

This jam occurs when residual paper is detected at the tray 4 feed sensor (SR122) at power on.

- **3,500 sheet high-capacity input (HCI) feeder**

This jam occurs when residual paper is detected at the tray 4 feed sensor (PS3302) at power on.

3x500 sheet paper deck

1. Open tray 4, remove any jammed paper, and then close the tray.
2. Open and close the HCI right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 4 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Test SR122 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests

- Manual Sensor Test
 - b. Select SR122.
6. Use the Component Test to run the tray 4 pickup and feed motor drive test and verify that the feed motor is functioning correctly.
 7. Check the connectors at the sensor, feed motor, and the HCI controller PCA to ensure that they are seated correctly and are not damaged.
 8. If the error persists, replace the tray pickup assembly.

Part number: RM2-0275-000CN

3,500 sheet high-capacity input (HCI) feeder

1. Open tray 4, remove any jammed paper, and then close the tray.
2. Open and close the HCI right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 4 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Test PS3302 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select PS3302.
6. Use the Component Test to run the tray 4 pickup and feed motor drive test and verify that the feed motor is functioning correctly.
7. Check the connectors at the sensor, feed motor, and the HCI controller PCA to ensure that they are seated correctly and are not damaged.
8. If the error persists, replace the tray pickup assembly.

Part number: RM1-8876-000CN

13.A5.D5 Jam in tray 5

Jam in tray 5.

This jam occurs when the paper does not reach the tray 5 feed sensor SR132 in the designated amount of time after the start of paper pickup from tray 5.

This is a no-pick jam from tray 5.

Recommended action

1. Open tray 5, remove any jammed paper, and then close the tray.
2. Open and close the HCI right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 5 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Test SR132 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR132.
6. Check the connectors at the sensor, feed motor, and the HCI controller PCA to ensure that they are seated correctly and are not damaged.
7. Use the Component Test to run the tray 5 pickup and feed motor drive test and verify that the feed motor is functioning correctly.
8. If the test fails, replace the paper pickup drive assembly.

Part number: RM1-8872-000CN

9. If the error persists, replace the paper pickup assembly (HCI).

Part number: RM1-8876-000CN

13.A5.FF Paper Jam

Residual paper jam in tray 5.

This jam occurs when residual paper is detected at the tray 5 feed sensor (SR132) at power on.

Recommended action

1. Open tray 5, remove any jammed paper, and then close the tray.
2. Open and close the HCI right door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 5 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Test SR132 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration

- Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
- b. Select SR132.
6. Use the Component Test to run the tray 5 pickup and feed motor drive test and verify that the feed motor is functioning correctly.
 7. If the test fails, check the connectors at the sensor, feed motor, and the HCI controller PCA to ensure that they are seated correctly and are not damaged.
 8. If the test fails and the connectors are not damaged, replace the paper pickup drive assembly.

Part number: RM1-8872-000CN

9. If the error persists, replace the paper pickup assembly (HCI).

Part number: RM1-8876-000CN

13.A7.D3 Jam in lower right door

Jam in lower right door from tray 3.

This jam occurs when the paper does not reach the HCI feed sensor (PS3301) in the designated amount of time after the tray 3 feed sensor (PS3302) sensed the leading edge of the paper when printing from tray 3.

Recommended action

1. Clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Test PS3301 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select PS3301.
6. If the sensor test fails, check the connectors at the sensor and the HCI controller PCA to ensure that they are seated correctly and are not damaged.
7. If the sensor test failed and the connectors are not damaged, replace the merge feed assembly.

Part number: RM2-0270-000CN

8. Use the Component Test to run the tray 3 pickup and feed motor drive test and verify that the feed motor is functioning correctly.
9. If the motor test fails, check the connectors at the feed motor and the HCI controller PCA to ensure that they are seated correctly and are not damaged.
10. If the error persists, replace the paper pickup drive assembly.

Part number: RM1-8872-000CN

13.A7.D4 Jam in lower right door

Jam in lower right door from tray 4.

This jam occurs when the paper does not reach the HCI feed sensor (PS3301) in the designated amount of time after the tray 4 feed sensor (PS3305) sensed the leading edge of the paper when printing from tray 4.

Recommended action

1. Clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 4 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Test PS3301 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select PS3301.
6. If the sensor test fails, check the connectors at the sensor and the HCI controller PCA to ensure that they are seated correctly and are not damaged.
7. If the sensor test failed and the connectors are not damaged, replace the merge feed assembly.

Part number: RM2-0270-000CN

8. Use the Component Test to run the tray 4 pickup and feed motor drive test and verify that the feed motor is functioning correctly.
9. If the motor test fails, check the connectors at the feed motor and the HCI controller PCA to ensure that they are seated correctly and are not damaged.

10. If the error persists, replace the paper pickup drive assembly.

Part number: RM1-8872-000CN

13.A7.FF Paper Jam

Residual paper jam in high capacity input (HCI).

This jam occurs when residual paper is detected at the HCI feed sensor (PS3301) at power on.

Recommended action

1. Clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 3 and tray 4 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Run a Paper Path Test from both tray 3 and tray 4 to verify in which tray the issue is occurring.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Paper Path Test
6. Test PS3301 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select PS3301.
7. Use the Component Test to run the tray 3 and tray 4 pickup and feed motor drive test and verify that the feed motor is functioning correctly.
8. If the test fails, check the connectors at the sensor, feed motor, and the HCI controller PCA to ensure that they are seated correctly and are not damaged.
9. If the test fails and the connectors are not damaged, replace the paper pickup drive assembly.

Part number: RM1-8872-000CN

10. If the error persists, run the intermediate feed motor drive test to verify that the feed motor is functioning correctly.
11. If the test fails, replace the merge drive assembly and/or merge assembly.

Part number: RM2-0270-000CN

13.A8.D3, 13.A8.D4, or 13.A8.D5 Jam in upper right door

Jam in upper right door.

- **1X500 or 3X500 Sheet paper deck**

This jam occurs when the paper does not reach the feed sensor (SR24) in the designated amount of time after the tray 3 feed sensor (SR112) sensed the leading edge when printing from tray X.

- **3,500 sheet high-capacity input (HCI) feeder**

Jam occurs when the paper does not reach the feed sensor (SR24) in the designated amount of time after the HCI Exit sensor (PS3301) sensed the leading edge when printing from tray 3 or tray 4

- D3 = tray 3
- D4 = tray 4
- D5 = tray 5

1x500 or 3x500 sheet paper deck

1. Clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Ensure that the tray 3 pickup, feed, and separation rollers are installed correctly and show no damage or wear.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Run the tray pickup and intermediate feed motor drive test and verify that the feed motor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Component Test
6. If the test fails, test the SR112 and verify that the sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests

- Manual Sensor Test
 - b. Select SR112.
7. If either test fails, check the connectors at the sensor, feed motor, and the HCI controller PCA to ensure that they are seated correctly and are not damaged.
 8. If the error persists, replace the paper pickup assembly.

Part number: RM2-0275-000CN

3,500 sheet high-capacity input (HCI) feeder

1. Clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Run a paper path test from both tray 3 and tray 4 to validate the issue.
4. Clean or replace the pickup and feed rollers as needed.

Part number: A2W77-67905

5. Test PS3301 and verify that the sensor is functioning correctly.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Sensor Tests

FutureSmart 4

- Support Tools
- Troubleshooting
- Diagnostic Tests (touch Continue).
- Manual Sensor Test

- b. Select PS3301.
6. Run the intermediate feed motor drive test to verify that the feed motor is functioning correctly.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Component Test

FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Component Test
7. Check the connectors at the sensor, feed motor, and the HCI controller PCA to ensure that they are seated correctly and are not damaged.
 8. If the error persists, replace the merge drive assembly and/or merge assembly.

Part number: RM2-0270-000CN

13.AA.EE Paper Jam

HCI door open jam.

- **1x500 or 3x500 Sheet paper deck**

This jam occurs when the HCI right door (SW113) is opened during printing.

- **3,500 sheet high-capacity input (HCI) feeder**

This jam occurs when the HCI right door (SW3301) is opened during printing.

1x500 or 3x500 sheet paper deck

1. Close the lower right door to allow the printer to attempt to clear the jam.
2. Test SW113 and verify that the switch is functioning correctly.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Tray/Bin Manual Sensor Test

FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Tray/Bin Manual Sensor Test
- b. Select SW113.
3. If the error persists, replace the sensor assembly (switch).

Part number: WC2-5512-000CN

3,500 sheet high-capacity input (HCI) feeder

1. Close the lower right door to allow the printer to attempt to clear the jam.
2. Test SW3301 and verify that the switch is functioning correctly.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Tray/Bin Manual Sensor Test

FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Tray/Bin Manual Sensor Test
3. If the error persists, replace the sensor assembly (switch).

Part number: WC2-5512-000CN

13.AB.EE Door open jam

HCI door open jam.

This jam occurs when the HCI inner flap door (PS3306) is opened during printing.

Recommended action

1. Close the inner flap door to allow the printer to attempt to clear the jam.
2. Test PS3306 and verify that the sensor is functioning correctly.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Sensor Tests

FutureSmart 4

- Support Tools
- Troubleshooting

- Diagnostic Tests (touch Continue).
 - Manual Sensor Test
 - b. Select PS3306.
3. If the error persists, replace the left tray pickup assembly.

Part number: RM1-8876-000CN

13.B2.Az Jam in right door

Media stay jam at registration sensor (TOP sensor) SR2501.

- **13.B2.A1**

Paper did not reach the registration sensor (SR2501) in the designated amount of time when printing from tray 1.

- **13.B2.A2**

Paper did not reach the registration sensor (SR2501) in the designated amount of time when printing from tray 2.

- **13.B2.A3**

Paper did not reach the registration sensor (SR2501) in the designated amount of time when printing from tray 3.

- **13.B2.A4**

Paper did not reach the registration sensor (SR2501) in the designated amount of time when printing from tray 4.

- **13.B2.A5**

Paper did not reach the registration sensor (SR2501) in the designated amount of time when printing from tray 5.

- **13.B2.AD**

Paper did not reach the registration sensor (SR2501) in the designated amount of time when printing from the duplexer.

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Inspect the paper path and ensure that there is no paper blocking the paper path.

3. Ensure that the tray width guides are set to the correct paper size being installed into the tray. The arrow on the guide should line up exactly with the line connected to paper size designation. Ensure that the tray is not filled above the fill mark on the tray.
4. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
5. Test SR2501 and verify that the registration sensor (TOP sensor) is functioning correctly.

Note:

This sensor is located on the ITB directly in the center.

- a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Sensor Tests

FutureSmart 4

- Support Tools
- Troubleshooting
- Diagnostic Tests (touch Continue).
- Manual Sensor Test

- b. Select SR2501, and then manually move the sensor to ensure that it moves freely and responds correctly to the sensor test.
6. If the sensor test fails, check the event log for the 10.22.70 code and replace the ITB (which contains SR2501 sensor).
 - If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

Part number: RY7-5211-000CN

7. Note:
8. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.
9. If the sensor is functioning correctly, run a few pages to check where the leading edge of the paper actually stops.
10. Check for broken white hooks on the 2nd transfer assembly.
11. If the white hooks are broken, check the event log for the 10.22.70 code and replace the hooks by replacing the registration 2nd transfer assembly.

- If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the part under warranty.

Part number: RM2-6856-000CN

12. Note:

13. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

13.B2.Bz Jam in right door

Multi-feed jam at registration sensor (TOP Sensor) SR2501.

- **13.B2.B1** Multifeed when printing from the tray 1.
- **13.B2.B2** Multifeed when printing from the tray 2.
- **13.B2.B3** Multifeed when printing from the tray 3.
- **13.B2.B4** Multifeed when printing from the tray 4.
- **13.B2.B5** Multifeed when printing from the tray 5.
- **13.B2.BD** Multifeed when printing from the duplexer.

If the issue occurs in tray 1 (13.B2.B1) only when manually duplexing, or printing with pre-printed paper such as letterheads:

This error can occur when manually duplexing, or printing with pre-printed paper like letterhead. This is due to a safety mechanism in the printer that tests for multi-page jams. If the paper sensor 'senses' a multi-page jam (or what it detects to be a thickness of ~.4 mm or greater), it stops the paper from progressing any further and displays the error message. This helps prevent the fuser from being damaged by stopping multiple pages from being fed through it.

Manually duplexed jobs are at risk as there is already toner placed on one side of the paper. The toner can be dense enough in some cases (when the coverage is more than 46% gray coverage) that the sensor will sense the paper as being 'thicker' than what it really is. Automatic duplexing does not turn on the paper sensor when printing the second side therefore the error does not occur in this case.

Pre-printed paper is at risk for the same reasoning, where the pre-printed image may block the paper sensor, making it appear to be thicker than it actually is. If this is the case, the paper will be seen stopping right at the paper sensor MS right by the registration sensor SR2501.

Recommended action

1. Clear the printer and check the paper.
 - a. Open the right door and clear the jam in the indicated area.
 - b. Inspect the paper path and ensure that no paper is blocking the paper path.

- c. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
2. Test all trays by using the same paper to verify whether or not the error occurs in all trays.
3. If the error occurs with all trays, test the paper sensor MS.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Sensor Tests

FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Manual Sensor Test
- b. Select the paper sensor MS, and then manually move the sensor to ensure that it moves freely and responds correctly to the sensor test.

Note: This sensor is located by the registration sensor SR2501.

 - If the paper sensor is not functioning correctly, replace the registration assembly.

Part number: RM2-6856-000CN
 - If the paper sensor is functioning correctly and the issue occurs in all trays, this is a paper specific issue. Use another type of paper.
 4. If the error occurs only with the optional input trays, and tray 1 and tray 2 work OK, Ensure that the printer is seated correctly on the optional input tray (HCI).
 5. If the error occurs only with Tray 1 (13.B2.B1), perform the following steps:
 - . Ensure that the tray width guides are set to the correct paper size being installed into the tray.

Note:

The arrow on the guide should line up exactly with the line connected to paper size designation. Ensure that the tray is not filled above the fill mark on the tray.

- a. Test tray 1 by using a standard size and type of paper.
- b. Ensure that the tray pickup and separation rollers are installed correctly.

Clean the pickup, feed, and separation rollers as needed, and replace any that show damage or wear.

Tray 1 part number: A2W77-67906

6. If the error occurs only when manually duplexing from Tray 1 (13.B2.B1), or only when printing with pre-printed paper such as letterheads from Tray 1 (13.B2.B1), perform the following steps:
 - . Open the following menus:
 - Administration
 - General Settings
 - Print Quality
 - Autosensing Behavior
 - a. Set “Tray 1 Sensing” to “Transparency” to turn off the MS paper sensor.
 - b. If the error persists, replace the multipurpose paper pickup assembly.

Tray 1 part number: RM1-9644-000CN

7. If the error occurs only with tray 2 (13.B2.B2), or with any other tray, tray 3-5 (13.B2.B3, 13.B2.B4, 13.B2.B5), perform the following steps:
 - . Ensure that the tray width guides are set to the correct paper size being installed into the tray.

Note:

The arrow on the guide should line up exactly with the line connected to paper size designation. Ensure that the tray is not filled above the fill mark on the tray.

- a. Ensure that the tray pickup, feed, and separation rollers are installed correctly.
- b. Clean the pickup, feed, and separation rollers as needed, and replace any that show damage or wear.

Tray 2 part number: A2W77-67905

- c. Test tray 2 by using a standard size and type of paper. If standard media works OK, ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
- d. If the error persists, replace the paper pickup assembly.

Tray 2 part number: RM1-9599-000CN

Trays 3-5 part number: RM2-0275-000CN

13 . B2 . Dz

Paper delay jam at registration sensor (TOP sensor) SR2501:

To avoid causing this type of error, handle the 2nd transfer assembly carefully when removing or reinstalling the registration assembly.

The registration assembly tension springs and spring mounting blocks at each end of the 2nd transfer assembly can be easily dislodged. This causes an obstruction for the shutter (de-skew gate) and prevents it from moving freely, which delays the paper from arriving to the registration roller located at the ITB in the designated time.

To resolve the following errors, put the springs in the correct position.

- **13.B2.D1**

Paper did not reach the registration sensor (SR2501) in the designated amount of time after the tray 1 feed sensor (SR24) sensed the leading edge when printing from tray 1.

- **13.B2.D2**

Paper did not reach the registration sensor (SR2501) in the designated amount of time after the tray 2 feed sensor (SR22) sensed the leading edge when printing from tray 2.

- **13.B2.D3**

Paper did reach the registration sensor (SR2501) in the designated amount of time after the tray 2 feed sensor (SR24) sensed the leading edge when printing from tray 3.

- **13.B2.D4**

Paper did reach the registration sensor (SR2501) in the designated amount of time after the tray 2 feed sensor (SR24) sensed the leading edge when printing from tray 4.

- **13.B2.D5**

Paper did reach the registration sensor (SR2501) in the designated amount of time after the tray 2 feed sensor (SR24) sensed the leading edge when printing from tray 5.

- **13.B2.DD**

Paper did reach the registration sensor (SR2501) on the 2nd transfer assembly in the designated amount of time after leaving the duplex wait point when duplexing.

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Inspect the paper path and ensure that no paper is blocking the paper path.
3. Check for packaging material obstructions in the input trays and paper pickup assemblies.

4. Ensure that the tray width guides are set to the correct paper size being installed into the tray.

Note:

The arrow on the guide should line up exactly with the line connected to paper size designation. Ensure that the tray is not filled above the fill mark on the tray.

5. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.

Note:

Smooth or slick paper can be the cause of the jam error.

6. Ensure that the tray pickup, feed, and separation rollers are installed correctly.
7. Clean the pickup and feed rollers as needed, and replace any that show damage or wear.

Part number: A2W77-67905

8. Test the SR2501 registration (TOP sensor).
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR2501, and then manually move the sensor to ensure that it moves freely and responds correctly to the sensor test.

Note:

This sensor is located on the ITB directly in the center.

- c. If the sensor is functioning correctly, run a few pages to check where the leading edge of the paper actually stops. Depending on where the paper is stopping, check for obstructions or damage, and then replace damaged parts as needed.

For instructions: [Removal and replacement: ITB Transfer roller](#)

ITB part number: RY7-5211-000CN

Tray 2 paper pickup assembly part number: RM1-9599-000CN

Right door sub assembly part number: RM1-9640-000CN

- d. If the sensor test fails, replace the registration sensor assembly and test again.

Part number: A2W77-67901

- e. If the sensor test still fails, the sensor might be defective. Check the event log for the 10.22.70 code and replace the ITB (which contains SR2501 sensor).
 - If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement. HP recommends that the customer order and install a maintenance kit at this time.
 - If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)


Part number: RY7-5211-000CN

- f. Important:
 - g. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.
9. Remove and check the 2nd transfer assembly for broken white hooks. If the white hooks are broken, replace the hooks by replacing the registration 2nd transfer assembly.
 - a. Make sure the registration assembly tension springs (callout 1) are in the correct position.

Note:

If the springs are out of position, this can cause an obstruction for the shutter (de-skew gate) and prevent it from moving freely. This delays the paper from arriving at the registration roller located at the ITB in the designated amount of time.

Reinstall the 2nd transfer assembly (1 of 2)

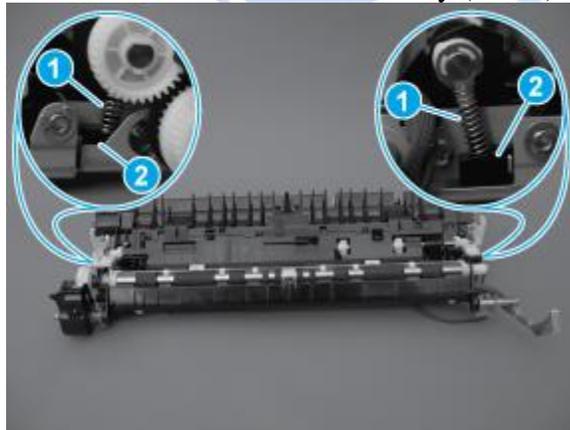

- b. Make sure the spring mounting blocks (callout 2) are in the correct position (the springs should be straight and not bent or curved as shown above).


Note:

These are located at each end of the 2nd transfer assembly in the registration assembly.

- c. If the error persists, replace the registration 2nd transfer assembly.

Part number: RM2-6856-000CN

10. Carefully turn the assembly over, and then check the tabs on the spring mounting blocks for correct seating in the assembly sheet metal.

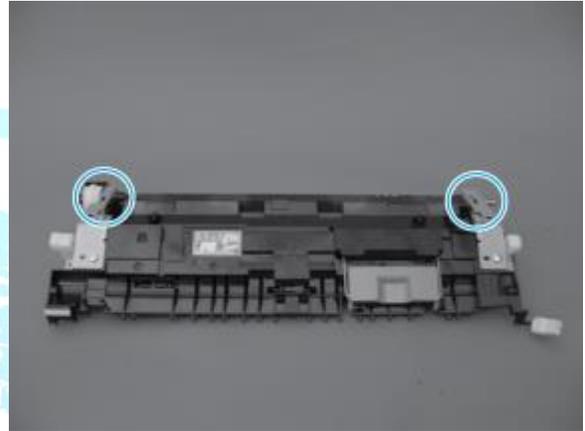

Reinstall the 2nd transfer assembly (2 of 2)

11. If the error persists, replace the paper pickup assembly for the affected tray.

Tray 2 part number: RM1-9599-000CN

Trays 3-5 part number: RM2-0275-000CN

12. If the error persists, and the previous steps did not resolve the error, replace the DC controller.

For instructions: See the Repair Service Manual for this product.

M855 part number: RM2-7005-000CN

M880 part number: RM2-7006-000CN

Note:

In a small number of cases, replacing the DC controller has fixed the problem (especially if a grinding noise is heard right before the jam occurs).

13 . B2 . FF

Residual paper jam in registration area.

This jam occurs when residual paper is detected at the registration sensor (SR2501) at power on.

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Inspect the paper path and ensure no paper is blocking the paper path.
3. Ensure that the tray width guides are set to the correct paper size being installed into the tray and that the tray is not filled above the fill mark on the tray.

Note:

The arrow on the guide should line up exactly with the line connected to paper size designation.

4. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
5. Test the SR2501 and verify that the registration sensor (TOP sensor) is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR2501, and then manually move the sensor to ensure that it moves freely and responds correctly to the sensor test.

Note:

This sensor is located on the ITB directly in the center.

- c. If the sensor is functioning correctly, run a few pages to check where the leading edge of the paper actually stops. Depending on where paper is stopping check for obstructions or damage and replace any parts as needed.
- d. If the sensor test fails, replace the registration sensor assembly and test again.

Part number: A2W77-67901

6. If the sensor test still fails, the sensor might be defective. Check the event log for the 10.22.70 code and replace the ITB which contains the SR2501 sensor.
 - If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

Part number: RY7-5211-000CN

7. Note:
8. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.
9. If the error persists, check the 2nd transfer assembly for broken white hooks. If the white hooks are broken, elevate the issue using the Standard Support Process.

13.B4.FF

Residual paper jam loop sensor (SR29 or SR30).

This jam occurs when residual paper is detected at the loop sensor (SR29 or SR30) at power on.

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. If the error persists, check the event log for any other specific paper jams, and troubleshoot the specified jam location.
4. Test SR29 and SR30 and verify that the loop sensors are functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR29.
 - c. Select SR30.
 - d. If either test fails, replace the registration 2nd transfer assembly.

Part number: RM2-6856-000CN

13.B8.Dz

Fuser delivery delay jam, fuser output sensor 2.

Paper did not reach fuser sensor 2, SR45 in the designated amount of time after activating fuser sensor 1, SR35.

- **13.B8.D1** Fuser delivery delay jam 2 when printing from tray 1.
- **13.B8.D2** Fuser delivery delay jam 2 when printing from tray 2.
- **13.B8.D3** Fuser delivery delay jam 2 when printing from tray 3.
- **13.B8.D4** Fuser delivery delay jam 2 when printing from tray 4.
- **13.B8.D5** Fuser delivery delay jam 2 when printing from tray 5.
- **13.B8.DD** Fuser delivery delay jam 2 when printing with the duplexer.

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Check to see where the leading edge of the paper is when the jam occurs and make sure the paper started to exit the fuser freely.
4. Test SR45 and verify that the fuser sensor on the right door assembly is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR45.
 - c. If the sensor is not functioning correctly, replace the right door assembly.

Part number: RM1-9640-000CN

5. Check the duplex feed assembly for obstructions, damage, or incorrect installation, and clean or replace the duplex feed assembly as needed.

M855 part number: A2W77-67913

M880 part number: A2W75-67911

6. Remove the fuser and perform the following steps.

CAUTION:

The fuser might be hot.

- a. Inspect the fuser rollers and exit guide for blockage and/or damage.
- b. Verify that fuser inlet guide is not detached or broken.
7. If the error persists, replace the fuser (also contains the inlet guide).

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

13.B9.Az

Fuser delivery stay jam.

The fuser delivery sensor (SR35) does not detect the trailing edge of the paper within a specified period of time from when the sensor detected the leading edge. The paper stopped at the fuser-output sensor (stay at fuser output sensor).

This jam can be caused by:

- An accordion paper jam at the fuser exit.
 - Something blocking the paper before reaching the output rollers.
 - The output bin rollers are not turning. Because there is very little distance from the fuser exit to the output bin, paper stopped at the rollers can cause a fuser jam.
 - A sticky fuser exit flag. If the flag is stuck or even delayed momentarily in the activated position it can cause this jam.
-
- **13.B9.A2** The fuser is printing in fuser mode `Normal`.
 - **13.B9.A3** The fuser is printing in fuser mode `Light 1` or `Light 2` (see the event log secondary jam information digits for specific mode).
 - **13.B9.A4** The fuser is printing in fuser mode `Heavy 1`.
 - **13.B9.A5** The fuser is printing in fuser mode `Heavy 2`.
 - **13.B9.AB** The fuser is printing in fuser mode `Transparency`.
 - **13.B9.AD** The fuser is printing in fuser mode `Envelope 1` or `Envelope 2` (see the event log secondary jam information digits for specific mode).

Recommended action

1. Open the right door, and clear any jammed paper.
2. Make sure the type and quality of the paper that is being used meets the HP specifications for the printer.
 - a. Use a better quality of paper (poor quality light or recycled paper has been shown to cause this error).
 - b. Use a fresh ream of paper and Ensure that the paper has not been stored in a humid or moist environment (moist paper has been shown to cause this jam).
 - c. If using light or recycled paper, adjust the following control panel settings to help the printer transfer the paper through the paper path.
 - Administration > General Settings > Print Quality > Adjust Paper Types > Plain > Print Mode > Select > Extra Light Mode > Save.
 - Administration > General Settings > Print Quality > Adjust Paper Types > Plain > Separation Mode > Select > Alternate > Save.
3. Confirm the output bin rollers are turning when printing a page.
4. Clean the paper path.
5. If severe or continuous toner waste contamination is present that cannot be cleaned sufficiently, replace the registration 2nd transfer assembly and the secondary transfer roller.

Registration 2nd transfer assembly part number: RM2-6856-000CN

For instructions: [Removal and replacement: ITB Transfer roller](#)


Secondary transfer roller part number: D7H14-67902

6. Remove the fuser, and then clear any jammed paper.

CAUTION:

The fuser might be hot.

- a. Verify that there is no debris from a previous jam stuck in the fuser or rollers leading into or out of the fuser.
- b. Check the fuser exit area for residual paper or damage.

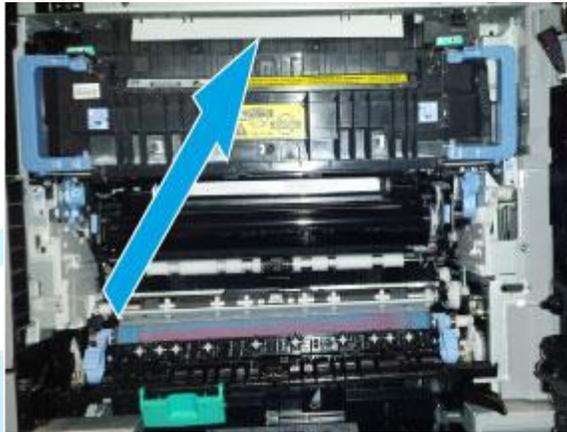

Fuser exit area


- c. Remove the fuser and check the fuser exit guides and retaining tabs.

CAUTION:

The fuser might be hot.

- d. If the exit guide is excessively loose, hanging crooked, moves around, or is otherwise not installed correctly, then remove the guide and check the retaining tabs for damage.

Exit guide

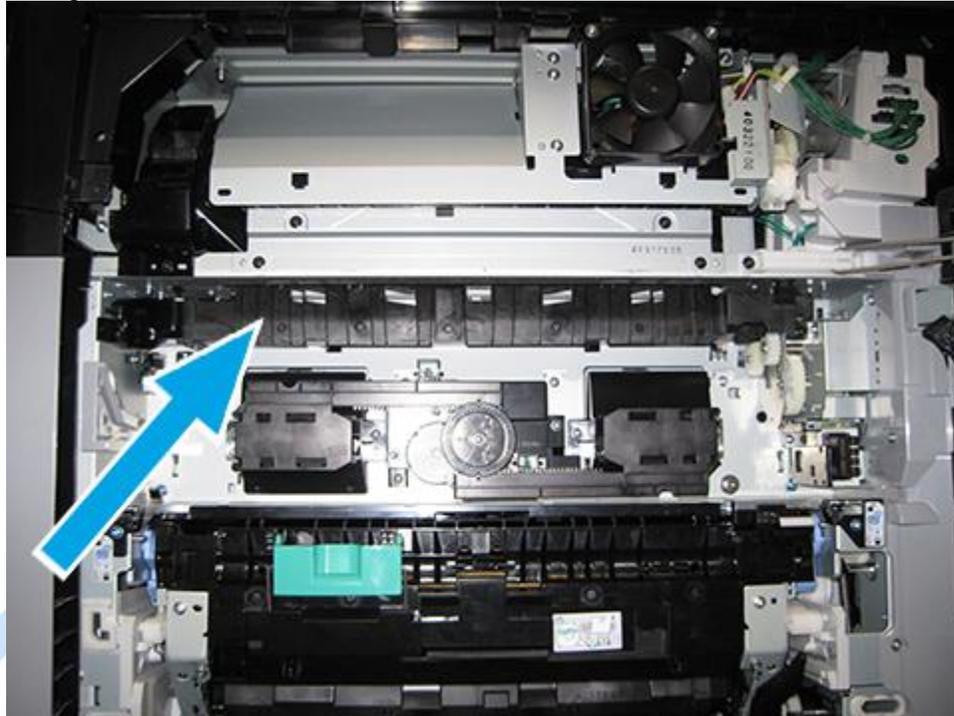

7. Ensure that the fuser exit flag is functioning correctly and engages the fuser sensor correctly on the right door assembly.
8. If the flag on the fuser is broken or damaged, check the event log for the 10.23.70 code and replace the fuser.
 - If a 10.23.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901 (C1N54-69002 functional equivalent)

Fuser (220V) part number: C1N58-67901 (C1N58-69001 functional equivalent)


9. Important:
10. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.
11. Test SR35 and verify that the sensor is functioning correctly.
 - . Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - a. Select SR35.
12. If the sensor test fails, replace the right door assembly.

Part number: RM2-0281-000CN

13. Remove the exit guide.

- Use a flat-blade screw driver to lift up on the center of the exit guide to release the holding pin (circle with arrow callout) and slide the guide gently to the right to free the retaining tabs.

Remove the exit guide

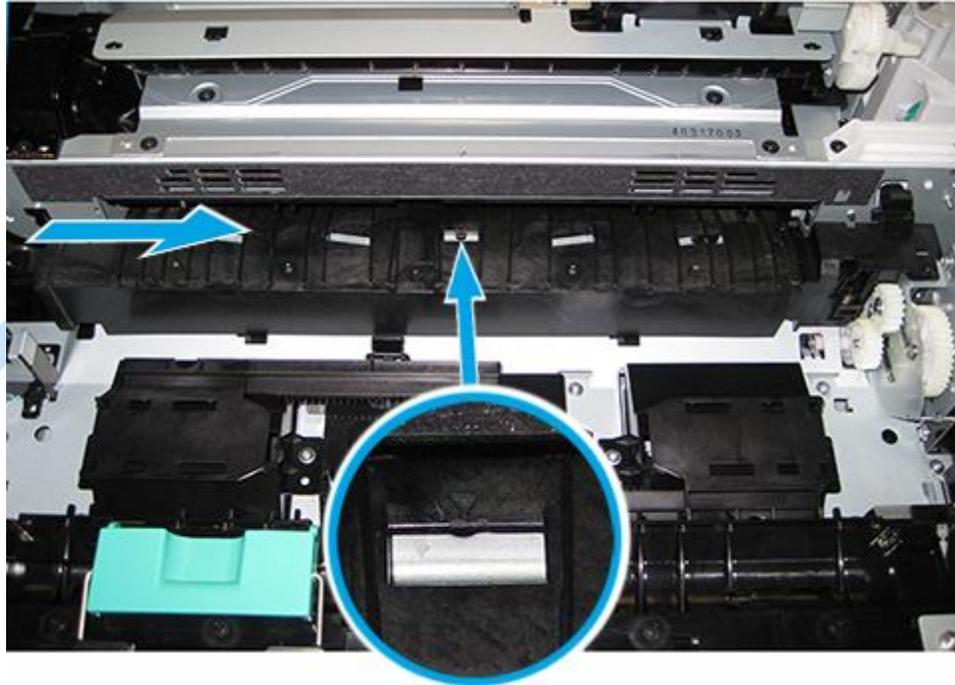

- With the exit guide removed, check the tabs on the guide. If any of these tabs are broken, elevate the issue using the Standard Support Process.

Note:


This guide might be damaged due to a previous repair of parts around and near the guide.

Exit guide tabs



- b. If the tabs are **not** broken, reinstall the guide making sure that it is secured correctly. Ensure that the four retaining tabs are inserted correctly into the sheet metal.

Reinstall guide

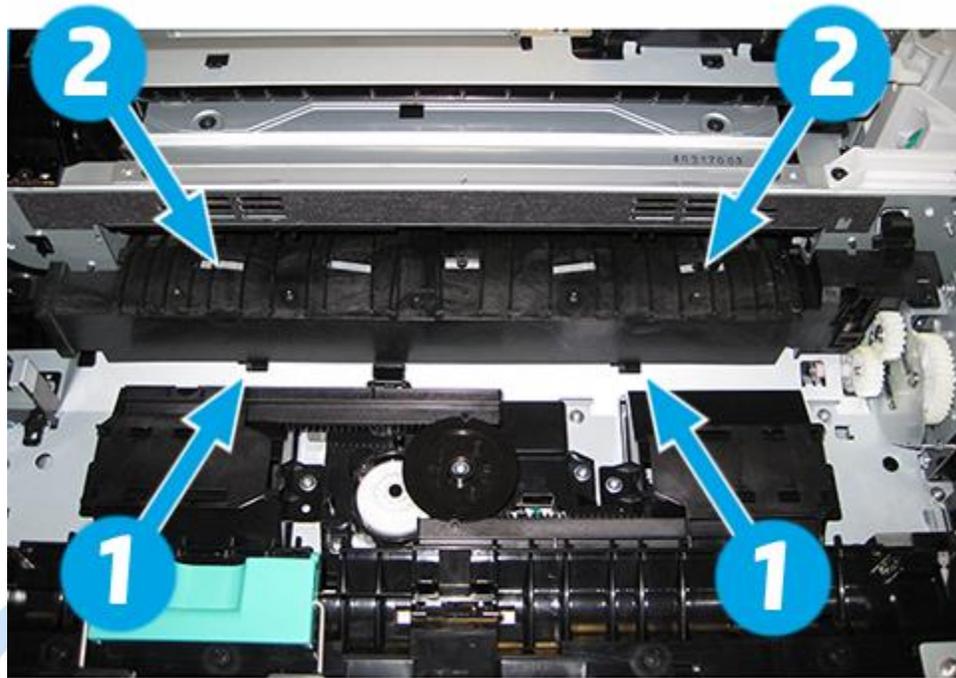

Callout 1: Visible retaining tabs

Callout 2: Retaining tabs on the back side of the guide

14. If the jam error occurs **only** when duplexing, clean the right door rollers, sensors, and actuators for the fuser exit. If everything already looks clean, replace the right-door sub assembly.

Part number: RM1-9640-000CN

15. If the jam occurs on simplex and duplex jobs, open the IPTU and inspect it for damage and debris.

16. With IPTU open, use the Component Test menu to test the motor (M202).

- Open the following menus:

- Administration
- Troubleshooting
- Component Test

- a. Select M202 and then watch for the rollers moving in the IPTU.


17. If M202 is not functioning and the rollers do not turn correctly, test IPTU motor M201. If only M202 fails, replace the M202 stepping motor.

Part number: RK2-1320-000CN

18. Check all connectors on the controller for damage, correct seating, and secure connection.

19. If both motors fail and the connectors are not damaged, replace the IPTU controller PCA.

Part number: RM2-7019-000CN

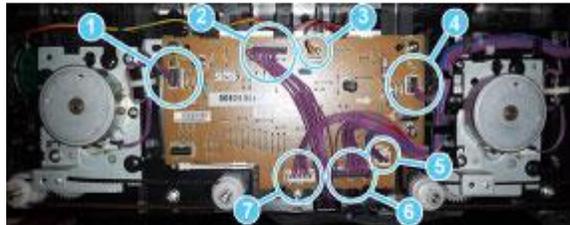

IPTU controller PCA

- 1 - J7003
- 2 - J7006
- 3 - J7008
- 4 - J7007
- 5 - J7004
- 6 - J7001
- 7 - J7005

20. If any of the connectors are damaged, replace the finisher lock assembly/ITPU.

Part number: RM2-5038-000CN



Lock assembly

21. If the error persists, check the event log for the 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901 (C1N54-69002 functional equivalent)

Fuser (220V) part number: C1N58-67901 (C1N58-69001 functional equivalent)

13.B9.Bz Jam in right door

This jam occurs when a near complete overlap (less than 5 to 15 mm of non-overlap) multi-feed jam is detected at the fuser.

- **13.B9.B1** Multi-Feed jam is detected when printing from tray 1.
- **13.B9.B2** Multi-Feed jam is detected when printing from tray 2.
- **13.B9.B3** Multi-Feed jam is detected when printing from tray 3.
- **13.B9.B4** Multi-Feed jam is detected when printing from tray 4.
- **13.B9.B5** Multi-Feed jam is detected when printing from tray 5.
- **13.B9.BD** Multi-Feed jam is detected when printing from the duplexer.

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. If standard paper is being used, skip to the next step. If using light or recycled paper when this error occurs, perform the following steps:
 - a. Use a better quality of paper (poor quality light or recycled paper has been shown to cause this error).
 - b. Use a fresh ream of paper and Ensure that the paper has not been stored in a humid or moist environment (moist paper has been shown to cause this jam).
 - c. Adjust the following settings on the control panel to help the printer transfer the paper through the paper path:
 - Administration > General Settings > Print Quality > Adjust Paper Types > Plain > Print Mode > Select > Extra Light Mode > Save.
 - Administration > General Settings > Print Quality > Adjust Paper Types > Plain > Separation Mode > Select > Alternate > Save.
 - d. Clean the paper path.
 - e. If severe or continuous toner contamination is present that cannot be cleaned sufficiently, replace the registration 2nd transfer assembly and the secondary transfer roller.

Registration 2nd transfer assembly part number: RM2-6856-000CN

For instructions: [Removal and replacement: ITB Transfer roller](#)

Secondary transfer roller part number: D7H14-67902

4. Ensure that the paper meets the HP specifications for the printer and is loaded correctly in the trays.
5. Ensure that the pickup, feed, and separation rollers for the specified tray are installed correctly.
6. Clean or replace the pickup and feed rollers as needed.

Tray 1 part number (pickup): A2W77-67906

Tray 2 part number (T2, pickup, feed): A2W77-67905

13.B9.Cz

Fuser wrap jam.

This jam occurs when the paper disappears from the fuser output sensor (SR35) before a designated amount of time after the paper reached the fuser output sensor (SR35).

(It is determined that the paper is being wrapped around the fuser roller)

Z = Fuser mode

- **13.B9.C1** Fuser wrap jam when Auto Sense (Normal).
- **13.B9.C2** Fuser wrap jam when Normal.
- **13.B9.C3** Fuser wrap jam when Light 1 or Light 2.
- **13.B9.C4** Fuser wrap jam when Heavy 1.
- **13.B9.C5** Fuser wrap jam when Heavy 2.
- **13.B9.C6** Fuser wrap jam when Heavy paper 3.
- **13.B9.C7** Fuser wrap jam when Glossy paper 1.
- **13.B9.C8** Fuser wrap jam when Glossy paper 2.
- **13.B9.C9** Fuser wrap jam when Glossy paper 3.
- **13.B9.CB** Fuser wrap jam when Transparency.
- **13.B9.CC** Fuser wrap jam when Label.
- **13.B9.CD** Fuser wrap jam when Envelope 1 or Envelope 2.

Recommended action

1. Open the right door and remove the fuser.

CAUTION:

The fuser might be hot.

2. Remove any paper wrapped around the fuser roller.
3. Reinstall the fuser, and then close the door.
4. Print a cleaning page to ensure that all of the toner is removed from the fuser roller.
5. If standard paper is being used, skip to the next step. If using light or recycled paper when this error occurs, perform the following steps:
 - a. Use a better quality of paper (poor quality light or recycled paper has been shown to cause this error).
 - b. Use a fresh ream of paper and Ensure that the paper has not been stored in a humid or moist environment (moist paper has been shown to cause this jam).
 - c. Adjust the following settings on the control panel to help the printer transfer the paper through the paper path:
 - Administration > General Settings > Print Quality > Adjust Paper Types > Plain > Print Mode > Select > Extra Light Mode > Save.
 - Administration > General Settings > Print Quality > Adjust Paper Types > Plain > Separation Mode > Select > Alternate > Save.
6. Clean the paper path.
7. If severe or continuous toner waste contamination is present that cannot be cleaned sufficiently, replace the registration 2nd transfer assembly and the secondary transfer roller.

Registration 2nd transfer assembly part number: RM2-6856-000CN

For instructions: [Removal and replacement: ITB Transfer roller](#)

Secondary transfer roller part number: D7H14-67902

8. Ensure that the fuser exit flag is functioning correctly and engages the fuser sensor on the right door assembly.
9. If the fuser exit flag is broken or damaged, check the event log for the 10.23.70 code and replace the fuser.
 - If a 10.23.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901 (C1N54-69002 functional equivalent)

Fuser (220V) part number: C1N58-67901 (C1N58-69001 functional equivalent)

10. Important:
11. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.
12. Test SR35 and verify that the fuser sensor on the right door is functioning correctly.

- . Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - a. Select SR35.
13. If the test fails, replace the right door sub assembly.

Part number: RM1-9640-000CN

14. If the error persists, the fuser roller or pressure roller might be damaged. Check the event log for a 10.23.70 code and replace the fuser.
- If a 10.23.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901 (C1N54-69002 functional equivalent)

Fuser (220V) part number: C1N58-67901 (C1N58-69001 functional equivalent)

15. Important:
16. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

13.B9.Dz

Fuser delivery delay jam.

This jam occurs when the media does not reach the fuser output sensor (SR35) before a designated amount of time after the registration sensor (SR2501) sensed the leading edge when printing.

- **13.B9.D1** Fuser delivery delay jam when printing from Tray 1.
- **13.B9.D2** Fuser delivery delay jam when printing from Tray 2.
- **13.B9.D3** Fuser delivery delay jam when printing from Tray 3.
- **13.B9.D4** Fuser delivery delay jam when printing from Tray 4.
- **13.B9.D5** Fuser delivery delay jam when printing from Tray 5.
- **13.B9.DD** Fuser delivery delay jam when printing with the duplexer.

Recommended steps for customers if the paper stopped before the fuser

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.

3. Thoroughly check the duplex paper path and the ITB/transfer area for issues with rollers, jammed paper or any potential obstructions that might be causing the jam.
4. If using light or recycled paper when this error occurs, perform the following steps:
 - a. Use a better quality of paper (poor quality light or recycled paper has been shown to cause this error).
 - b. Use a fresh ream of paper and ensure that the paper has not been stored in a humid or moist environment (moist paper has been shown to cause this jam).
 - c. Adjust the following settings on the control panel to help the printer transfer the paper through the paper path. Open the following menus:

Settings change 1

FutureSmart 3

- Administration
- General Settings
- Print Quality
- Adjust Paper Types
- Plain
- Print Mode
- Extra Light Mode (touch Save)

FutureSmart 4


- Settings
- Copy/Print
- Print Quality
- Adjust Paper Types
- Plain
- Print Mode
- Extra light mode (touch Done)

Settings change 2

FutureSmart 3

- Administration
- General Settings
- Print Quality
- Adjust Paper Types
- Plain
- Separation Mode
- Alternative (touch Save)

FutureSmart 4

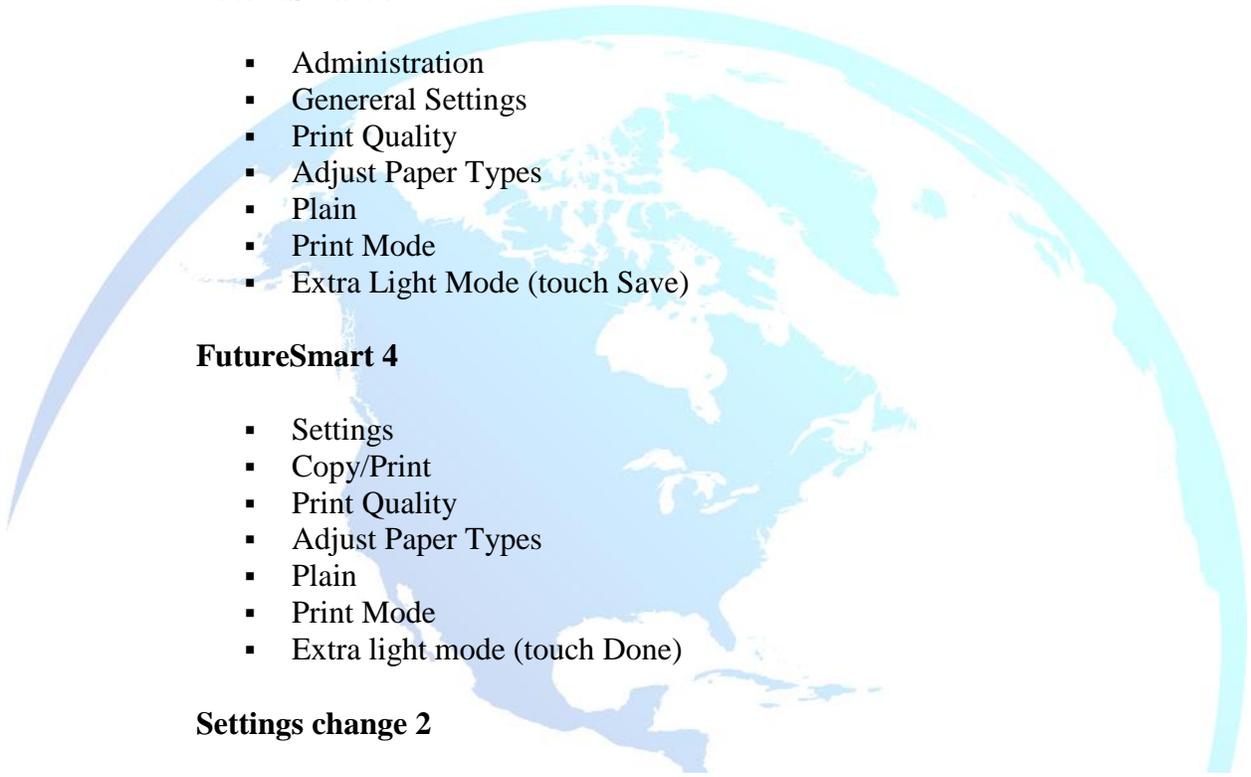

- Settings
- Copy/Print
- Print Quality
- Adjust Paper Types
- Plain
- Separation Mode
- Alternative (touch Done)

Recommended steps for call-center agents and onsite technicians if the paper stopped before the fuser

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Thoroughly check the duplex paper path and the ITB/transfer area for issues with rollers, jammed paper or any potential obstructions that might be causing the jam.
4. If using standard paper, skip to the next step. If using light or recycled paper when this error occurs, perform the following steps:
 - a. Use a better quality of paper (poor quality light or recycled paper has been shown to cause this error).
 - b. Use a fresh ream of paper and ensure that the paper has not been stored in a humid or moist environment (moist paper has been shown to cause this jam).
 - c. Adjust the following settings on the control panel to help the printer transfer the paper through the paper path. Open the following menus:

Settings change 1: FutureSmart 3

- Administration
- General Settings
- Print Quality
- Adjust Paper Types
- Plain
- Print Mode
- Extra Light Mode (touch Save)

FutureSmart 4

- Settings
- Copy/Print
- Print Quality
- Adjust Paper Types
- Plain
- Print Mode
- Extra light mode (touch Done)

Settings change 2: FutureSmart 3

- Administration
- General Settings
- Print Quality
- Adjust Paper Types
- Plain
- Separation Mode
- Alternative (touch Save)

FutureSmart 4

- Settings
 - Copy/Print
 - Print Quality
 - Adjust Paper Types
 - Plain
 - Separation Mode
 - Alternative (touch Done)
5. Clean the paper path. If possible, vacuum the toner dust from the ITB area.
 6. Run a cleaning page. Also, schedule regular cleaning pages to prevent these jams.
 7. If severe or continuous toner waste contamination is present that cannot be cleaned sufficiently, replace the Registration 2nd Transfer Assembly.

For instructions: [M880 Repair Manual](#) (page 174)

Part number: RM2-6856-000CN

8. Verify that the Secondary Transfer Roller is seated correctly and not worn or deformed.
9. If the Secondary Transfer Roller is damaged, check the event log for the 10.22.70 code and replace the transfer roller.

Note:

If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement. HP recommends that the customer order and install a maintenance kit at this time.

If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: ITB and Secondary Transfer roller](#) - Part number: D7H14-67902

Note:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

10. Inspect the transfer feed assembly for debris or damage.
11. If damaged, or if the error persists, replace the right door sub assembly:

Part number: RM1-9640-000CN

Recommended steps for call-center agents and onsite technicians if the paper stopped in or at the fuser

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Remove the fuser and inspect the fuser rollers for blockage and/or damage.

CAUTION:

The fuser might be hot.

4. Make sure the fuser exit flag is functioning correctly.
5. If the flag on the fuser is broken or damaged and does not engage the fuser sensor on the right door assembly, or if the fuser is damaged, check the event log for the 10.23.70 code and replace the fuser.
 - If a 10.23.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901 (C1N54-69002 functional equivalent)

Fuser (220V) part number: C1N58-67901 (C1N58-69001 functional equivalent)

6. Note:
7. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.
8. Verify that fuser inlet guide is not detached or broken. Reinstall or reseal the guide as needed.
9. Test SR35 and verify that the fuser sensor is functioning correctly.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Manual Sensor Test

FutureSmart 4

- Support Tools
- Troubleshooting
- Diagnostic Tests (touch Continue).
- Manual Sensor Test (select SR35)

10. If the sensor test fails, replace the right door assembly.

Part number: RM1-9640-000CN

11. Run the fuser motor drive test to verify that the fuser drive and gears are functioning correctly. If they are not, replace the fuser motor assembly.

For instructions: [M880 Repair Manual](#) (page 128)

Part numbers: RM1-4519-000CN

For instructions: [M880 Repair Manual](#) (page 240)

Part number: RM2-6856-000CN

13 . B9 . FF

Residual paper jam at the fuser output sensor.

This jam occurs when residual paper is detected at the fuser output sensor (SR35) at power on.

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. If standard paper is being used, skip to the next step. If using light or recycled paper when this error occurs, perform the following steps:
 - a. Use a better quality of paper (poor quality light or recycled paper has been shown to cause this error).
 - b. Use a fresh ream of paper and Ensure that the paper has not been stored in a humid or moist environment (moist paper has been shown to cause this jam).
 - c. Adjust the following settings on the control panel to help the printer transfer the paper through the paper path.
 - Administration > General Settings > Print Quality > Adjust Paper Types > Plain > Print Mode > Select > Extra Light Mode > Save.
 - Administration > General Settings > Print Quality > Adjust Paper Types > Plain > Separation Mode > Select > Alternate > Save.
4. Clean the paper path.
5. If severe or continuous toner waste contamination is present that cannot be cleaned sufficiently, replace the 2nd transfer assembly.

Registration 2nd transfer assembly part number: RM2-6856-000CN

For instructions: [Removal and replacement: ITB Transfer roller](#)

Secondary transfer roller part number: D7H14-67902

6. Remove the fuser, and inspect the fuser rollers.

CAUTION:

The fuser might be hot.

7. Ensure that the fuser exit flag is functioning correctly, and engages the fuser sensor on the right door assembly.
8. If the fuser rollers or the fuser exit flag is damaged, check the event log for the 10.23.70 code and replace the fuser.

Important:

After an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

9. If the error persists, test SR35 and verify that the fuser sensor on the right door is functioning correctly.
 - . Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - a. Select SR35.

10. If the test fails, replace the right door sub assembly.

Part number: RM1-9640-000CN

11. If the error persists, run the fuser motor drive test to verify that the fuser drive and gears are functioning correctly.
12. If the test fails, replace the fuser motor assembly.

Part number: RM1-4519-000CN

13 . BA . EE

This jam occurs when the engine front door is opened during printing (sensor SW14).

Recommended action

1. Close the front door.
2. Check the projection tabs of the front door that engage the door sensors (SW14). If damaged, replace the front door assembly.

Part number: A2W77-67907

3. Use the manual sensor test to activate the door switch.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Tray/Bin Manual Sensor Test
4. If the test fails, check the connectors on the DC controller PCA to ensure that they are seated correctly and not damaged.
5. If the error persists, replace the switch.

Part number: RM2-7035-000CN

13 . BB . EE

This jam occurs when the engine right door (SW13) is opened during printing.

Recommended action

1. Close the right door.
2. Check the projection tabs of the right door that engage the door sensor (SW13). If damaged, replace the right door assembly.

Part number: RM1-9640-000CN

3. Use the manual sensor test to activate the door switch.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Tray/Bin Manual Sensor Test
4. If the test fails, replace the switch.

Part number: RM2-7035-000CN

5. If the error persists, check the connectors on the DC controller PCA to ensure that they are seated correctly and not damaged.

13.D1.Az

Jam in the right door.

This jam occurs when the paper stays at the duplex switchback sensor (SR301) for a designated amount of time after it has reached the SR301 sensor.

Z = Fuser Mode

- **13.D1.A1** The fuser is printing in fuser mode Auto Sense (Normal).
- **13.D1.A2** The fuser is printing in fuser mode Normal.
- **13.D1.A3** The fuser is printing in fuser mode Light 1 or Light 2.
- **13.D1.A4** The fuser is printing in fuser mode Heavy 1.
- **13.D1.A5** The fuser is printing in fuser mode Heavy 2.
- **13.D1.A6** The fuser is printing in fuser mode Heavy paper 3.
- **13.D1.A7** The fuser is printing in fuser mode Glossy paper 1.
- **13.D1.A8** The fuser is printing in fuser mode Glossy paper 2.
- **13.D1.A9** The fuser is printing in fuser mode Glossy paper 3.
- **13.D1.AB** The fuser is printing in fuser mode Transparency.
- **13.D1.AC** The fuser is printing in fuser mode Label.

Recommended action

1. Follow the on screen instructions to locate and remove the paper or obstruction.
2. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
3. Turn the printer off.
4. Remove and reinstall the fuser.

CAUTION:

The fuser might be hot.

5. Test the duplexer reverse motor.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Component Test
 - b. Select Duplexer reverse motor test. The duplexing reverse-motor test activates the duplexing reverse motor for 10 seconds.

6. Test the duplexer refeed motor.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Component Test
 - b. Select Duplexer refeed motor test. The duplexing refeed motor test activates the duplexing refeed motor for 10 seconds.
7. If either of these tests fail, check the connectors (J1902, J9946, J1909, and J1908) for correct seating and secure connection.
8. If the error persists and the connectors are not damaged, replace the duplex reverse assembly.

M855 part number: RM2-0291-000CN

M880 part number: RM2-5061-000CN

9. If the motor tests pass, test SR301 (the duplex switchback sensor).
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR301, and then manually move the sensor to ensure that it moves freely and responds correctly to the sensor test.
 - c. If the sensor test fails, check that the sensor flag moves freely.
 - d. Clean the area and then test again.
10. If the sensor test continues to fail, the sensor might be defective. Replace the duplex reverse assembly.

M855 Part number: RM2-0291-000CN

M880 Part number: RM1-5061-000CN

11. If the sensor is functioning correctly, replace the right door assembly.

Part number: RM1-9640-000CN

13.D1.Dz

Jam in the right door.

The paper did not reach the duplex switchback sensor (SR301) in the designated amount of time after the fuser output sensor (SR45) sensed the leading edge.

Z = Fuser Mode

- **13.D1.D1** The fuser is printing in fuser mode Auto Sense.
- **13.D1.D2** The fuser is printing in fuser mode Normal.
- **13.D1.D3** The fuser is printing in fuser mode Light 1 or Light 2.
- **13.D1.D4** The fuser is printing in fuser mode Heavy 1.
- **13.D1.D5** The fuser is printing in fuser mode Heavy 2.
- **13.D1.D6** The fuser is printing in fuser mode Heavy paper 3.
- **13.D1.D7** The fuser is printing in fuser mode Glossy paper 1.
- **13.D1.D8** The fuser is printing in fuser mode Glossy paper 2.
- **13.D1.D9** The fuser is printing in fuser mode Glossy paper 3.
- **13.D1.DB** The fuser is printing in fuser mode Transparency.
- **13.D1.DC** The fuser is printing in fuser mode Label.

Preliminary Troubleshooting

1. Follow the on screen instructions to locate and remove the paper or obstruction.
2. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
3. Determine where the leading and trailing edge of the paper is during the error state.
 - Is it stopped in the fuser?
 - Is it stopped in the diverter assembly?
 - Is it stopped at the input of duplexer?

Stopped in the fuser

1. Remove the fuser and inspect the fuser and the rollers for blockage and/or damage.

CAUTION:

The fuser might be hot.

2. Check the fuser guide assembly and verify that is not causing the paper to get damaged and be stuck at the fuser exit.
3. If the error persists, check the event log for the 10.23.70 code and replace the fuser.

Note:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

Stopped in the diverter assembly

1. Check the right door assembly for blockage or damage.
2. Test SR301 to verify that the duplex switchback sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR301, and then manually move the sensor to ensure that it moves freely and responds correctly to the sensor test.
 - c. If the sensor test fails, check that the sensor flag moves freely.
 - d. Clean the area and test again.
3. If the sensor test continues to fail, the sensor might be defective. Replace the duplex reverse assembly.

M855 part number: RM2-0291-000CN

M880 part number: RM1-5061-000CN

Stopped at the input of duplexer

1. Check that the duplex reverse motor and the refeed motor are functioning correctly.
2. Test the duplexer reverse motor.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Component Test
 - b. Select Duplexer reverse motor test. The duplexing reverse-motor test activates the duplexing reverse motor for 10 seconds.
3. Test the duplexer refeed motor.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Component Test
 - b. Select Duplexer refeed motor test. The duplexing refeed motor test activates the duplexing refeed motor for 10 seconds.
4. Check the connectors (J1902, J9946, J1909, and J1908) for correct seating and secure connection.
5. If either of these tests fail and the connectors are not damaged, replace the duplex reverse assembly.

M855 part number: RM2-0291-000CN

M880 part number: RM2-5061-000CN

6. Test SR301 to verify that the duplex switchback sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR301, and then manually move the sensor to ensure that it moves freely and responds correctly to the sensor test.
7. If the sensor fails to change state, ensure that the sensor flag moves freely, clean the area, and then test again.
8. If the sensor test continues to fail, the sensor might be defective. Replace the duplex reverse assembly.

M855 Part number: RM2-0291-000CN

M880 Part number: RM1-5061-000CN

9. If the sensor is functioning correctly, replace the right door assembly.

Part number: RM1-9640-000CN

13.D1.FF

Jam in the right door.

This jam occurs when residual paper is detected at the duplex switchback sensor (SR301) at power on.

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Replace the duplex switchback assembly.

M855 part number: RM2-0291-000CN

M880 part number: RM2-5061-000CN

13.D3.Az

Jam in the right door.

This jam occurs when the paper stays at the duplex feed sensor (SR304) for the designated amount of time after it has reached the SR304 sensor.

- **13.D3.A1** The fuser is printing in fuser mode Auto Sense.
- **13.D3.A2** The fuser is printing in fuser mode Normal.
- **13.D3.A3** The fuser is printing in fuser mode Light 1 or Light 2.
- **13.D3.A4** The fuser is printing in fuser mode Heavy 1.
- **13.D3.A5** The fuser is printing in fuser mode Heavy 2.
- **13.D3.A6** The fuser is printing in fuser mode Heavy paper 3.
- **13.D3.A7** The fuser is printing in fuser mode Glossy paper 1.
- **13.D3.A8** The fuser is printing in fuser mode Glossy paper 2.
- **13.D3.A9** The fuser is printing in fuser mode Glossy paper 3.

Recommended action

1. Follow the on screen instructions to locate and remove the paper or obstruction.
2. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
3. Use the Component Test menu to perform the following motor tests:
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Component Test
 - b. Select the Duplexer reverse motor test. The duplexing reverse-motor test activates the duplexing reverse motor for 10 seconds.
 - c. Select Duplexer refeed motor test. The duplexing refeed motor test activates the duplexing refeed motor for 10 seconds.
4. Check the connectors (J1902, J9946, J1909, and J1908) for correct seating and secure connection.
5. If either of motor tests fail and the connectors are not damaged, replace the duplex reverse assembly.

M855 part number: RM2-0291-000CN

M880 part number: RM2-5061-000CN

6. If the motor tests pass, test SR304 to ensure that the duplex re-pick feed sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR304 and then manually move the sensor to ensure that it moves freely and responds correctly to the sensor test.
 - c. If the sensor test fails, clean the sensor and then test again.

7. If the sensor test continues to fail, the sensor might be defective. Replace the duplex feed assembly.

M855 Part number: A2W77-67913

M880 Part number: A2W75-67911

8. If the sensor is functioning correctly and the error persists, replace the right door assembly.

Part number: RM1-9640-000CN

13.D3.Dz

Jam in the right door.

The paper did not reach the duplex refeed sensor (SR304) in the designated amount of time after the duplex switchback sensor (SR302) sensed the leading edge:

- **13.D3.D1** The fuser is printing in fuser mode Auto Sense.
- **13.D3.D2** The fuser is printing in fuser mode Normal.
- **13.D3.D3** The fuser is printing in fuser mode Light 1 or Light 2.
- **13.D3.D4** The fuser is printing in fuser mode Heavy 1.
- **13.D3.D5** The fuser is printing in fuser mode Heavy 2.
- **13.D3.D6** The fuser is printing in fuser mode Heavy paper 3.
- **13.D3.D7** The fuser is printing in fuser mode Glossy paper 1.
- **13.D3.D8** The fuser is printing in fuser mode Glossy paper 2.
- **13.D3.D9** The fuser is printing in fuser mode Glossy paper 3.

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Use the Component Test menu to perform the following motor tests:
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Component Test
 - b. Select the Duplexer reverse motor test. The duplexing reverse-motor test activates the duplexing reverse motor for 10 seconds.
 - c. Select Duplexer refeed motor test. The duplexing refeed motor test activates the duplexing refeed motor for 10 seconds.
4. Check the connectors (J1902, J9946, J1909, and J1908) for correct seating and secure connection.

5. If either of these tests fail and the connectors are not damaged, replace the duplex reverse assembly.

M855 part number: RM2-0291-000CN

M880 part number: RM2-5061-000CN

6. If the motor tests pass, test SR304 to verify that the duplex re-pick feed sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR304, and then manually move the sensor to ensure that it moves freely and responds correctly to the sensor test.
 - c. If the sensor test fails, clean the sensor and then test again.
7. If the sensor test continues to fail, the sensor might be defective. Replace the duplex feed assembly.

M855 Part number: A2W77-67913

M880 Part number: A2W75-67911

8. If the sensor is functioning correctly and the error persists, replace the right door assembly.

Part number: RM1-9640-000CN

13.D3.FF

Jam in the right door.

Residual paper is detected at the duplex delivery sensor (SR302) or the duplexer refeed sensor (SR304) at power on.

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Use the Component Test menu to perform the following motor tests:
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Component Test

- b. Select the Duplexer reverse motor test. The duplexing reverse-motor test activates the duplexing reverse motor for 10 seconds.
 - c. Select Duplexer refeed motor test. The duplexing refeed motor test activates the duplexing refeed motor for 10 seconds.
4. Check the connectors (J1902, J9946, J1909, and J1908) for correct seating and secure connection.
5. If either of these tests fail and the connectors are not damaged, replace the duplex reverse assembly.

M855 part number: RM2-0291-000CN

M880 part number: RM2-5061-000CN

6. If the motor tests pass, test SR304 and verify that the duplex re-pick feed sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR304, and then manually move the sensor to ensure that it moves freely and responds correctly to the sensor test.
7. If the sensor fails, clean the sensor and then test again.
8. If the sensor test continues to fail, the sensor might be defective. Replace the duplex feed assembly.

M855 Part number: A2W77-67913

M880 Part number: A2W75-67911

9. If the sensor is functioning correctly and the error persists, replace the right door assembly.

Part number: RM1-9640-000CN

13.DF.Dz

Jam in the right door.

The paper did not reach either the duplex switchback sensor (SR301) or the duplex delivery sensor (SR302) in a designated amount of time.

- **13.DF.D1** The fuser is printing in fuser mode `Auto Sense`.
- **13.DF.D2** The fuser is printing in fuser mode `Normal`.
- **13.DF.D3** The fuser is printing in fuser mode `Light 1` or `Light 2`.
- **13.DF.D4** The fuser is printing in fuser mode `Heavy 1`.

- **13.DF.D5** The fuser is printing in fuser mode Heavy 2.
- **13.DF.D6** The fuser is printing in fuser mode Heavy paper 3.
- **13.DF.D7** The fuser is printing in fuser mode Glossy paper 1.
- **13.DF.D8** The fuser is printing in fuser mode Glossy paper 2.
- **13.DF.D9** The fuser is printing in fuser mode Glossy paper 3.

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Component Test
4. Use the Component Test menu to test the duplex reverse and refeed motors and verify that they are functioning correctly.
5. Use the Component Test menu to test the duplexer motors:
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Component Test
 - b. Select the Duplexer reverse motor test. The duplexing reverse-motor test activates the duplexing reverse motor for 10 seconds.
 - c. Select the Duplexer refeed motor test. The duplexing refeed motor test activates the duplexing refeed motor for 10 seconds.
6. If the test fails, check the connectors (J1902, J9946, J1909, and J1908) for correct seating and secure connection.
7. If either of these tests fail and the connectors are not damaged, replace the duplex reverse assembly.

M855 part number: RM2-0291-000CN

M880 part number: RM2-5061-000CN

8. If the motor tests pass, test the duplex sensors and verify that they are functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Test all of the following sensors:
 - **SR301** Duplex switchback sensor
 - **SR302** Duplex feed sensor

- **SR304** Duplex refeed sensor
9. If a sensor test fails, ensure that the sensor moves freely, clean the sensor, and then test again.
 10. If the sensor test continues to fail, the sensor might be defective. Replace the duplex feed assembly.

M855 part number: A2W77-67913

M880 part number: A2W75-67911

11. If the sensor is functioning correctly and the error persists, replace the right door assembly.

Part number: RM1-9640-000CN

13.E1.C1

Stopped at standard bin sensor.

Recommended action for customer

1. Follow the control panel animations to clear the jam.
2. Verify that the tray guides are set correctly for the tray being printed from.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Follow the control panel animations to clear the jam.
2. Verify that the tray guides are set correctly for the tray being printed from.
3. If the error persists, replace the fuser drive assembly.

Part number: RM1-9606-000CN

13.E1.Dz

Jam in the right door.

The paper did not reach the face down sensor (SR33) in the designated amount of time after the fuser delivery sensor 2 (SR45) sensed the leading edge.

- **13.E1.D1** The fuser is printing in fuser mode `Auto Sense`.
- **13.E1.D2** The fuser is printing in fuser mode `Normal`.
- **13.E1.D3** The fuser is printing in fuser mode `Light 1` or `Light 2`.
- **13.E1.D4** The fuser is printing in fuser mode `Heavy 1`.

- **13.E1.D5** The fuser is printing in fuser mode Heavy 2.
- **13.E1.D6** The fuser is printing in fuser mode Heavy paper 3.
- **13.E1.D7** The fuser is printing in fuser mode Glossy paper 1.
- **13.E1.D8** The fuser is printing in fuser mode Glossy paper 2.
- **13.E1.D9** The fuser is printing in fuser mode Glossy paper 3.
- **13.E1.DB** The fuser is printing in fuser mode Transparency.
- **13.E1.DC** The fuser is printing in fuser mode Label.
- **13.E1.DD** The fuser is printing in fuser mode Envelope 1, 2, 3.
- **13.E1.DE** The fuser is printing in fuser mode Rough media.
- **13.E1.D0** The fuser is printing in fuser mode Photo Media.

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Ensure that the delivery sensor flag moves smoothly.
4. Test SR33 and verify that the face-down bin full sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR33.
5. If the test fails, replace the delivery sensor assembly.

Part number: RM1-9841-000CN

6. If the test passes, make sure the fuser is installed correctly, and inspect the fuser guide and the fuser for damage or wear.
7. If damaged, check the event log for the 10.23.70 code and replace the fuser.

Note:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

8. If the error persists, inspect the right door sub assembly and replace if damaged.

Part number: RM1-9640-000CN

9. If the error persists, replace the face-down delivery assembly.

Part number: RM2-6868-000CN

13.E1.FF

Jam in the right door.

This jam occurs when residual paper is detected at the face down bin full sensor (SR33) at power on.

Recommended action

1. Remove the paper from the top output bin.
2. Open the right door and clear the jam in the indicated area.
3. Close the door to allow the printer to attempt to clear the jam.
4. Ensure that the delivery sensor flag moves smoothly.
5. Test SR33 and verify that the face-down bin full sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR33.
6. If the test fails, replace the delivery sensor assembly.

Part number: RM1-9841-000CN

7. If the test passes, make sure the fuser is installed correctly, and inspect the fuser guide and the fuser for damage or wear.
8. If damaged, check the event log for the 10.23.70 code and replace the fuser.

Note:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

9. If the error persists, replace the face-down delivery assembly.

Part number: RM2-6868-000CN

13.E2.Az

Stay jam in the input area of the IPTU.

This jam occurs when the paper stays at the IPTU feed sensor 1 (SR203) for a designated time period after the sensor detects the paper.

- **13.E2.A1** The fuser is printing in fuser mode Auto Sense.
- **13.E2.A2** The fuser is printing in fuser mode Normal.
- **13.E2.A3** The fuser is printing in fuser mode Light 1 or Light 2
- **13.E2.A4** The fuser is printing in fuser mode Heavy 1.
- **13.E2.A5** The fuser is printing in fuser mode Heavy 2.
- **13.E2.A6** The fuser is printing in fuser mode Heavy paper 3.
- **13.E2.A7** The fuser is printing in fuser mode Glossy paper 1.
- **13.E2.A8** The fuser is printing in fuser mode Glossy paper 2.
- **13.E2.A9** The fuser is printing in fuser mode Glossy paper 3.
- **13.E2.AB** The fuser is printing in fuser mode Transparency.
- **13.E2.AC** The fuser is printing in fuser mode Label.
- **13.E2.AD** The fuser is printing in fuser mode Envelope 1 or Envelope 2

Recommended action

1. Follow the on screen instructions to locate and remove the paper or obstruction.
2. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
3. Check the input side of the IPTU for any damaged or excessive wear.
4. Ensure that the delivery assembly is not damaged and the finisher is aligned correctly with the printer.
5. Open the IPTU cover and run the IPTU drive motor test to Ensure that the paper-transport motors are functioning correctly.
6. Test the IPTU drive motor.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Component Test
 - b. Select the IPTU drive motor test.

Note:

This test activates the IPTU motors and is only available when the IPTU is installed. During the test, observe the two sets of rollers on the right side and left side while facing the IPTU. M201 drives the input area rollers of the IPTU and M202 drives the output area rollers.

7. If the rollers in one area of the IPTU do not rotate, replace the DC motor assembly M201 or M202.

Part number: RK2-1320-000CN

8. If both sets of rollers react the same way, rotate or do not rotate, check the IPTU around sensor SR203 for something blocking the paper path or for any damage or excessive wear.

9. Test the SR201, SR202, and SR203 paper path sensors in the IPTU.

- a. Open the following menus:

- Administration
- Troubleshooting
- Diagnostic Tests
- Manual Sensor Test

- b. Test all three IPTU paper path sensors, SR201, SR202, and SR203.

- c. If the IPTU drive motor test **passed**, and the sensor test fails, replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

- d. If the IPTU drive motor test **failed**, and the sensor test fails replace the IPTU controller PCA.

Part number: RM2-7019-000CN

10. If the error persists, replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

13.E2.Dz

Delay jam at the input area of the IPTU.

The paper did not reach the IPTU feed sensor 1 (SR203) in the designated amount of time.

- **13.E2.D1** The fuser is printing in fuser mode `Auto Sense`.
- **13.E2.D2** The fuser is printing in fuser mode `Normal`.
- **13.E2.D3** The fuser is printing in fuser mode `Light 1` or `Light 2`.
- **13.E2.D4** The fuser is printing in fuser mode `Heavy 1`.

- **13.E2.D5** The fuser is printing in fuser mode Heavy 2.
- **13.E2.D6** The fuser is printing in fuser mode Heavy paper 3.
- **13.E2.D7** The fuser is printing in fuser mode Glossy paper 1.
- **13.E2.D8** The fuser is printing in fuser mode Glossy paper 2.
- **13.E2.D9** The fuser is printing in fuser mode Glossy paper 3.
- **13.E2.DB** The fuser is printing in fuser mode Transparency.
- **13.E2.DC** The fuser is printing in fuser mode Label.
- **13.E2.DD** The fuser is printing in fuser mode Envelope 1 or Envelope 2.

Recommended action

1. Follow the on screen instructions to locate and remove the paper or obstruction.
2. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
3. Check the input side of the IPTU for any damaged or excessive wear.
4. Ensure that the delivery assembly is not damaged and the finisher is aligned correctly with the printer.
5. Open the IPTU cover and run the IPTU drive motor test to Ensure that the paper-transport motors are functioning correctly.
6. Test the IPTU drive motor.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Component Test
 - b. Select the IPTU drive motor test.

Note:

This test activates the IPTU motors and is only available when the IPTU is installed. During the test, observe the two sets of rollers on the right side and left side while facing the IPTU. M201 drives the input area rollers of the IPTU and M202 drives the output area rollers.

7. If the rollers in one area of the IPTU do not rotate, replace the DC motor assembly M201 or M202.

Part number: RK2-1320-000CN

If both sets of rollers react the same way, rotate or do not rotate, proceed with the next step.

8. Check the IPTU around sensor SR203 to see if there is something possibly blocking the paper path or for any damaged or excessive wear.
9. Test the SR201, SR202, and SR203 paper path sensors in the IPTU.
 - a. Open the following menus:

- Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
- b. Test all three IPTU paper path sensors, SR201, SR202, and SR203.
- c. If the IPTU drive motor test **passed**, and the sensor test fails replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

- d. If the IPTU drive motor test **failed**, and the sensor test fails replace the IPTU controller PCA.

Part number: RM2-7019-000CN

10. If the error persists, replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

13.E3.Az

Stay jam in the IPTU.

This jam occurs when the paper stays at the IPTU feed sensor 2 (SR202) for a designated time period after the sensor detects the paper.

- **13.E3.A1** The fuser is printing in fuser mode Auto Sense .
- **13.E3.A2** The fuser is printing in fuser mode Normal.
- **13.E3.A3** The fuser is printing in fuser mode Light 1 or Light 2.
- **13.E3.A4** The fuser is printing in fuser mode Heavy 1.
- **13.E3.A5** The fuser is printing in fuser mode Heavy 2.
- **13.E3.A6** The fuser is printing in fuser mode Heavy paper 3.
- **13.E3.A7** The fuser is printing in fuser mode Glossy paper 1.
- **13.E3.A8** The fuser is printing in fuser mode Glossy paper 2.
- **13.E3.A9** The fuser is printing in fuser mode Glossy paper 3.
- **13.E3.AB** The fuser is printing in fuser mode Transparency.
- **13.E3.AC** The fuser is printing in fuser mode Label.
- **13.E3.AD** The fuser is printing in fuser mode Envelope 1 or Envelope 2.

Recommended action

1. Follow the on screen instructions to locate and remove the paper or obstruction.
2. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
3. Check the input side of the IPTU for any damaged or excessive wear.

4. Ensure that the delivery assembly is not damaged and the finisher is aligned correctly with the printer.
5. Open the IPTU cover and run the IPTU drive motor test to Ensure that the paper-transport motors are functioning correctly.
6. Test the IPTU drive motor.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Component Test
 - b. Select the IPTU drive motor test.

Note:

This test activates the IPTU motors and is only available when the IPTU is installed. During the test, observe the two sets of rollers on the right side and left side while facing the IPTU. M201 drives the input area rollers of the IPTU and M202 drives the output area rollers.

7. If the rollers in one area of the IPTU do not rotate, replace the DC motor assembly M201 or M202.

Part number: RK2-1320-000CN

8. If both sets of rollers react the same way, rotate or do not rotate, check the IPTU around sensor SR203 for something blocking the paper path or for any damage or excessive wear.
9. Test the SR201, SR202, and SR203 paper path sensors in the IPTU.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Test all three IPTU paper path sensors, SR201, SR202, and SR203.
 - c. If the IPTU drive motor test **passed**, and the sensor test fails replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

- d. If the IPTU drive motor test **failed**, and the sensor test fails replace the IPTU controller PCA.

Part number: RM2-7019-000CN

10. If the error persists, replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

13.E3.Dz

Delay jam in the IPTU.

The paper did not reach the IPTU feed sensor 2 (SR202) in the designated amount of time.

- **13.E3.D1** The fuser is printing in fuser mode `Auto Sense`.
- **13.E3.D2** The fuser is printing in fuser mode `Normal`.
- **13.E3.D3** The fuser is printing in fuser mode `Light 1` or `Light 2`.
- **13.E3.D4** The fuser is printing in fuser mode `Heavy 1`.
- **13.E3.D5** The fuser is printing in fuser mode `Heavy 2`.
- **13.E3.D6** The fuser is printing in fuser mode `Heavy paper 3`.
- **13.E3.D7** The fuser is printing in fuser mode `Glossy paper 1`.
- **13.E3.D8** The fuser is printing in fuser mode `Glossy paper 2`.
- **13.E3.D9** The fuser is printing in fuser mode `Glossy paper 3`.
- **13.E3.DB** The fuser is printing in fuser mode `Transparency`.
- **13.E3.DC** The fuser is printing in fuser mode `Label`.
- **13.E3.DD** The fuser is printing in fuser mode `Envelope 1` or `Envelope 2`.

Recommended action

1. Follow the on screen instructions to locate and remove the paper or obstruction.
2. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
3. Check the input side of the IPTU for any damaged or excessive wear.
4. Ensure that the delivery assembly is not damaged and the finisher is aligned correctly with the printer.
5. Open the IPTU cover and run the IPTU drive motor test to Ensure that the paper-transport motors are functioning correctly.
6. Test the IPTU drive motor.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Component Test
 - b. Select the IPTU drive motor test.

Note:

This test activates the IPTU motors and is only available when the IPTU is installed. During the test, observe the two sets of rollers on the right side and left side while facing the IPTU. M201 drives the input area rollers of the IPTU and M202 drives the output area rollers.

7. If the rollers in one area of the IPTU do not rotate, replace the DC motor assembly M201 or M202.

Part number: RK2-1320-000CN

8. If both sets of rollers react the same way, rotate or do not rotate, check the IPTU around sensor SR203 for something blocking the paper path or for any damage or excessive wear.
9. Test the SR201, SR202, and SR203 paper path sensors in the IPTU.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Test all three IPTU paper path sensors, SR201, SR202, and SR203.
 - c. If the IPTU drive motor test **passed**, and the sensor test fails replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

- d. If the IPTU drive motor test **failed**, and the sensor test fails replace the IPTU controller PCA.

Part number: RM2-7019-000CN

10. If the error persists, replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

13.E4.Az

Stay jam at the exit area of the IPTU.

This jam occurs when the paper stays at the IPTU feed sensor 3 (SR201) for a designated time period after the sensor detects the paper.

- **13.E4.A1** The fuser is printing in fuser mode `Auto Sense`.
- **13.E4.A2** The fuser is printing in fuser mode `Normal`.
- **13.E4.A3** The fuser is printing in fuser mode `Light 1` or `Light 2`.
- **13.E4.A4** The fuser is printing in fuser mode `Heavy 1`.
- **13.E4.A5** The fuser is printing in fuser mode `Heavy 2`.
- **13.E4.A6** The fuser is printing in fuser mode `Heavy paper 3`.
- **13.E4.A7** The fuser is printing in fuser mode `Glossy paper 1`.
- **13.E4.A8** The fuser is printing in fuser mode `Glossy paper 2`.
- **13.E4.A9** The fuser is printing in fuser mode `Glossy paper 3`.

- **13.E4.AB** The fuser is printing in fuser mode *Transparency*.
- **13.E4.AC** The fuser is printing in fuser mode *Label*.
- **13.E4.AD** The fuser is printing in fuser mode *Envelope 1* or *Envelope 2*.

Recommended action

1. Follow the on screen instructions to locate and remove the paper or obstruction.
2. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
3. Check the input side of the IPTU for any damaged or excessive wear.
4. Ensure that the delivery assembly is not damaged and the finisher is aligned correctly with the printer.
5. Open the IPTU cover and run the IPTU drive motor test to Ensure that the paper-transport motors are functioning correctly.
6. Test the IPTU drive motor.

- a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Component Test
- b. Select the IPTU drive motor test.

Note:

This test activates the IPTU motors and is only available when the IPTU is installed. During the test, observe the two sets of rollers on the right side and left side while facing the IPTU. M201 drives the input area rollers of the IPTU and M202 drives the output area rollers.

- c. If the rollers in one area of the IPTU do not rotate, replace the DC motor assembly M201 or M202.

Part number: RK2-1320-000CN

- d. If both sets of rollers react the same way, rotate or do not rotate, check the IPTU around sensor SR203 for something blocking the paper path, or for any damage or excessive wear.
7. Test the SR201, SR202, and SR203 paper path sensors in the IPTU.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Test all three IPTU paper path sensors, SR201, SR202, and SR203.
 - c. If the IPTU drive motor test **passed**, and the sensor test fails replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

- d. If the IPTU drive motor test **failed**, and the sensor test fails replace the IPTU controller PCA.


Part number: RM2-7019-000CN

8. Check the white wheels on the entrance to the upper-guide assembly on the HCO for damage, skew, or missing rollers.

Note: If the rollers are not installed correctly, it can cause the HCO to not pull the paper from the IPTU and a stay jam at the output sensor SR201 can occur.

9. If a roller is out of the sheet metal holder, tighten the holding clip by pinching both sides of the holder together with the white roller removed.


Note: This will apply more force to the sides of the roller and help hold it more securely. Many times the rollers can be found inside the output device.

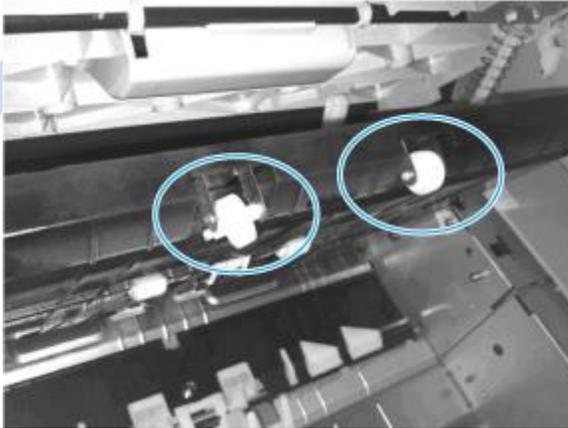

10. Check the connector from the IPTU to the output device and ensure that is connected correctly.

Note: If this connector is loose or damaged the HCO will not work causing a stay jam at IPTU sensor SR201.

- a. Push in on the tab to release the connector housing.
- b. Check to ensure that the connector is not loose or disconnected.

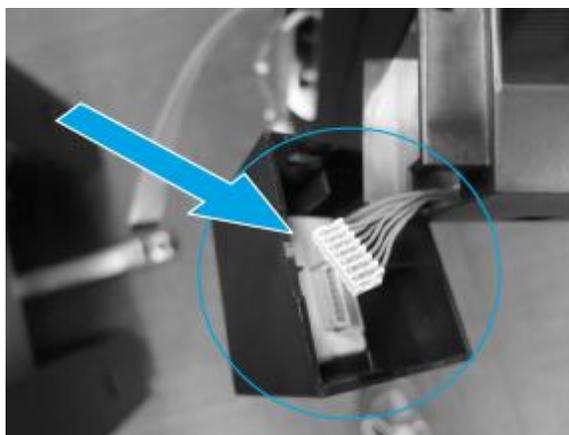

Connector disconnected

11. If the error persists, replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

13.E4.Dz

Delay jam to the last sensor in IPTU.

The paper did not reach the IPTU feed sensor 3 (SR201) in the designated amount of time.

- **13.E4.D1** The fuser is printing in fuser mode Auto Sense
- **13.E4.D2** The fuser is printing in fuser mode Normal.
- **13.E4.D3** The fuser is printing in fuser mode Light 1 or Light 2.
- **13.E4.D4** The fuser is printing in fuser mode Heavy 1.
- **13.E4.D5** The fuser is printing in fuser mode Heavy 2.
- **13.E4.D6** The fuser is printing in fuser mode Heavy paper 3.
- **13.E4.D7** The fuser is printing in fuser mode Glossy paper 1.
- **13.E4.D8** The fuser is printing in fuser mode Glossy paper 2.
- **13.E4.D9** The fuser is printing in fuser mode Glossy paper 3.
- **13.E4.DB** The fuser is printing in fuser mode Transparency.
- **13.E4.DC** The fuser is printing in fuser mode Label.
- **13.E4.DD** The fuser is printing in fuser mode Envelope 1 or Envelope 2.

Recommended action

1. Follow the on screen instructions to locate and remove the paper or obstruction.
2. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
3. Check the input side of the IPTU for any damaged or excessive wear.
4. Ensure that the delivery assembly is not damaged and the finisher is aligned correctly with the printer.
5. Test the IPTU drive motor.

- a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Component Test
- b. Select the IPTU drive motor test.

Note:

This test activates the IPTU motors and is only available when the IPTU is installed. During the test, observe the two sets of rollers on the right side and left side while facing the IPTU. M201 drives the input area rollers of the IPTU and M202 drives the output area rollers.

6. If the rollers in one area of the IPTU do not rotate, replace the DC motor assembly M201 or M202.

Part number: RK2-1320-000CN

7. If both sets of rollers react the same way, rotate or do not rotate, check the IPTU around sensor SR203 for something blocking the paper path or for any damage or excessive wear.
8. Test the SR201, SR202, and SR203 paper path sensors in the IPTU.

- a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
- b. Test all three IPTU paper path sensors, SR201, SR202, and SR203.
- c. If the IPTU drive motor test **passed**, and the sensor test fails replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

- d. If the IPTU drive motor test **failed**, and the sensor test fails replace the IPTU controller PCA.

Part number: RM2-7019-000CN

9. If the error persists, replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

13.E6.Dz

Delay jam in the right door

The paper did not reach the face down sensor (SR33) in the designated amount of time after the fuser delivery sensor 2 (SR45) sensed the leading edge.

- **13.E6.D1** The fuser is printing in fuser mode Auto Sense.
- **13.E6.D2** The fuser is printing in fuser mode Normal.
- **13.E6.D3** The fuser is printing in fuser mode Light 1 or Light 2.
- **13.E6.D4** The fuser is printing in fuser mode Heavy 1.
- **13.E6.D5** The fuser is printing in fuser mode Heavy 2.
- **13.E6.D6** The fuser is printing in fuser mode Heavy paper 3.
- **13.E6.D7** The fuser is printing in fuser mode Glossy paper 1.
- **13.E6.D8** The fuser is printing in fuser mode Glossy paper 2.
- **13.E6.D9** The fuser is printing in fuser mode Glossy paper 3.
- **13.E6.DB** The fuser is printing in fuser mode Transparency.
- **13.E6.DC** The fuser is printing in fuser mode Label.
- **13.E6.DD** The fuser is printing in fuser mode Envelope 1 or Envelope 2

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Ensure that the delivery flags move smoothly.
4. Test SR33 and verify that the face-down bin full sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR33.
5. If the test fails, replace the delivery sensor assembly.

Part number: RM1-9841-000CN

6. Make sure the fuser is installed correctly, and inspect the fuser guide and the fuser for damage or wear.
7. If damaged, check the event log for the 10.23.70 code and replace the fuser.

Note:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

8. If the error persists, inspect the right door sub assembly and replace if damaged.

Part number: RM1-9640-000CN

9. If the error persists, replace the face-down delivery assembly.

Part number: RM2-6868-000CN

13.E6.FF

Residual jam in the right door.

This jam occurs when residual paper is detected at the face-down bin full sensor (SR33) at power on.

Recommended action

1. Open the right door and clear the jam in the indicated area.
2. Close the door to allow the printer to attempt to clear the jam.
3. Ensure that the delivery flags move smoothly.
4. Test SR33 and verify that the face-down bin full sensor is functioning correctly.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - b. Select SR33.
5. If the test fails, replace the delivery sensor assembly.

Part number: RM1-9841-000CN

6. If the error persists, replace the face-down delivery assembly.

Part number: RM2-6868-000CN

13.EA.EE

IPTU door open jam.

This jam occurs when the IPTU door (SR204) is opened during printing.

Recommended action

1. Close the IPTU door to allow the printer to attempt to clear the jam.
2. Test SR204 and verify that the sensor is functioning correctly.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Sensor Tests

FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Manual Sensor Test
- b. Select SR204.
 3. If the test fails, or if the error persists, replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

13.EF.Az

Stay jam in IPTU at multiple sensors.

Output (IPTU) area jam triggered by multiple sensors.

Paper is jammed in the IPTU. The IPTU might have the power or data cables disconnected or interconnects not connected correctly.

- **13.EF.A1** The fuser is printing in fuser mode Auto Sense.
- **13.EF.A2** The fuser is printing in fuser mode Normal.
- **13.EF.A3** The fuser is printing in fuser mode Light 1 or Light 2.
- **13.EF.A4** The fuser is printing in fuser mode Heavy 1.
- **13.EF.A5** The fuser is printing in fuser mode Heavy 2.
- **13.EF.A6** The fuser is printing in fuser mode Heavy paper 3.
- **13.EF.A7** The fuser is printing in fuser mode Glossy paper 1.
- **13.EF.A8** The fuser is printing in fuser mode Glossy paper 2.
- **13.EF.A9** The fuser is printing in fuser mode Glossy paper 3.
- **13.EF.AA** The fuser is printing in fuser mode Glossy Film.

- **13.EF.AB** The fuser is printing in fuser mode *Transparency*.
- **13.EF.AC** The fuser is printing in fuser mode *Label*.
- **13.EF.AD** The fuser is printing in fuser mode *Envelope 1* or *Envelope 2*.
- **13.EF.AE** The fuser is printing in fuser mode *Rough*.
- **13.EF.A0** The fuser is printing in fuser mode *Photo Media*.

Recommended action

1. Follow the on screen instructions to locate and remove the paper or obstruction.
2. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
3. Check that the finisher is aligned correctly with the printer.
4. Check the IPTU for any damage or excessive wear, and physically check sensors SR201, SR202, and SR203. If any of the sensors or rollers are worn or damaged, replace the IPTU lower guide assembly.


Part number: RM2-5057-000CN

5. Make sure that the ITPU delivery assembly is not damaged. If it is damaged, replace the face-down delivery assembly.

Part number: RM2-6868-000CN

6. Check the rollers on the entrance upper-guide and saddle-feed assemblies.
7. Check the white wheels on the entrance to the upper-guide assembly for damage, skew, or missing rollers.
8. Check inside the output device for any displaced rollers.
 - a. If a roller is displaced from the sheet metal holder, retrieve the rollers and set aside.
 - b. Tighten the holding clip by pinching both sides of the holder together. This will apply more force to the sides of the roller and help hold it more securely.

Entrance to upper guide white wheels

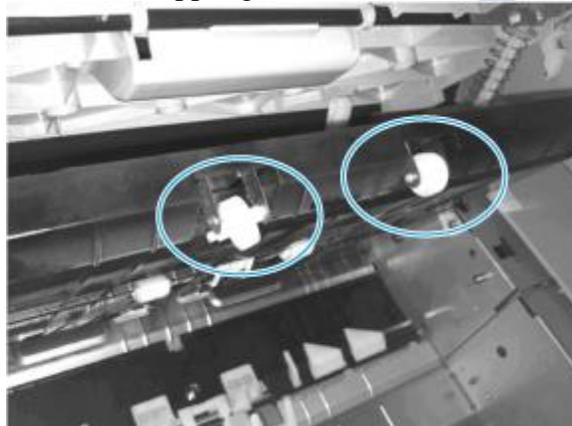


- c. Reinstall any recovered rollers securely, and order new rollers for any that are missing.
9. Check the connector from the IPTU to the output device and ensure that it is connected correctly.




IPTU unit connector

- a. Push in on the tab to release the connector housing.

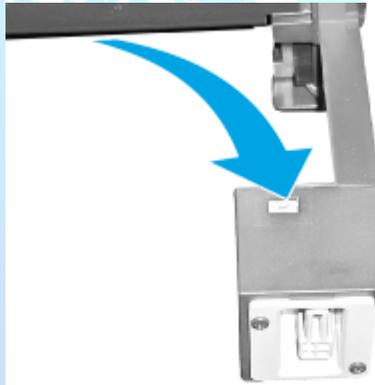

Opening IPTU connector

- b. Check to ensure that the connector is not loose or disconnected.

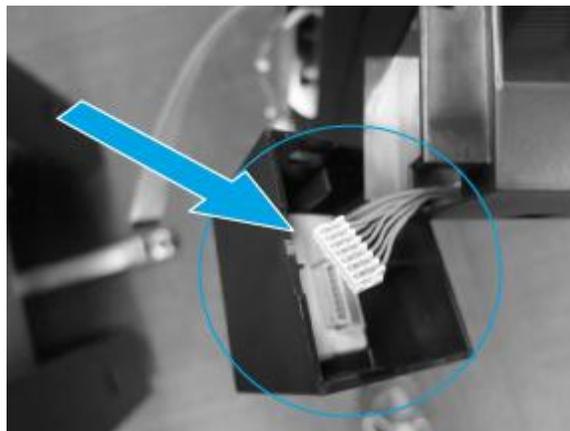

Connector disconnected

10. Check the cables on the IPTU controller to make sure that they are seated correctly and not damaged.
11. If the lock assembly or connector is damaged, replace the finisher lock assembly (IPTU).

Part number: RM2-5038-000CN

12. If the paper is jamming at the output of the IPTU, use the Component Test menu to test M113 and verify that the saddle inlet motor is functioning correctly.

Note:

If the saddle motor is not working the paper will not be pulled from the IPTU into the HCO.

- a. Open the following menus:
 - Administration
 - Troubleshooting
 - Component Test
 - b. Select M113 and then observe whether or not the paper is being pulled from the IPTU into the HCO.
13. If the test fails, make sure the connection on the PCA (J803) is seated correctly and fully connected.
 14. If the error persists and the connectors are not damaged, replace the M113 motor.

Part number: FM2-0737-000CN

15. If the error persists, replace the driver PCA.

Part number: RM2-7590-000CN

16. If the error persists, replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

13.EF.Dz

Jam in the IPTU. Delay to the IPTU output sensor.

Output (IPTU) area jam triggered by multiple sensors.

- **13.EF.D1** The fuser is printing in fuser mode `Auto Sense`.
- **13.EF.D2** The fuser is printing in fuser mode `Normal`.
- **13.EF.D3** The fuser is printing in fuser mode `Light 1` or `Light 2`.
- **13.EF.D4** The fuser is printing in fuser mode `Heavy 1`.
- **13.EF.D5** The fuser is printing in fuser mode `Heavy 2`.

- **13.EF.D6** The fuser is printing in fuser mode Heavy paper 3.
- **13.EF.D7** The fuser is printing in fuser mode Glossy paper 1.
- **13.EF.D8** The fuser is printing in fuser mode Glossy paper 2.
- **13.EF.D9** The fuser is printing in fuser mode Glossy paper 3.
- **13.EF.DA** The fuser is printing in fuser mode Glossy Film.
- **13.EF.DB** The fuser is printing in fuser mode Transparency.
- **13.EF.DC** The fuser is printing in fuser mode Label.
- **13.EF.DD** The fuser is printing in fuser mode Envelope 1 or Envelope 2.
- **13.EF.DE** The fuser is printing in fuser mode Rough.
- **13.EF.D0** The fuser is printing in fuser mode Photo Media.

Recommended action

1. Follow the on screen instructions to locate and remove the paper or obstruction.
2. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
3. Check that the finisher is aligned correctly with the printer.
4. Check the IPTU for any damaged or excessive wear, physically check sensors SR201, SR202, SR203. If any of the sensors or rollers are worn or damaged, replace the IPTU lower guide assembly.


Part number: RM2-5057-000CN

5. Make sure the ITPU delivery assembly is not damaged. If it is damaged, replace the face-down delivery assembly.

Part number: RM2-6868-000CN

6. Check the rollers on the entrance upper-guide and saddle-feed assemblies.
7. Check the white wheels on the entrance to the upper-guide assembly for damage, skew, or missing rollers.
8. Check inside the output device for any displaced rollers.
 - a. If a roller is displaced from the sheet metal holder, retrieve the rollers and set aside.
 - b. Tighten the holding clip by pinching both sides of the holder together. This will apply more force to the sides of the roller and help hold it more securely.

Entrance to upper guide white wheels

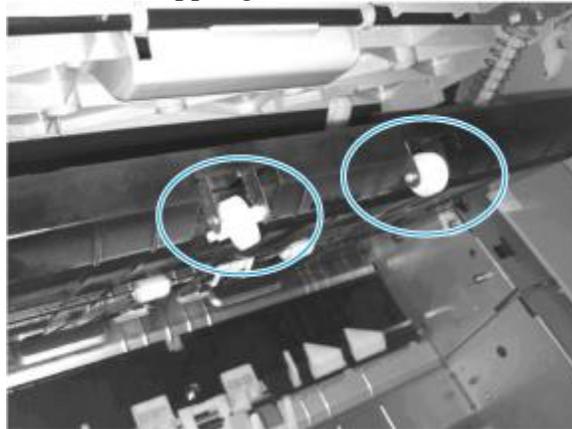


- c. Reinstall any recovered rollers securely, and order new rollers for any that are missing.
9. Check the connector from the IPTU to the output device and ensure that is connected correctly.




IPTU unit connector

- a. Push in on the tab to release the connector housing.

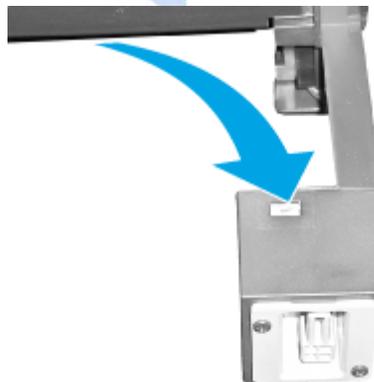

Opening IPTU connector

- b. Check to ensure that the connector is not loose or disconnected.

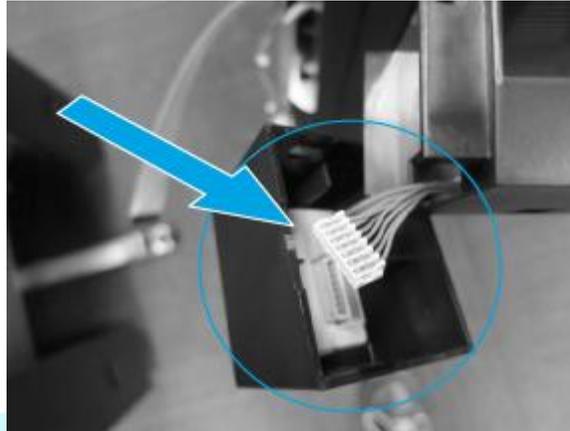

Connector disconnected

10. Check the cables on the IPTU controller to make sure that they are seated correctly and not damaged.
11. If the lock assembly or connector is damaged, replace the finisher lock assembly/IPTU.

Part number: RM2-5038-000CN

12. If the paper is jamming at the output of the IPTU, use the Component Test menu to test M113 and verify that the saddle inlet motor is functioning correctly.

Note:

If the saddle motor is not working the paper will not be pulled from the IPTU into the HCO.

- a. Open the following menus:
 - Administration
 - Troubleshooting
 - Component Test
 - b. Select M133 and then observe whether or not the paper is being pulled from the IPTU into the HCO.
13. If the test fails, Ensure that the connection on the PCA (J803) is seated correctly and fully connected.
 14. If the error persists and the connectors are not damaged, replace the M113 motor.

Part number: FM2-0737-000CN

15. If the error persists, replace the driver PCA.

Part number: RM2-7590-000CN

16. If the error persists, replace the IPTU lower guide assembly.

Part number: RM2-5057-000CN

13.FF.FF Jam inside upper right door

Paper jam in printer.

This jam occurs when residual paper is detected at the multiple paper path sensors.

This jam code will only be in the event log if it is a residual jam at power on.

Recommended action

1. Determine if there was a previous jam code.

Note:

Normally, before the 13.FF.FF is displayed there is another jam code with the same or very close page count.


- a. Check the event log by using the EWS or control panel for any previous error message.
 - b. If listed, troubleshoot each error message in the order presented.
2. If no previous jam message is present, check the following locations for possible paper jams.

Note:

Check for small pieces of paper in the paper path and check for paper dust or toner dust contamination that might cause a blockage of an optical sensor.



Callouts

- SR302 Developer delivery sensor (Callout - 1)
- SR304 Duplex refeed sensor (Callout - 2)
- SR45 Fuser output sensor 2 (Callout - 3)
- SR35 Fuser output sensor 1 (Callout - 4)
- SR24 tray 1 feed sensor (Callout - 5)
- SR2501 TOP sensor (Callout - 6)
- SR29 Fuser loop 1 sensor (Callout - 7)
- SR37 / SR38 Fuser width sensors (Callout - 8)

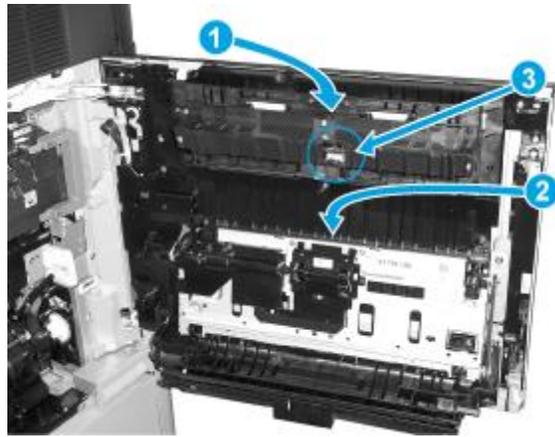

Right door sensors

Right door internal fuser and tray feed sensor

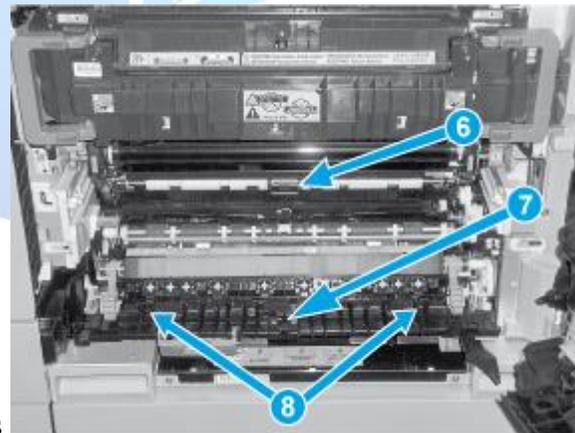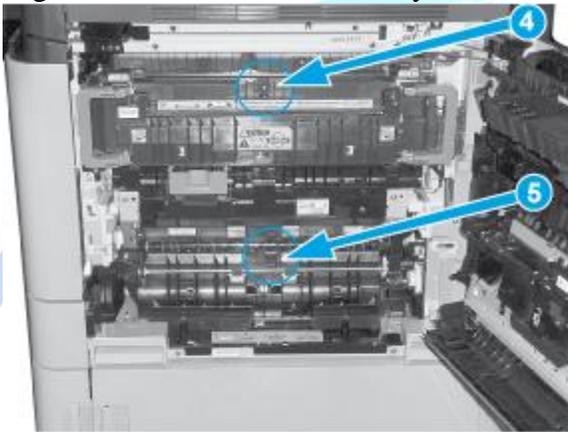

Right door internal access sensors

3. Turn the printer off. Remove the fuser.

CAUTION:


The fuser might be hot.

Note:

Reseating the fuser forces the printer to preform a sensor check on all sensors to clear the jam condition.

4. Turn the power on with the fuser out and allow the device to prompt to install the fuser.
5. If the error persists (without a previous jam code), test the sensors.
 - . Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Manual Sensor Test
 - a. Select each of the following sensors (one at a time), and then manually move the sensor to ensure that it moves freely and responds correctly to the sensor test.
 - SR302, SR304, SR35, and SR45
 - SR24
 - SR2501
 - SR29, SR37, or SR38
 - b. If the sensor fails to change state, clean the sensor of paper dust or toner, and then test again.
 - c. If SR304 is intermittent check for a loose spring, see the following image.

Right door spring

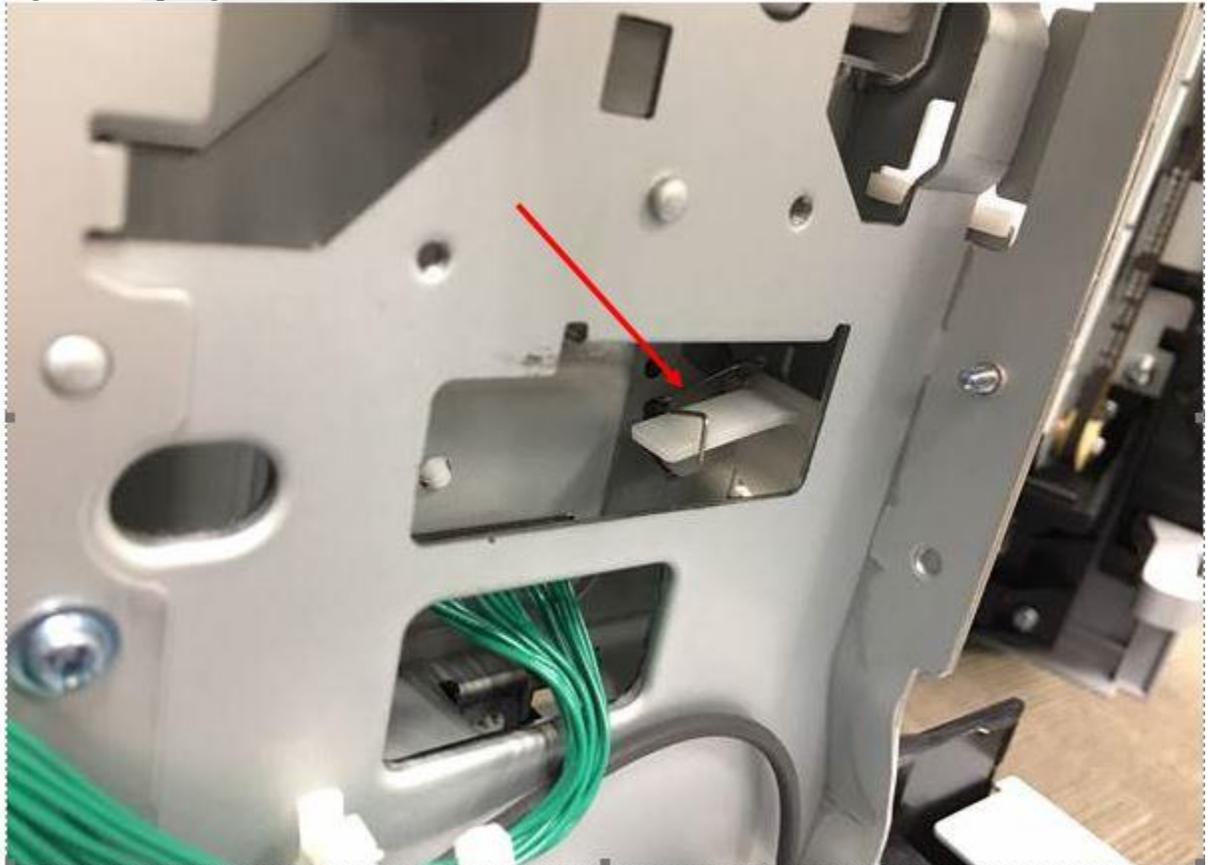


- d. If the sensor test still fails, the sensor might be defective. Replace the sensor or the assembly containing the sensor.

SR302, SR304, SR35, or SR45: RM1-9640-000CN

SR24: RM1-9615-000CN

SR2501: A2W77-67901

SR29, SR37, or SR38: RM2-6856-000CN

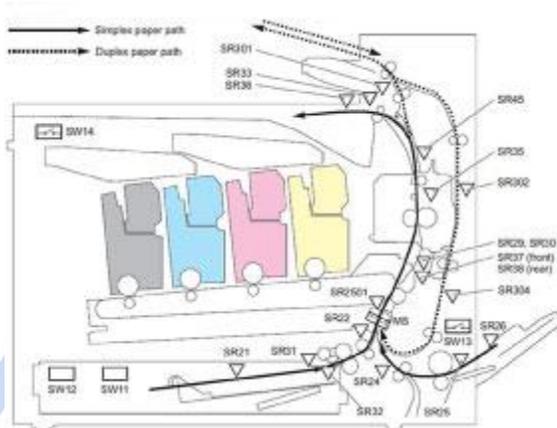

- 6.
7. Close all the doors to allow the printer to attempt to clear the paper path.

13.41.A1 or 13.41.A2 Jam in top left door

Paper stay jam in top left door of HCO at the punch path sensor.

The finisher's punch path sensor (PS2) remains activated longer than expected.

PS 2 (trailing edge sensor) is located in the paper path within the punch unit on a circuit board with four other paper sensors. Every sheet of paper printed on by the printer must pass by these five sensors regardless of whether or not the sheet is being hole-punched. For this reason, paper dust accumulation can cause a false reading on the trailing edge sensor (PS2).

Preliminary troubleshooting

1. Open the front left door and the top left door.
2. Turn the green wheel to align the arrows.
3. Lift the puncher top cover.
4. Remove all paper from the left bins.
5. Remove all paper found inside the top left door area.
6. Close the puncher top cover.
7. Close the top left door and close the front left door.

8. Verify that the finisher is securely fastened to the engine. Make sure that the finisher and printer are aligned correctly. Adjust the finisher castors to obtain a uniform gap between the finisher and the engine. With the engine-to-finisher gap correct, make sure that the finisher paper path entry point is aligned with the printer exit point.
9. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer's punching capabilities.

Clear and clean the paper punch path

1. Open the front door of the finisher and remove the punch waste bin from the punch unit.
2. Remove any media in the upper paper path that might be activating sensor PS2.
3. Open the top of the punch unit to better expose the punch paper path.
4. Locate the five sensors, including PS2, that are located above and below the paper path.


Note:


The sensors are covered by clear plastic windows to protect the sensors.

5. Clean the plastic windows that are located on the rear half of the punch paper path.
6. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.

Note:

A can of pressurized air or a blower brush will work well for this step.

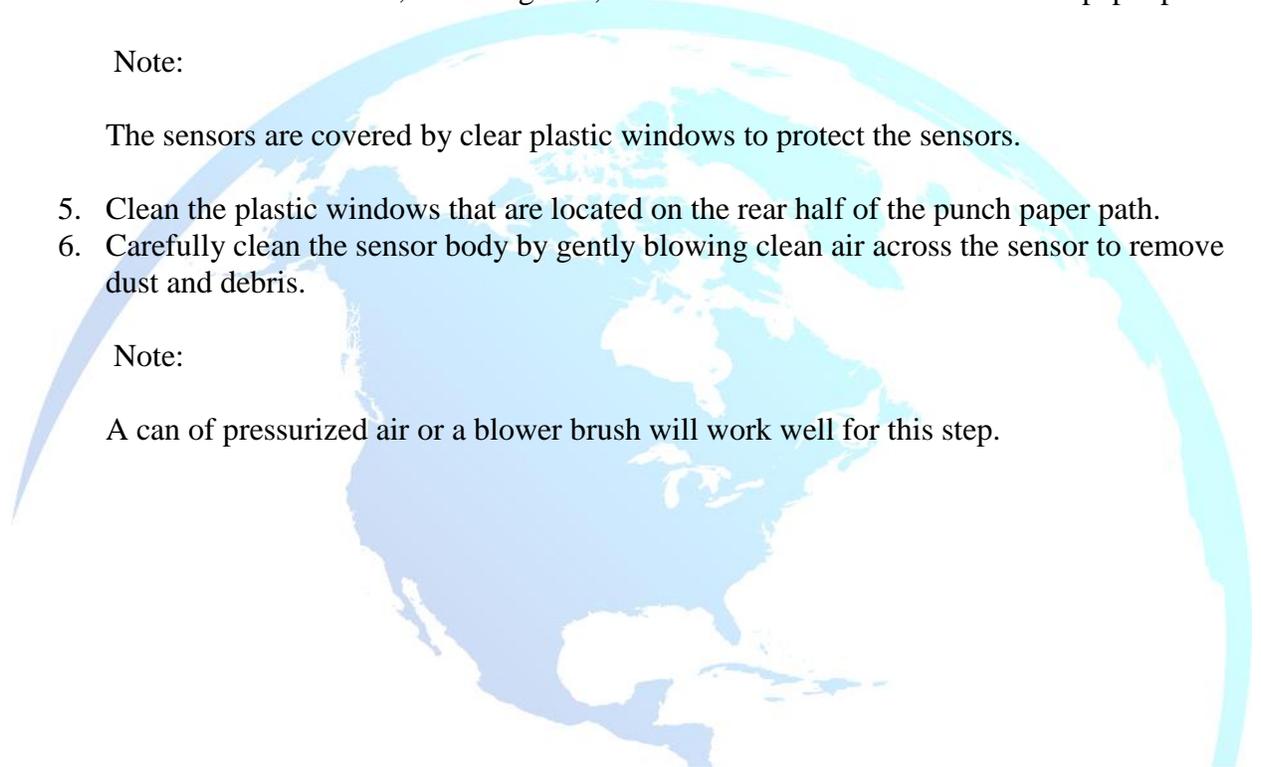

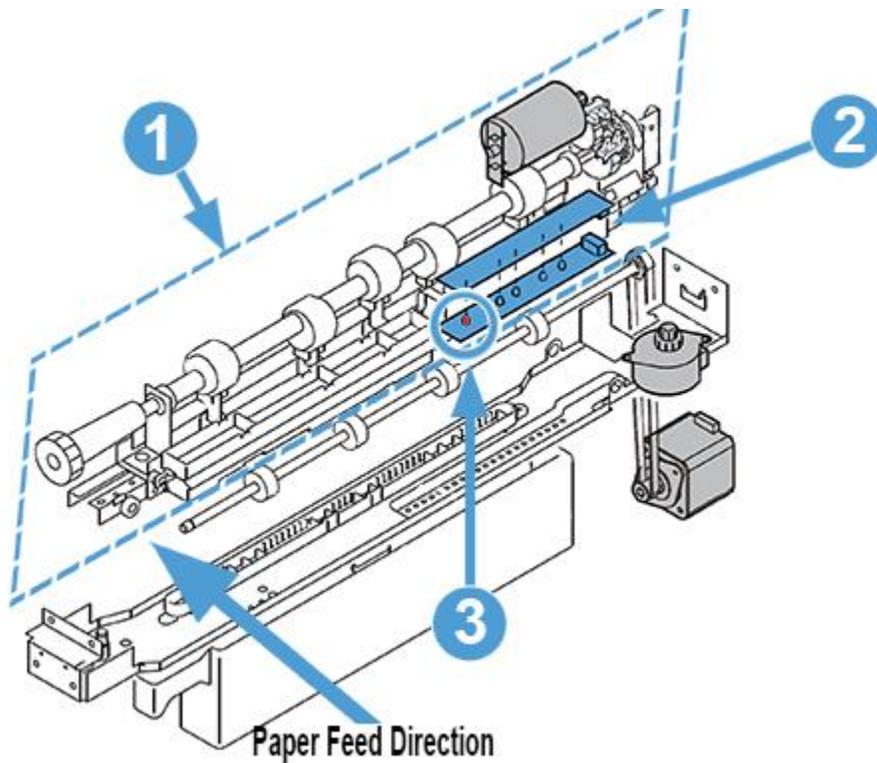

Callout 1: Punch slide assembly.

Callout 2: Photosensor PCA and LED PCA.

Callout 3: PS2 Trailing edge sensor.

7. If the error persists, further clean the sensor windows on the upper and lower portions of the paper path guides using a slightly damp, clean cloth.
8. Insert the cloth into the rear half of the punch paper path and wipe away any buildup on the sensor windows.
9. Check the connector on the stacker controller PCA for correct seating and a secure connection, and verify that the wiring at the sensor is not damaged.
10. If the error persists, replace the punch assembly.

Note:

Be sure to order the correct model for the printer region: 2/3 hole or 3/4 hole punch unit.

2/3 Punch hole assembly part number: A2W94-67901

2/4 Punch hole assembly part number: CZ999-67902

13.41.D1 or 13.41.D2 Jam in top left door

Paper delay jam at the punch path sensor.

The punch unit sensor PS2, which detects the paper entering the punch unit from the printer, did not detect the paper within the expected time period after the tripping the last internal printer paper path sensor.

PS 2 (trailing edge sensor) is located in the paper path within the punch unit on a circuit board with four other paper sensors. Every sheet of paper printed on by the printer must pass by these five sensors regardless of whether or not the sheet is being hole-punched. For this reason, paper dust accumulation can cause a false reading on the trailing edge sensor (PS2).

Preliminary troubleshooting

1. Open the front left door and the top left door.
2. Turn the green wheel to align the arrows.
3. Lift the puncher top cover.
4. Remove all paper from the left bins.
5. Remove all paper found inside the top left door area.
6. Close the puncher top cover, close the top left door, and close the front left door.
7. Verify that the finisher is securely fastened to the engine. Make sure that the finisher and printer are aligned correctly. Adjust the finisher castors to obtain a uniform gap between the finisher and the engine. With the engine-to-finisher gap correct, make sure that the finisher paper path entry point is aligned with the printer exit point.
8. Ensure that the paper meets the following conditions:
 - It is in good condition, and not wrinkled or damaged.
 - The correct paper size in the trays is selected according the paper size being fed.
 - The type and quality of the paper that is being used meets the HP specifications for the punching capabilities of the printer.
9. Print and analyze the event log. Check for printer related jams occurring either in the fuser or in the duplexer. These errors might be the result of paper failing to reach the output device in the correct amount of time. Troubleshoot all printer engine jams first.

Clear and clean the paper punch path

1. Open the front door of the finisher and remove the punch waste bin from the punch unit.
2. Remove any media in the upper paper path that might be activating sensor PS2.
3. Open the top of the punch unit to better expose the punch paper path.
4. Locate the five sensors, including PS2, that are located above and below the paper path.


Note:

The sensors are covered by clear plastic windows to protect the sensors.

5. Clean the plastic windows on the rear half of the punch paper path.
6. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.

Note:

A can of pressurized air or a blower brush will work well for this step.

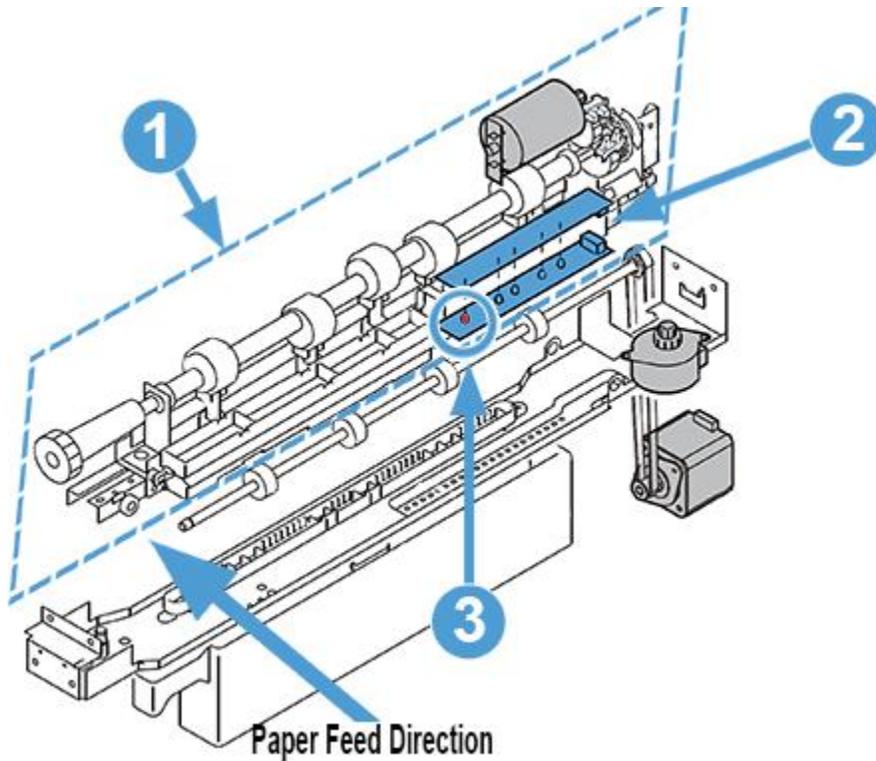

Callout 1: Punch slide assembly.

Callout 2: Photosensor PCA and LED PCA.

Callout 3: PS2 Trailing edge sensor.

7. If the error persists, further clean the sensor windows on the upper and lower portions of the paper path guides using a slightly damp, clean cloth.
8. Insert the cloth into the rear half of the punch paper path and wipe away any buildup on the sensor windows.
9. Check the connector on the stacker controller PCA for correct seating and a secure connection, and verify that the wiring at the sensor is not damaged.
10. If the error persists, replace the punch assembly.

Note:

Be sure to order the correct model for the printer region: 2/3 hole or 3/4 hole punch unit.

2/3 Punch hole assembly part number: A2W94-67901

2/4 Punch hole assembly part number: CZ999-67902

13.41.FF Jam in top left door

Paper jam in the punch unit at PS2 when the printer is turned on or after a restart.

PS 2 (trailing edge sensor) is located in the paper path within the punch unit on a circuit board with four other paper sensors. Every sheet of paper printed on by the printer must pass by these five sensors regardless of whether or not the sheet is being hole-punched. For this reason, paper dust accumulation can cause a false reading on the trailing edge sensor (PS2).

Recommended action

1. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer's punching capabilities.
2. Open the front door of the finisher and remove the punch waste bin from the punch unit.
3. Remove any media in the upper paper path that might be activating sensor PS2.
4. Open the top of the punch unit to better expose the punch paper path.
5. Locate the five sensors, including PS2, that are located above and below the paper path.


Note:

The sensors are covered by clear plastic windows to protect the sensors.

6. Clean the plastic windows located on the rear half of the punch paper path.
7. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.

Note:

A can of pressurized air or a blower brush will work well for this step.

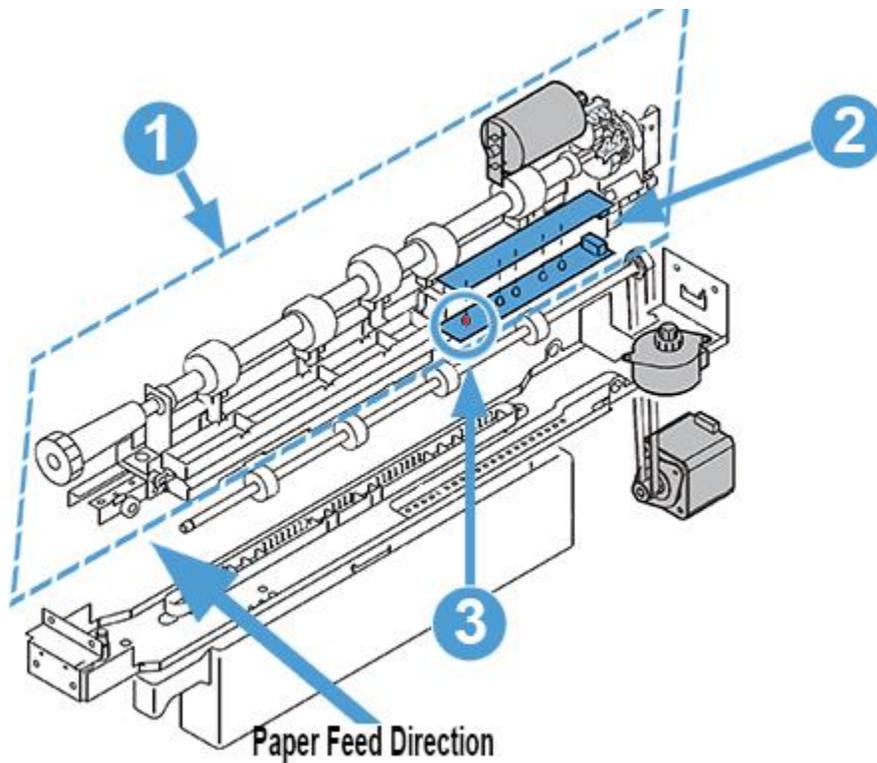

Callout 1: Punch slide assembly.

Callout 2: Photosensor PCA and LED PCA.

Callout 3: PS2 Trailing edge sensor.

8. If the error persists, further clean the sensor windows on the upper and lower portions of the paper path guides using a slightly damp, clean cloth.
9. Insert the cloth into the rear half of the punch paper path and wipe away any buildup on the sensor windows.
10. Check the connector on the stacker controller PCA for correct seating and secure connection, and ensure that the wiring at the sensor is not damaged.
11. If the error persists, replace the punch assembly.

Note:

Be sure to order the correct model for the printer region: 2/3 hole or 3/4 hole punch unit.

2/3 Punch hole assembly part number: A2W94-67901

2/4 Punch hole assembly part number: CZ999-67902

13.47.41 or 13.47.42 Jam in top left door

The punch does not return to its home position after operating.

The punch fails to return to the home position due to faulty parts such as the punch home sensor.

Recommended action

1. Open the front-left and top-left doors.
2. Turn the green wheel to align the arrows.
3. Lift the puncher top cover.
4. Remove all paper from the left bins.
5. Remove all paper found from the top-left-door area.
6. Close the puncher top cover.
7. Close the top-left door and close the front-left door.
8. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer's punching capabilities.
9. Check to ensure that the latest version for finisher and punch firmware are installed.
10. Check the connector on the stacker controller PCA for correct seating and secure connection, and ensure that the wiring at the sensor is not damaged.
11. If the error persists, replace the punch assembly.

Note:

Be sure to order the correct model for the printer region: 2/3 hole or 3/4 hole punch unit.

2/3 Punch hole assembly part number: A2W94-67901

2/4 Punch hole assembly part number: CZ999-67902

13.60.Az

Stacker entrance sensor stay jam. Jam in the top left door.

The finisher's upper-feed-path-entry sensor (PI103) remains activated longer than expected.

- **13.60.A0** Stay jam in inlet sensor going to unknown bin.
- **13.60.A1** Stay jam in inlet sensor going to bin 1.
- **13.60.A2** Stay jam in inlet sensor going to bin 2.
- **13.60.A3** Stay jam in inlet sensor going to bin 3.

Recommended action

1. Open the bridge door and the finisher door, remove the paper from the finisher entrance, and then close the door.
2. Verify that the sensor flag is not damaged, moves freely, and is aligned correctly with the sensor body.

3. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
4. Check the connector (J3) on the stacker controller PCA for correct seating and a secure connection, and verify that the wiring at the sensor is not damaged.
5. If the error persists, replace the entrance sensor bracket and the entrance sensor flag.

Entrance sensor bracket part number: FM2-0717-000CN

Entrance sensor flag part number: RM2-5849-000CN

13.60.Dz

Stacker entrance sensor delay jam.

The finisher's upper-feed-path-entry sensor (PI103), which detects paper entering the finisher, did not detect the paper within the expected time period when being fed from either the paper pass assembly or the hole punch assembly (if installed).

- **13.60.D0** Delay jam going to unknown bin.
- **13.60.D1** Delay jam going to bin 1.
- **13.60.D2** Delay jam going to bin 2.
- **13.60.D3** Delay jam going to bin 3.


Recommended action

1. Ensure that the high output accessory initializes correctly. If it initializes, skip to the next step. If not, perform the following steps to check the IPTU connector:
 - a. Check the connector from the IPTU to the output device and ensure that it is connected correctly.




IPTU unit connector

- b. Push in on the tab to release the connector housing.

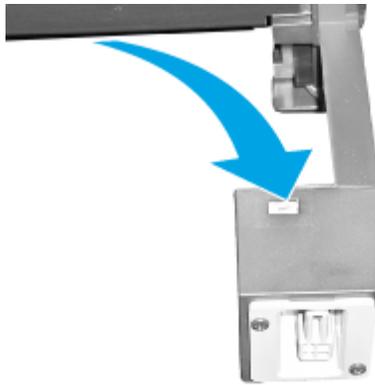

Opening IPTU connector

- c. Ensure that the connector is not loose or disconnected.

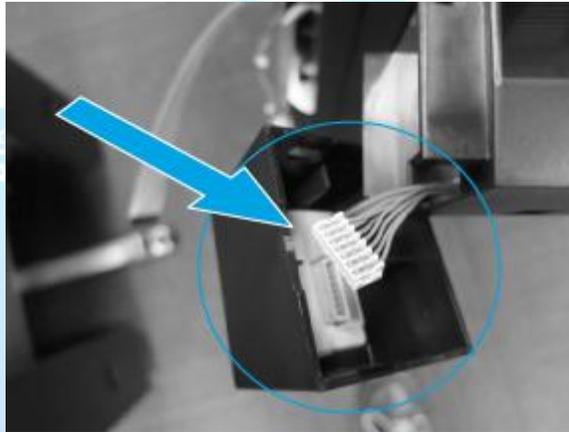

Connector disconnected

With the cover off from the connector housing, check that the interior cables are seated correctly and not damaged.

- d. Check the cables on the IPTU controller to make sure that they are seated correctly and not damaged.
- e. If the lock assembly or connector is damaged, replace the finisher lock assembly/ITPU.

Part number: RM2-5038-000CN

2. Print and analyze the event log, and troubleshoot any related jams occurring either in the paper pass assembly or the hole punch assembly (if installed).

Note:

These errors might be the result of paper failing to reach the output device in the correct amount of time.

3. Check the paper.
 - a. Ensure that the paper is in good condition, and not wrinkled or damaged.
 - b. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer and the high capacity output.
 - c. Ensure that the correct paper size in the trays is selected according the paper size being fed.
4. Verify where the leading edge of the paper is when the jam occurs.
5. If the paper has not reached the sensor PI103, skip to the next step. If the paper is found in the finisher at sensor PI103, perform the following steps:
 - a. Check the sensor for obstructions.
 - b. Verify that the sensor flag is not damaged, moves freely, and is aligned correctly with the sensor body.
 - c. Ensure that the lower end of the flag is not damaged and is positioned correctly to activate the sensor.
 - d. Ensure that the sensor is securely fastened to the chassis.
 - e. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
 - f. Check the upper and lower guides and rollers in the paper path for damage.
 - g. Check the wiring at the sensors.
 - h. If the error persists, check the intermediate connectors (J1007 and J3) on the stacker controller PCA for damage, correct seating, and secure connection.
 - i. If the error persists, replace the entrance sensor bracket assembly.

Part number: FM2-0717-000CN

6. Check if the paper passed through the paper pass assembly or the hole punch assembly (if installed).
 - If the paper passed through, test the M101 paper feed motor assembly.
 - If the paper did **not** pass through, test the M113 motor.
7. Use the finisher component test to test the motors.
 - . Turn the printer off.
 - a. On the main controller PCA, set DIPSW4 to the following settings:
 - Switch 1 ON
 - Switch 2 and switch 3 OFF
 - Switch 4 ON
 - Switch 5 OFF
 - Switch 6 ON
 - Switch 7 and switch 8 OFF
 - b. Turn the printer on.
 - c. On the controller PCA, press and release SW3, and then observe the following switches:
 - First press of SW3: The saddle entrance motor or punch feed roller motor rotates—listen for the motor to rotate.
 - Second press of SW3: The saddle entrance motor or punch feed roller motor stops.
 - d. If the M113 motor test fails, replace the paper pass assembly.

Part number: RM2-5334-000CN

- e. If the M101 motor test fails, replace the paper feed motor assembly.

Part number: FM0-1889-000CN

8. Check the finisher entry-point guides for damage. If damaged, replace either the paper pass or hole punch assembly (if installed).

Paper pass assembly part number: RM2-5334-000CN

2/3 punch kit part number: A2W84-67901

2/4 punch kit part number: CZ999-67902

9. If the error persists, replace the paper pass assembly.

Part number: RM2-5334-000CN

10. If the error persists, replace the stacker main controller PCA.

Part number: RM2-7582-000CN

13 . 60 . FF

Residual paper jam in the top left door (left bins).

Residual jam at either PI103 or PI104 when the printer is powered on.

Recommended action

1. Open the top door and remove any paper in the paper path (media detected at PI103).
2. Raise the upper paper path (exit) delivery rollers and remove any paper in the paper path (media detected at PI104).
3. Remove all paper found from the top left door area.
4. Verify that the sensor flags are not damaged, move freely, are aligned correctly with the sensor body, and are mounted correctly.
5. Check the wiring and connectors for any damage or loose connections.
6. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
7. Check the wiring at the sensors.
8. Check the connectors (J2 and J3) on the stacker controller PCA for damage, correct seating, and secure connection.
9. If the error persists, replace the assembly containing sensor PI103 and PI104.

PI103 entrance sensor bracket assembly part number: FM2-0717-000CN

PI104 return roller assembly part number: FM0-2403-000CN

10. If the error persists, replace the stacker main controller PCA.

Part number: RM2-7582-000CN

13.64.Az

Stacker delivery sensor stay jam.

The finisher's upper-paper-path-exit sensor (PI104) remains activated longer than expected.

PI104 is located on the front frame of the finisher, above the main stapler unit.

- **13.64.A0** Stay jam going to unknown bin.
- **13.64.A1** Stay jam going to bin 1.
- **13.64.A2** Stay jam going to bin 2.
- **13.64.A3** Delay jam going to bin 3.

Recommended action

1. Remove any paper in the upper paper path that might be activating sensor PI104.
2. Lift the swing-guide assembly at the paper exit area to the output bins and inspect for jammed paper, obstructions, or damage.
3. Carefully clean the sensor body, by gently blowing clean air across the sensor to remove dust and debris.
4. Verify that the sensor flag is not damaged, moves freely, and is aligned correctly with the sensor body.
5. Test the M101 entrance motor.
 - a. Run the finisher test on M101 entrance motor, and observe the gear rotations on the upper-rear frame of the finisher.
 - b. Make sure that the first delivery rollers and buffer rollers that pass paper to and from PI104 are rotating.
 - c. Turn the printer off.
 - d. On the main controller PCA, set DIPSW4 to the following settings:
 - Switch 1 ON
 - Switch 2 through 5 OFF
 - Switch 6 ON
 - Switch 7 OFF
 - Switch 8 ON
 - e. Turn the printer on.
 - f. On the controller PCA, press and release SW3, and then observe the following switches:
 - First press of SW3: The stacker entrance guide motor rotates—listen for the motor to rotate.
 - Second press of SW3: The stacker entrance guide motor stops.

- g. If the stacker entrance guide motor test fails, replace the paper feed motor assembly.

Part number: FM0-1889-000CN

- h. If replacing the motor does not solve the issue, replace the stacker main controller PCA.

Part number: RM2-7582-000CN

6. Use the Diagnostic Tests menu to test SL102 (buffer-roller solenoid) and SL103 (output-roller solenoid).
 - a. Turn the printer off.
 - b. On the main controller PCA, set DIPSW4 to the following settings:
 - Switch 1 ON
 - Switch 2 through 4 OFF
 - Switch 5 and switch 6 ON
 - Switch 7 and switch 8 OFF
 - c. Turn the printer on.
 - d. On the controller PCA, press and release SW3, and then observe the following switches in the order presented:

Note:

Press and hold down SW3 to cause the solenoids to repeatedly activate, and then deactivate.

- First press of SW3: The entrance roller alienation solenoid activates for 500 milliseconds (ms), and then deactivates—listen for the solenoid to activate, and then deactivate.
 - Second press of SW3: The buffer roller alienation solenoid activates for 500 ms, and then deactivates—listen for the solenoid to activate, and then deactivate.
 - Third press of SW3: The primary output roller alienation solenoid activates for 500 ms, and then deactivates—listen for the solenoid to activate, and then deactivate.
 - Fourth press of SW3: The buffer trailing edge solenoid activates for 500 ms, and then deactivates—listen for the solenoid to activate, and then deactivate.
- e. If any test fails, check the wiring from sensor PI104 to the stacker-control-board connector (J2).
 - f. If the error persists and the connectors are not damaged, replace the upper cross member assembly.

Part number: FM0-1882-000CN

7. If the error persists, and none of the previous steps correct the problem, replace the stacker controller PCA.

Part number: RM2-7582-000CN

13.64.Dz

Stacker delivery sensor delay jam.

The upper-paper-path-entry sensor (PI103) has signaled that the paper has passed through but the upper paper-path-exit sensor PI104 does not actuate within the expected time. The paper has jammed between PI103 and PI104 in the upper paper path.

- **13.64.D0** Delay jam going to unknown bin.
- **13.64.D1** Delay jam going to bin 1.
- **13.64.D2** Delay jam going to bin 2.
- **13.64.D3** Delay jam going to bin 3.

Recommended action

1. Remove any paper jammed in the upper paper path between sensor PI103 and sensor PI104.
2. Check the paper path between sensor PI103 and sensor PI104 for obstructions that might be preventing the paper from reaching PI104.
3. Verify that the PI104 sensor flag is not damaged, moves freely, and is aligned correctly with the sensor body.
4. Ensure that sensor PI104 is securely fastened to the chassis and wiring is connected correctly to sensor.

Note:

Sensor PI104 is located on the front frame of the finisher, directly over the primary stapler.

5. Test the M101 entrance motor.
 - a. Observe the gear rotations on the upper-rear frame of the finisher.
 - b. Ensure that the first delivery rollers and buffer rollers that pass paper to and from PI104 are rotating.
 - c. Turn the printer off.
 - d. On the main controller PCA, set DIPSW4 to the following settings:
 - Switch 1 ON
 - Switch 2 through 5 OFF
 - Switch 6 ON
 - Switch 7 OFF
 - Switch 8 ON
 - e. Turn the printer on.

- f. On the controller PCA, press and release SW3, and then observe the following switches:
 - First press of SW3: The stacker entrance guide motor rotates—listen for the motor to rotate.
 - Second press of SW3: The stacker entrance guide motor stops.
- g. If the stacker entrance guide motor test fails, replace the paper feed motor assembly.

Part number: FM0-1889-000CN

- h. If replacing the motor does not solve the issue, replace the stacker main controller PCA.

Part number: RM2-7582-000CN

6. Use the Diagnostic Tests menu to test SL102 (buffer-roller solenoid) and SL103 (output-roller solenoid).
 - a. Turn the printer off.
 - b. On the main controller PCA, set DIPSW4 to the following settings:
 - Switch 1 ON
 - Switch 2 through 4 OFF
 - Switch 5 and switch 6 ON
 - Switch 7 and switch 8 OFF
 - c. Turn the printer on.
 - d. On the controller PCA, press and release SW3, and then observe the following switches in the order presented:

Note:

Press and hold down SW3 to cause the solenoids to repeatedly activate, and then deactivate.

- First press of SW3: The entrance roller alienation solenoid activates for 500 milliseconds (ms), and then deactivates—listen for the solenoid to activate, and then deactivate.
 - Second press of SW3: The buffer roller alienation solenoid activates for 500 ms, and then deactivates—listen for the solenoid to activate, and then deactivate.
 - Third press of SW3: The primary output roller alienation solenoid activates for 500 ms, and then deactivates—listen for the solenoid to activate, and then deactivate.
 - Fourth press of SW3: The buffer trailing edge solenoid activates for 500 ms, and then deactivates—listen for the solenoid to activate, and then deactivate.
- e. If any test fails, check the wiring from sensor PI104 to stacker-control-board connector (J2).

- f. If the error persists and the connectors are not damaged, replace the upper cross member assembly.

Part number: FM0-1882-000CN

7. If the error persists, and none of the previous steps correct the problem, replace the stacker controller PCA.


Part number: RM2-7582-000CN

13.84.A0 (at Power on)


The paper is jammed in the finisher/output device when powering on the printer.

Switch MSW103 (output bin 1 close detection switch) actuator is unable to actuate due to a mounting issue. The actuator arm is not in the correct position for the switch to actuate.

Callout 1 shows the switch lever in the incorrect position, which is above the holder.

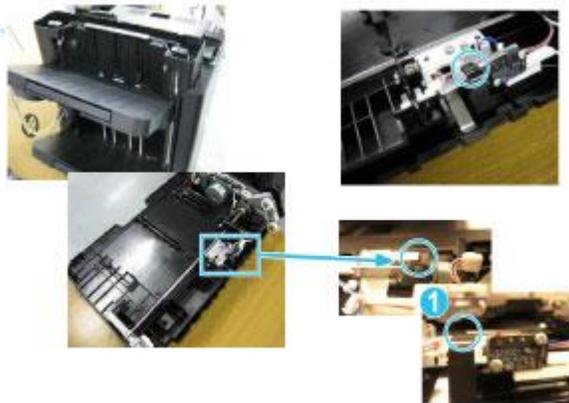

Incorrect position

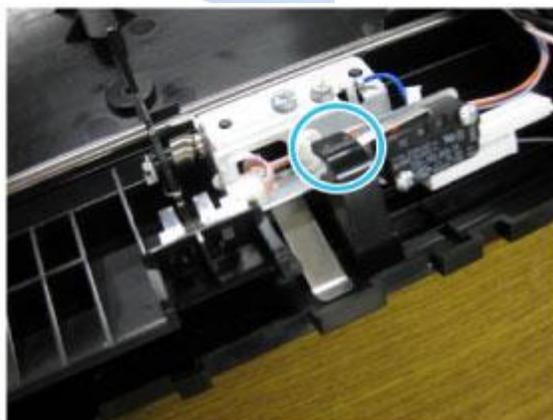

- Correct position

Recommended action

1. Verify that the switch MSW103 is not aligned correctly. If the switch is not aligned correctly, continue to the next step.
2. Remove the upper and lower stepped cover, rear cover, front door cover and the inner cover.



Removal 1


Call outs

- 1 - Upper stepped cover. Unhook the two snap fit claws.
 - 2 - Lower stepped cover. Remove the two screws.
 - 3 - Rear cover. Remove the five screws.
 - 4 - Front door cover. Lift and remove the front door cover after removing the lower stepped cover.
 - 5 - Inner cover (inside the front door cover). Remove the five screws after removing the front door cover.
3. Remove the stack wall.



Remove the stack wall

4. Remove five screws (callout 6).
5. If the tray is in the way of removing the stack wall upper, use a screw driver to slide the ratchet on the bottom surface of the tray and remove the sheet metal brackets A, B, and C as shown in the following images (this will allow the tray top move up and down freely).

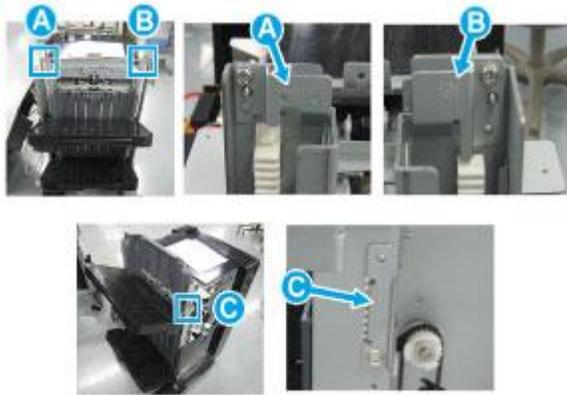


Brackets

6. Remove the bin 1 delivery tray (callout 1).



Bin removal


7. Remove the cover of the bin 1 delivery tray.
8. Remove the following nine screws as shown.

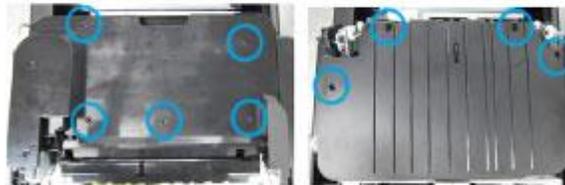

Bin 1 screws

9. Move the lever for the tray guide back into the correct position.


Tray-guide switch-lever in the wrong position

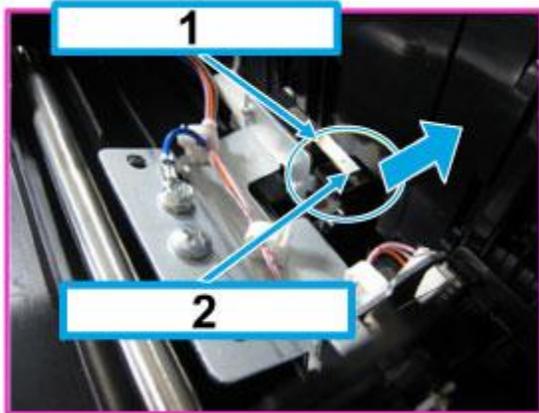

Call outs

- 1 - Safety switch metal plate.
 - 2 - Lever of the tray guide shown off of the metal plate (notice that the metal plate is on top of the lever).
10. Move the lever for the tray guide back into the correct position. While making the tray guide bend in the direction of the blue arrow in the first image, cover the safety switch metal plate by the lever.

Tray guide switch lever in the correct position

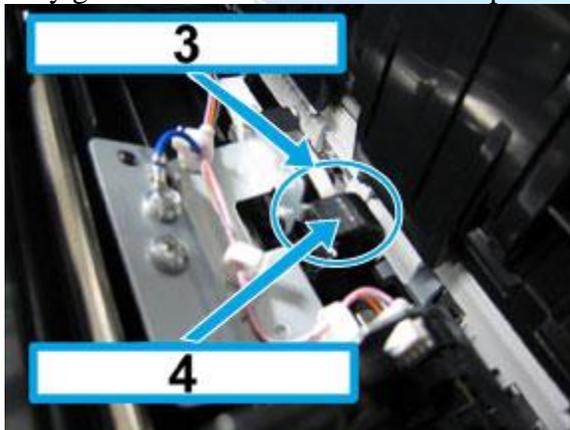

Call outs

- Callout 3 - Safety switch metal plate.
 - Callout 4 - Tray-guide lever in the **correct** position, which is pushed onto the metal plate.
11. Reverse the previous steps to reassemble the parts.

13.84.Az

Accumulator tray stay jam.

The upper paper path entry sensor (PI104) has signaled that the paper has passed through but the output bin sensor PI112 or PI111 does not actuate within the expected time.

- **13.84.A0** Stay jam going to unknown tray
- **13.84.A1** Stay jam going to 1
- **13.84.A2** Stay jam going to 2
- **13.84.A3** Stay jam going to 3

Recommended action

1. Remove any paper jammed in the upper paper path between sensor PI104 and the output bin.
2. Check the accumulator for damage or obstructions.
3. Run the finisher test on the stack eject motor M102.
 - a. Turn the printer off.
 - b. On the main controller PCA, set DIPSW4 to the following settings:
 - Switch 1 ON
 - Switch 2 through 4 OFF
 - Switch 5 ON
 - Switch 6 and switch 7 OFF
 - Switch 8 ON
 - c. Turn the printer on, listen for the motor rotation, and ensure that the delivery rollers and buffer rollers are rotating.
 - d. On the controller PCA, press and release SW3, and then observe the following switches:
 - First press of SW3: The stapled job output motor rotates—listen for the motor to rotate.
 - Second press of SW3: The stapled job output motor stops.

Note:

Press and hold down SW3 to cause the stapled job output motor to repeatedly rotate and then stop.

- e. If the stapled job output motor test fails, replace the stack ejection motor assembly.

Part number: 4G3-0769-000CN

- f. If replacing the motor does not resolve the issue, replace the stacker main controller PCA.

Part number: RM2-7582-000CN

13.89.3Z

Stapler 1 jam in the front left door.

When the staple motor (M41) is rotated forward, the staple home-position sensor (PI120) does not turn back on after the prescribed time has elapsed after it goes off, and the staple home-position sensor (PI120) turns on within the prescribed time after the staple motor (M41) is rotated backwards.

- **13.89.30**
- **13.89.31**
- **13.89.32**

Recommended action

1. Check the stapler unit for jammed or loose staples.
2. Check the stapler unit for paper dust.
3. Inspect the stapler unit for damage.
4. Remove the stapler cartridge and ensure that HP-approved staples are being used.
5. Install new staple cartridge and retest.
6. If the error persists, verify that the wiring at the stapler unit and the connectors to the staple 2, staple 1 and stacker PCA are not damaged.
7. If the error persists, replace the stapler unit.

Part number: 4G3-0938-000CN

13.90.Az

Booklet-maker inlet-sensor stay jam.

The booklet making paper-entry sensor (PI22) remains activated longer than expected.

The specific jam error code will be one of the following forms:

- **13.90.A0** Going to unknown bin
- **13.90.A2** Going to bin 2
- **13.90.A3** Going to bin 3

Recommended action

1. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
2. Remove any paper in the upper paper path that might be activating the sensor PI22.
3. Verify that the sensor flag is not damaged, moves freely, and is aligned correctly with the sensor body.

4. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
5. Run the finisher test on the saddle feed motor M1.
 - a. Turn the printer off.
 - b. On the saddle controller PCA, set DIPSW to the following settings:
 - Switch 1 OFF
 - Switch 2 ON
 - Switch 3 and switch 4 OFF
 - Switch 5 through 8 not used
 - c. Turn the printer on.
 - d. On the saddle controller PCA, press and release SW1, and then listen for the motor rotation, and ensure that the delivery rollers and buffer rollers are rotating when pressing each of the following switches:
 - First press of SW1: The saddle feed motor rotates at a slow rate: 130 mm/sec (5.12 in/sec). Listen for the motor to slowly rotate.
 - Second press of SW1: The saddle feed motor rotates at a fast rate: 200 mm/sec (7.87 in/sec). Listen for the motor to increase rotation speed.
 - Third press of SW1: The saddle feed motor stops.

Note:

Press and hold down SW1 to cause the motor to repeatedly rotate, and then stop.

- e. If the motor test fails, verify that the wiring at the sensor is not damaged and that the intermediate connectors between sensor PI22 and connector J21 on saddle-stitcher controller PCA are not damaged and are seated correctly.
- f. If the motor test fails and the connectors are not damaged, replace the saddle motor assembly.

Part number: FM2-0737-000CN

6. If the error persists, replace the entrance sensor bracket.

Part number: FM2-0717-000CN

13.90.Dz

Booklet-maker inlet-sensor delay jam.

This error occurs when the booklet-making function is selected and after the engine signals the finisher that it is delivering paper to the finisher. The booklet-making paper-entry sensor (PI22) is not activated within the expected time period after receiving the engine's delivery signal. A paper jam has occurred somewhere between the inlet feed assembly and sensor PI22.

- **13.90.D0** Going to unknown bin
- **13.90.D2** Going to bin 2

- **13.90.D3** Going to bin 3

Preliminary Troubleshooting

1. Print and analyze the event log, check for related jams occurring either in the inlet feed assembly or the hole punch assembly, and troubleshoot all printer engine jams first.

Note:

These errors might be the result of paper failing to reach the output device in the correct amount of time.

2. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
3. Ensure that the paper is in good condition, and not wrinkled or damaged.
4. Verify that the sensor flag is not damaged, moves freely, and is aligned correctly with the sensor body.
5. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
6. Verify where the leading edge of the paper is when the jam occurs.

Paper stuck in the inlet feed assembly

1. Run the finisher test on the stacker entrance guide motor M101.
 - a. Turn the printer off.
 - b. On the main controller PCA, set DIPSW4 to the following settings:
 - Switch 1 ON
 - Switch 2 through 5 OFF
 - Switch 6 ON
 - Switch 7 OFF
 - Switch 8 ON
 - c. Turn the printer on, listen for the motor rotation, and ensure that the feed rollers and buffer rollers are rotating.
 - d. On the controller PCA, press and release SW3, and then observe the following switches:
 - First press of SW3: The stacker entrance guide motor rotates—listen for the motor to rotate.
 - Second press of SW3: The stacker entrance guide motor stops.
 - e.
2. If the stacker entrance guide motor test fails, replace the paper feed motor assembly.

Part number: FM0-1889-000CN

3. If the error persists, and none of the previous steps corrected the problem, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Paper passes through the saddle paper feed assembly but does not reach PI22

1. Check the sensor for obstructions.
2. Verify that the sensor flag is not damaged, moves freely, and is aligned correctly with the sensor body.
3. Ensure that the lower end of the flag is not damaged and is positioned correctly to activate the sensor.
4. Ensure that the sensor is securely fastened to the chassis.
5. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
6. Run the finisher test on the saddle feed motor M1.
 - a. Turn the printer off.
 - b. On the saddle controller PCA, set DIPSW to the following settings:
 - Switch 1 OFF
 - Switch 2 ON
 - Switch 3 and switch 4 OFF
 - Switch 5 through 8 not used
 - c. Turn the printer on.
 - d. On the saddle controller PCA, press and release SW1, and then listen for the motor rotation, and ensure that the delivery rollers and buffer rollers are rotating after each press:

Note:

Press and hold down SW1 to cause the motor to repeatedly rotate, and then stop.

- First press of SW1: The saddle feed motor rotates at a slow rate: 130 mm/sec (5.12 in/sec). Listen for the motor to slowly rotate.
 - Second press of SW1: The saddle feed motor rotates at a fast rate: 200 mm/sec (7.87 in/sec). Listen for the motor to increase rotation speed.
 - Third press of SW1: The saddle feed motor stops.
- e. If the motor test fails, verify that the wiring at the sensor is not damaged and that the intermediate connectors between sensor PI22 and connector J21 on saddle-stitcher controller PCA are not damaged and are seated correctly.
 - f. If the motor test fails and the connectors are not damaged, replace the saddle motor assembly.

Part number: FM2-0737-000CN

7. If PI22 still does not detect the paper, replace the entrance sensor bracket assembly which includes PI22.

Part number: FM2-0717-000CN

8. If the error persists, and none of the previous steps corrected the problem, replace the saddle-stitcher controller PCA.

Part number: RM2-7586-000CN

13.92.FF

Residual paper jam in the booklet maker.

Paper is detected by one of the sensors on the paper-sensor board (PI18, PI19, PI20), vertical-path-paper sensor (PI17), booklet-delivery sensor (PI11), paper positioning-plate paper sensor (PI8), or booklet-making paper-entry sensor (PI22) when the printer is turned on.

Recommended action

1. Remove paper from the booklet-maker paper path.
2. Verify that the sensor flags are not damaged, move freely, and are aligned correctly with the sensor bodies.
3. Carefully clean each sensor body by gently blowing clean air across each sensor to remove dust and debris.
4. Check the connectors (J6, J9, J10, J13, and J21) on the saddle-stitcher controller PCA for correct seating and secure connection.
5. If the error persists, and none of the previous steps correct the problem, replace the saddle-stitcher controller PCA.

Part number: RM2-7586-000CN

13.94.Az

Booklet-maker delivery-sensor stay jam.

Paper stay jam at the booklet-delivery sensor (PI11) or the vertical-paper-path sensor (PI17).


This error can occur under the following conditions:

- When the booklet-delivery sensor (PI11) remains activated longer than expected after sensing the arrival of the new booklet from the folding rollers.
- When the vertical-paper-path sensor (PI17) remains activated longer than expected after the paper has already passed through the folding rollers and is now detected by the booklet-delivery sensor (PI11).
 - **13.94.A0**
 - **13.94.A2**
 - **13.94.A3**

Recommended action


1. Check the folder-roller area for a jam.
2. Ensure that the sensors are not obstructed.
3. Ensure that sensor PI11 is securely fastened to the chassis and is not damaged.
4. If the paper is found in folder-roller area, remove the paper and check the sensor position of sensor PI17.
5. Check to see if the sensor flag is protruding through the sensor cutout in the sheet metal.
 - a. Open the front left door.
 - b. Move the upper jam release lever to the right and the lower jam lever to the left. Remove any paper still present and check to see if the PI17 sensor flag is visible.
 - c. If the flag is not visible, remove the back cover of output device to clearly see if the sensor (PI17) is in the correct position.

Black sensor flag clearly visible in cutout.

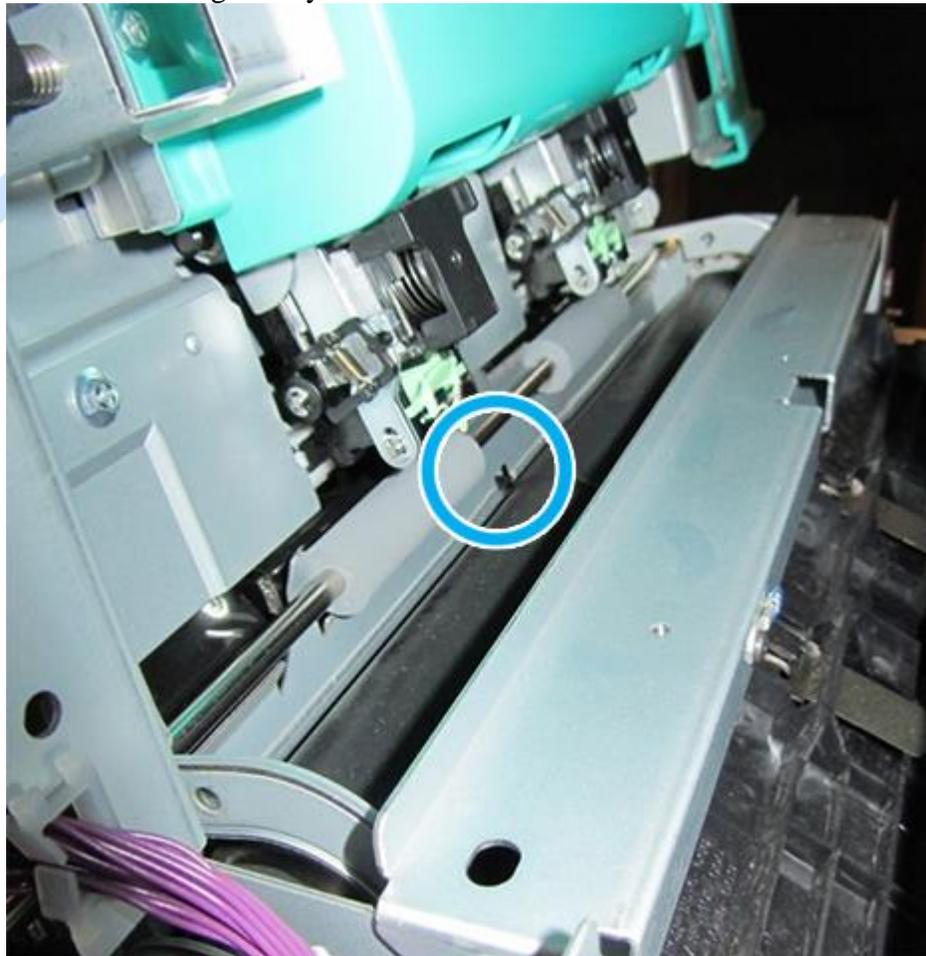

- d. If the sensor is **not** in the correct position, remove the output device back cover and check the following section in the lower center of the output device.


Back side of output device

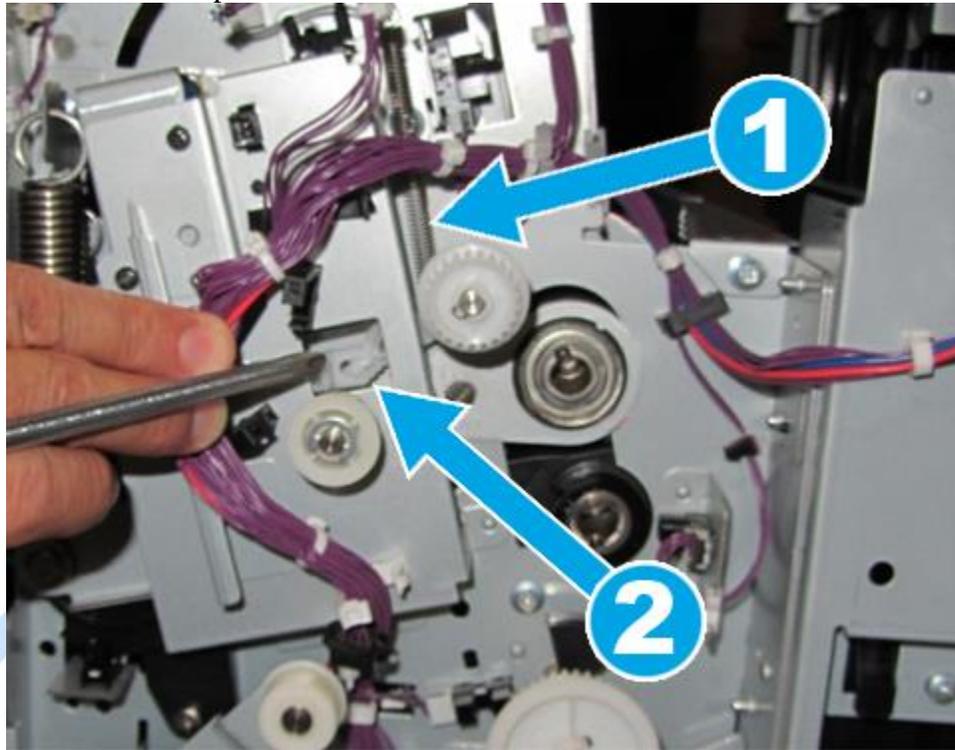

Callout 1: Tension spring installed correctly.

Callout 2: White plastic engagement arm pin and fork holder.


- e. Check the position of the white plastic arm. The plastic pin on the arm should be in the center of the plastic fork.

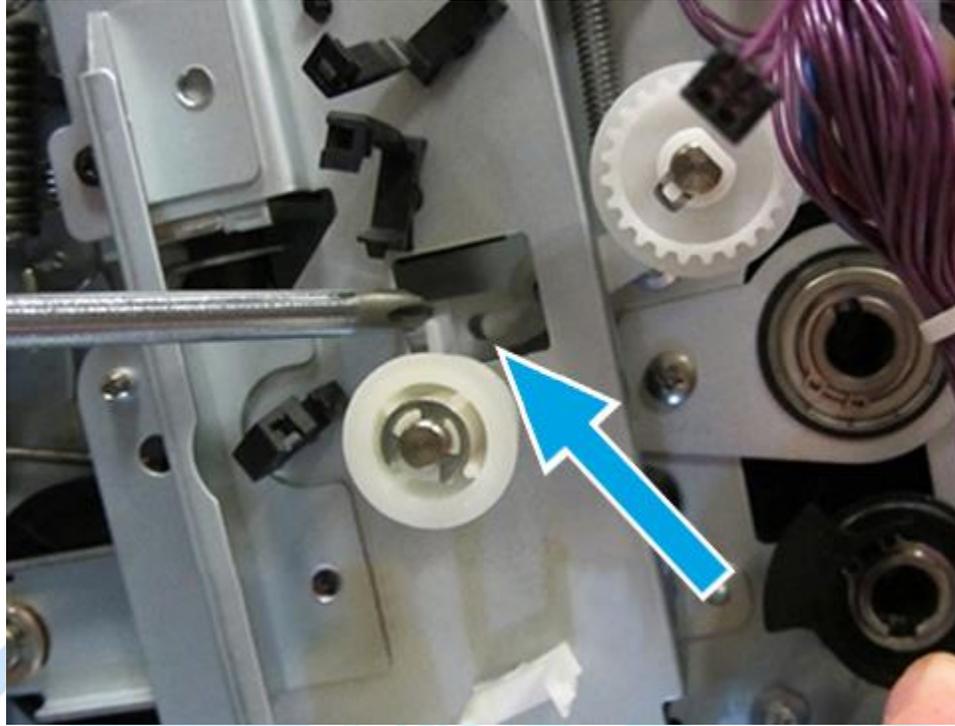


Tension spring loose and white arm in incorrect position



- f. If the pin is not in the correct position, rotate the arm clockwise so that the arm pin is between the plastic fork, then reattach the tension spring.

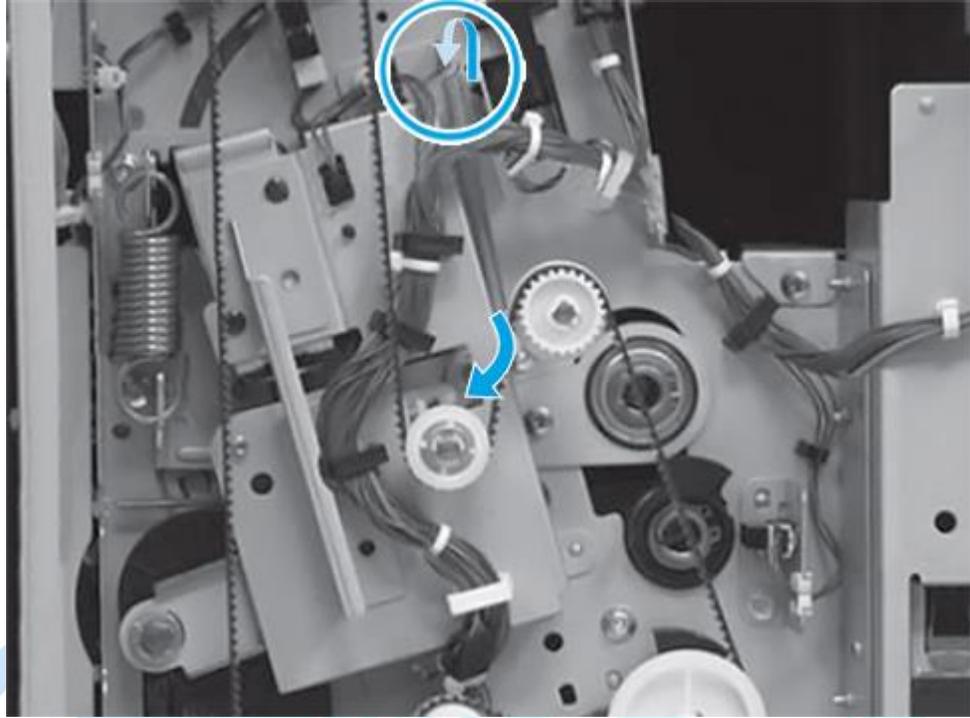

The white arm should be in a horizontal position with the pin held between the plastic fork.

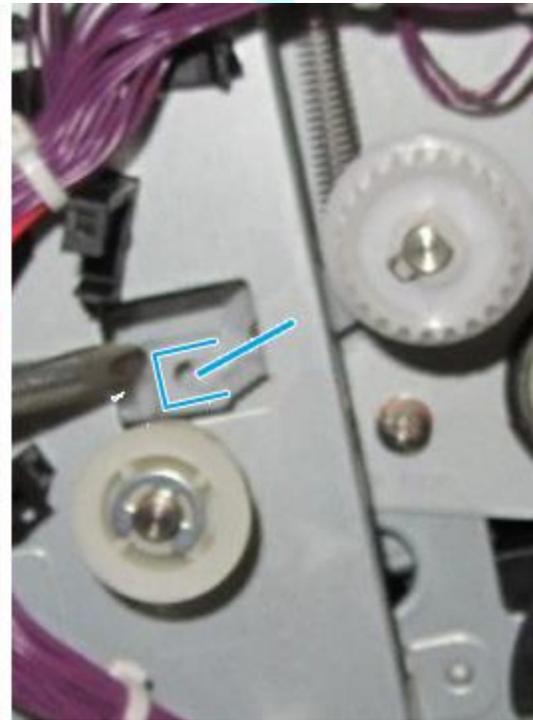

6. Run the finisher test or component test to test M2 and verify that the folding motor is functioning correctly. Remove the finisher rear cover before starting the test and ensure that the folding rollers are rotating when motor M2 is on.
7. If the error persists, replace the folder motor assembly.

Part number: FM0-1686-000CN

13.94.Dz

Booklet-maker delivery-sensor delay jam.

A folded booklet is exiting the folding rollers but did not reach the booklet delivery sensor (PI11) within the expected time.

- 13.94.D0
- 13.94.D2
- 13.94.D3

Recommended action

1. Check the folder-roller area for a jam or paper wrapped around the rollers.
2. Check sensor PI11 for damage.
3. Ensure that the sensor is not obstructed.
4. Ensure that sensor PI11 is securely fastened to the chassis.
5. Replace the folder motor assembly as needed.

Part number: FM0-1686-000CN

13.96.3Z

Booklet-maker staple jam (front).

When the rear-staple motor (M7) has rotated forward, the staple home-position sensor (SW7) did not turn back on after the prescribed time has elapsed after it goes off (0.4 seconds).

- 13.96.30
- 13.96.32
- 13.96.33

Recommended action

1. Check the front booklet stapler unit for jammed or loose staples, and clear any jammed staples.
2. Make sure that HP-approved staples are in use and retest the stapler.
3. If the error persists, replace the staple cartridge.

Part number: CF367-67914

Note:

Replace both the front and rear cartridges at the same time so that the staple low sensors will detect the level of staples in the cartridges.

4. If the error persists, inspect the front booklet stapler unit for damage, and verify that the wiring at the stapler unit and the connector are not damaged.
5. If damaged, or if the error persists, replace the saddle-stapler assembly.

Part number: RM2-6269-000CN

13.97.3z

Booklet-maker staple jam (rear).

When the rear-staple motor (M6) is rotated forward, the staple home-position sensor (SW5) did not turn back on after the prescribed time has elapsed after it goes off (0.4 seconds).

- 13.97.30
- 13.97.32
- 13.97.33

Recommended action

1. Check the rear booklet stapler unit for jammed or loose staples, and clear any jammed staples.
2. Make sure that HP-approved staples are in use and retest the stapler.
3. If the error persists, replace the staple cartridge.

Part number: CF367-67914

Note:

Replace both the front and rear cartridges at the same time so that the staple low sensors will detect the level of staples in the cartridges.

4. If the error persists, inspect the front booklet stapler unit for damage, and verify that the wiring at the stapler unit and the connector are not damaged.
5. If damaged, or if the error persists, replace the saddle-stapler assembly.

Part number: RM2-6269-000CN

Part description: Saddle Stapler Assembly

13.98.Az

Booklet-maker saddle-output-bin media-presence-sensor stay jam.

The folded booklet is exiting the folding rollers and passes PI11 booklet-delivery-sensor but does not reach the saddle-output-bin media-presence-sensor (PI6) within the expected time.

- 13.98.A0
- 13.98.A2
- 13.98.A3

Recommended action

1. Check the folder-roller area for a jam or paper wrapped around the rollers.
2. Check the saddle-output-bin media-presence-sensor PI6 for damage.
3. Ensure that the sensor is not obstructed.
4. Ensure that the saddle-output-bin media-presence-sensor PI6 is securely fastened to the chassis.
5. Replace saddle tray assembly as needed.

Part number: RM2-5318-000CN

13.98.Dz

Booklet-maker saddle-output-bin media-presence-sensor delay jam.

A finished booklet did not reach the saddle-output-bin media-presence-sensor PI6 in the expected amount of time.

- 13.98.D0
- 13.98.D2
- 13.98.D3

Recommended action

1. Check the folder-roller area for a jam or paper wrapped around the rollers.
2. Check the saddle-output-bin media-presence-sensor PI6 for damage.
3. Ensure that the sensor is not obstructed.
4. Ensure that the saddle-output-bin media-presence-sensor PI6 is securely fastened to the chassis.
5. Replace saddle tray assembly as needed.

Part number: RM2-5318-000CN

30.XX.YZ error messages

30.* errors

Errors in the 30.* family are related to the flatbed scanner.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Calibrate the scanner. Open these menus: Device Maintenance > Calibrate-Cleaning > Calibrate Scanner.
2. Clean the scanner glass and glass strips.
3. Perform the tests for scanner diagnostics. Open these menus: Administration > Troubleshooting > Diagnostic Tests > Scanner Tests.
4. Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

5. Check all connections on the scanner control board and from the scanner control board to the formatter and the DC controller or the engine control board. If all connections are good, replace the scanner control board.
6. Replace the formatter.
7. If the error persists, replace the scanner assembly.

30.01.01

The flatbed cover sensor was interrupted.

The scanner flatbed cover is open.

This message appears only in the event log and is not posted on the control panel.

The control panel will read **Flatbed Cover Open**.

Recommended action

1. Close the cover. This error message should automatically clear with no further action necessary.
2. If the issue persists after closing the the cover, use the Diagnostic Tests menu to test the scanner sensor on the cover at the center rear of the scanner:
 - a. Open the following menus

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Scanner Tests

FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Manual Sensor Test
3. Check all connections on the SCB and the connection from the lid sensor to the SCB for correct seating and secure connection, and ensure that there is no damage.
 4. If the error persists, and the connectors are not damaged, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

5. If the error persists, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

30.01.06

Scanner fan error.

The copy, fax and send options will be grayed out or not present on the control panel and this message will be posted in the event log.

Recommended action

1. Turn the printer off, and then on.
2. During the MFP initialization sequence, listen to the fan to determine if it is operating.
3. If the error persists, turn the printer off and then check the fan wire-harness connectors.
4. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

5. If the error persists, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

30.01.08

The scanner optic failed to return to the home position.

Recommended action

1. Turn the printer off, and then on.
2. Observe the movement of the optics assembly while the printer is turning on.
3. Check the scanner lock.
4. Move the lock back and forth and leave it in the unlock position, and then retest the printer by turning the printer on.
5. If the error persists, run the scanner motor test.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Scanner Tests

FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Manual Sensor Test
- b. Select the Flatbed Motor test.
 - c. Make sure the scanner head moves freely.
 - d. If the scanner head does not move freely, and looks like it is binding or not installed correctly, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

6. If the error persists and the firmware has been upgraded, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

7. If the error persists, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

30.01.14

Scanner control board (SCB) EEPROM error.

Recommended action

1. Turn the printer off, and then on.
2. Ensure all connectors on the SCB are seated correctly.
3. Ensure that the MFP has the latest SCB firmware version.
4. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

30.01.15

Scanner did not initialize.

The scanner failed to initialize due to an internal error.

Recommended action

1. Turn the printer off, and then on.
2. Verify that all the covers are installed correctly and that the document feeder and document feeder jam cover are closed.
3. Check all the sensors on the scanner to ensure that they are not blocked.
4. Check the vents on the back of the scanner to verify that the green LEDs are lit.
5. If no LEDs are visibly lit, check the connections from the SCB to the printer engine for correct seating and secure connection.
6. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

30.01.18

Scanner internal optical sensor error.

Recommended action

1. Turn the printer off, and then on.
2. Ensure that all the connectors on the SCB are seated fully.
3. Make sure that the MFP has the latest SCB firmware version.
4. If the error persists, check the connections from the SCB to the printer engine for correct seating and secure connection.
5. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

6. If the error persists, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

30.01.19

Scanner internal lamp sensor error.

Recommended action

1. Turn the printer off, and then on.
2. Determine if the scanner lamp turns on and off approximately 12 seconds after the printer turns on.
3. Use the Diagnostic Tests menu to test the scanner lower lamp.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Scanner Tests

FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Manual Sensor Test
4. Reseat the interconnect cables between the optical carriage and the SCB.

5. If the error persists, check the connections from the SCB to the printer engine for correct seating and secure connection.
6. If the error persists, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

30.01.23 Scanner calibration failure

The scanner calibration failed.

Recommended action

1. Turn the printer off, and then on.
2. After the printer warms up, repeat the calibration process.
3. If the error persists, check the connections from the SCB to the printer engine for correct seating and secure connection.
4. If the error persists, replace the scanner assembly.

Part number: A2W75-67908

For instructions: See the Repair Service Manual for this product.

5. If the error persists on a Flow model, the failure might be in the second side scanner of the document feeder. Replace the document feeder (Flow models only).

Part number: A2W75-67907

30.01.30 or 30.01.32

HP image ASIC error.

Recommended action

1. Turn the printer off, and then on.
2. Check the connection on the SCB.
3. If the error persists, check the connections from the SCB to the printer engine for correct seating and secure connection.
4. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

30.01.36

Scanner firmware upgrade error.

Recommended action

1. Re-send the scanner firmware upgrade.
2. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

30.01.41

The formatter lost connections with the SCB or the communication was corrupted.

Recommended action for call agents

1. Turn the printer off, and then on.
2. Remove and reseal the formatter.
3. Upgrade the firmware.
4. Verify that the scanner control board (SCB) has power.
5. Verify that all cables are connected correctly to the interconnect board, the formatter, and the SCB.
6. If the error persists, replace the scanner data cable.

Part number: RK2-4801-000CN

7. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

8. If the error persists, replace the formatter.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: Formatter](#)

Part number formatter PCA Assembly (M880): A2W75-67903


Part number formatter PCA Assembly (M880 China/India ONLY): A2W75-67902

9. If the error persists, replace the interconnect board.

Part number interconnect board (ICB) (M880): RM2-5035-000CN

Recommended action for on-site technicians

1. Turn the printer off, and then on.
2. Remove and reseat the formatter.
3. Upgrade the firmware.
4. Verify that the scanner control board (SCB) has power.
5. Check the cable between the SCB and the ICB.

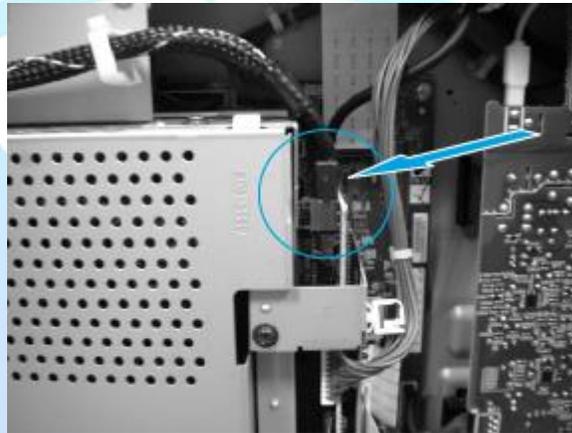


ICB connector location

6. Make sure the USB connectors on each end of the cable are plugged in and seated correctly.


Note:

If the cable is not firmly seated, the error code 30.01.41 will be present in a solid condition.


USB connected correctly

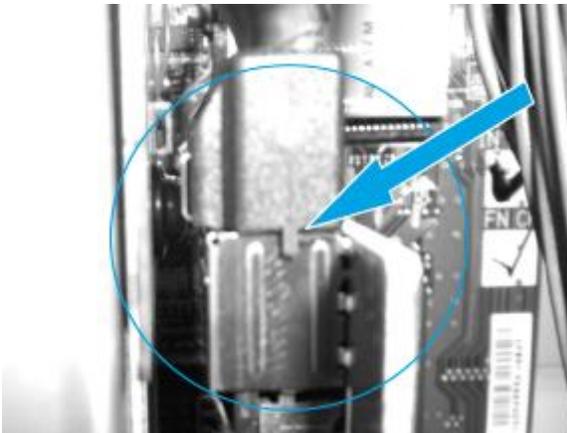

USB not connected correctly

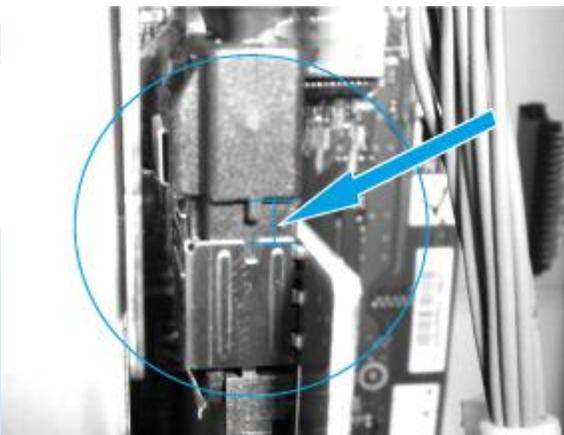


7. Check all connections on the SCB as shown in the following image.

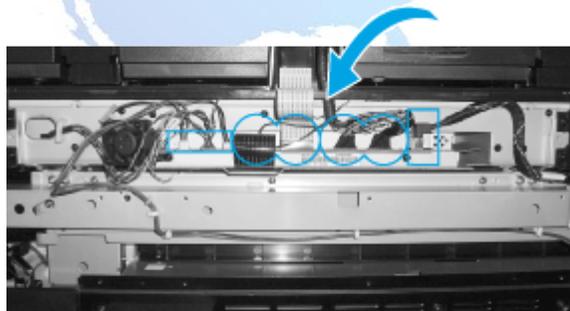


SCB connections

8. Check the USB connection on the engine and the SCB (a loose or poorly seated connection can cause this error).

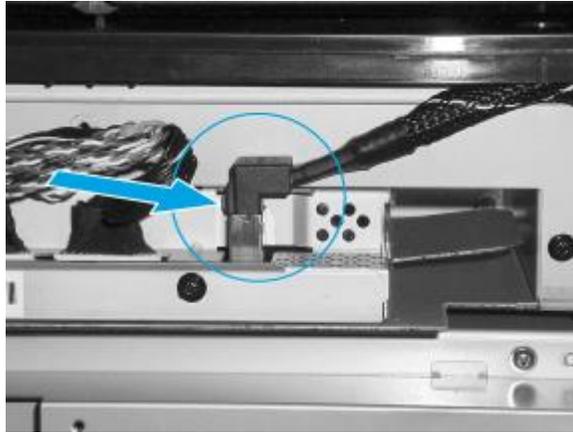

SCB USB connected correctly

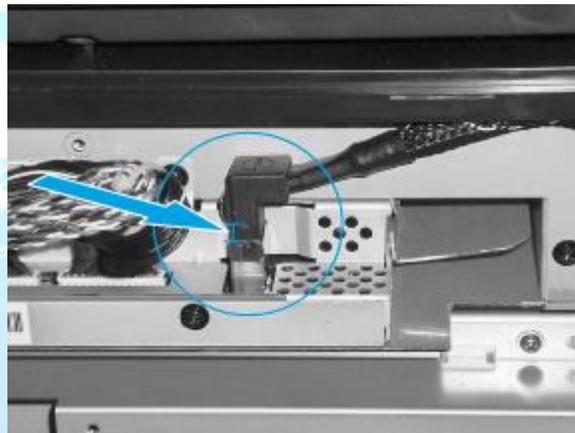

SCB USB not connected correctly

9. If the error persists, replace the scanner data cable.

Part number: RK2-4801-000CN

10. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

11. If the error persists, replace the formatter.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: Formatter](#)

Part number formatter PCA Assembly (M880): A2W75-67903

Part number formatter PCA Assembly (M880 China/India ONLY): A2W75-67902

12. If the error persists, replace the interconnect board.

Part number interconnect board (ICB) (M880): RM2-5035-000CN

30 . 01 . 42

Internal printer communication error.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, turn the printer off, and then check the SCB connectors to the printer engine for correct seating and secure connection.
3. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

30 . 01 . 43

Scan memory error.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, turn the printer off, and then reseal the formatter.
3. If the error persists, replace the formatter.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: Formatter](#)

Part number formatter PCA Assembly (M880): A2W75-67903

Part number formatter PCA Assembly (M880 China/India ONLY): A2W75-67902

30 . 01 . 44

CPB/SCB communication error.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, turn the printer off, and then check the scanner cable.
3. Upgrade the firmware.
4. If the error persists, turn the printer off, and then reseal the formatter.
5. If the error persists, check the connectors from the SCB to the printer engine for correct seating and secure connection.
6. If the error persists and the connectors are not damaged, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

7. If the error persists, replace the image scanner assembly.

Part number: A2W75-67908

For instructions: See the Repair Service Manual for this product.

8. If the error persists on a Flow model, the failure might be in the second side scanner of the document feeder. Replace the document feeder (Flow models only).

Part number: A2W75-67907

9. If the error persists, replace the formatter.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: Formatter](#)

Part number formatter PCA Assembly (M880): A2W75-67903

Part number formatter PCA Assembly (M880 China/India ONLY): A2W75-67902

30.01.45

Internal CPB communication error.

CPB code assertion error for the copy processor board firmware.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, turn the printer off, and then reseal the formatter.
3. Upgrade the firmware.
4. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

5. If the error persists, replace the image scanner assembly.

Part number: A2W75-67908

For instructions: See the Repair Service Manual for this product.

6. If the error persists on a Flow model, the failure might be in the second side scanner of the document feeder. Replace the document feeder (Flow models only).

Part number: A2W75-67907

7. If the error persists, replace the formatter.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: Formatter](#)

Part number formatter PCA Assembly (M880): A2W75-67903

Part number formatter PCA Assembly (M880 China/India ONLY): A2W75-67902

30.01.46

Scanner firmware error.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, turn the printer off, and then reseal the formatter.
3. If the error persists, check the connectors from the SCB to the printer engine for correct seating and secure connection.

4. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

30.01.47

Document feeder error.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, turn the printer off, and then check the document feeder wire-harness connectors.
3. If the error persists, check the connectors from the SCB to the document feeder for correct seating and secure connection.
4. If the error persists and the connectors are not damaged, replace the document feeder assembly.

See the Repair Service Manual for this product.

Part number: CF367-67920

5. If the error persists, replace the formatter.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: Formatter](#)

Part number formatter PCA Assembly (M880): A2W75-67903

Part number formatter PCA Assembly (M880 China/India ONLY): A2W75-67902

30.01.48

Scanner error or scanner power is not connected.

Recommended action

1. Turn the printer off, and then on.

2. If the error persists, turn the printer off, and then check the scanner wire-harness connectors and the scanner power supply fan.
3. If the error persists, check the connectors from the SCB to the printer engine for correct seating and secure connection.
4. If the error persists, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

30.01.49

Scanner inverter fan error.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, turn the printer off, and then check the scanner wire harness connectors and the scanner power supply fan.
3. If the error persists, check the connectors from the SCB for secure seating and secure connection.
4. If the error persists, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

30.01.50

Internal SCB error.

Recommended action

1. Turn the printer off, and then on.
2. Upgrade the firmware.
3. If the error persists, check the connectors from the SCB for correct seating and secure connection.
4. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

30.03.14

A non-fatal error has occurred or a scanner EEPROM (NVM) error has occurred.

Recommended action

No action required.

30.03.20

The copy processor board firmware cannot communicate with the PCA on the optical assembly.

Recommended action

1. Turn the printer off, and then on.
2. Make sure that the FFC cables between the scanner and the SCB are connected.
3. If the error persists, check the connectors from the SCB for correct seating and secure connection.
4. If the error persists, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

30.03.22

Front side illumination calibration failure.

The scan module cannot see the illumination module, or the illumination is marginal.


The optical assembly may not be parked under the calibration strip.

Recommended action

1. Turn the printer off, and then on.
2. Clean the glass for both the document feeder and the scanner, and clean the white strip.
3. Upgrade the firmware.
4. Check the service event log for other scanner errors, and then resolve those errors.
5. If the error persists, check the connectors on the SCB for correct seating and secure connection, and then retest the printer for errors.
6. If the error persists and the connectors are not damaged, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

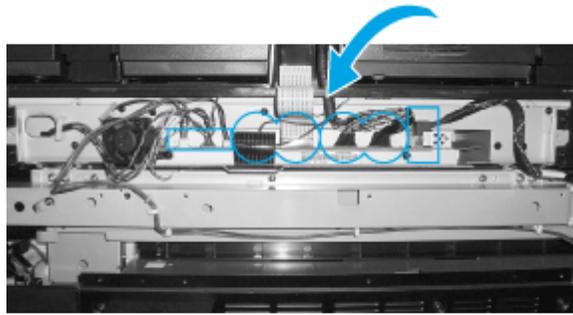

SCB connections

7. If the error persists, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

30.03.23

Flatbed alignment calibration error.


Recommended action

1. Turn the printer off, and then on.
2. Perform a flatbed copy to test the scanner.
 - If the output has the flatbed image defect, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.


Part number: A2W75-67908

- If the output does not look like the following image, do **not** replace any parts and continue to the next step.

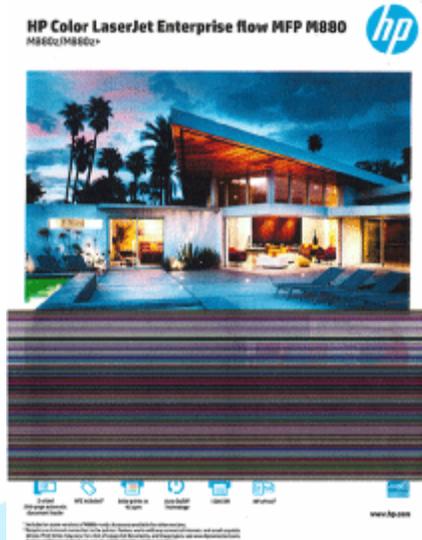

Flatbed image defect

3. Upgrade the firmware.
4. Check the connectors from the SCB to the printer engine for correct seating and secure connection.

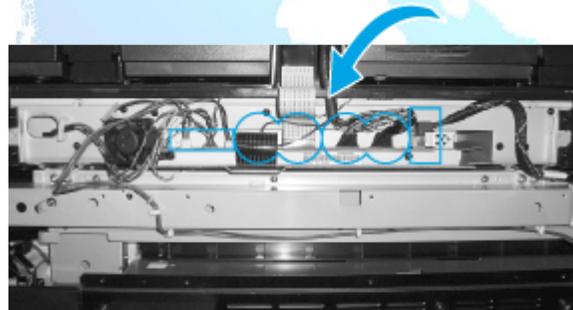

SCB connections

5. If the error persists, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

30.03.30

Flatbed motor shutdown.

The scanner control board cannot communicate with the flatbed scanner motor.

Recommended action

1. Turn the printer off, and then on. As the printer turns on, verify that the scanner head moves.
2. Verify that the drive belt is in the correct position.
3. Use the Diagnostic Tests menu to test the flatbed scanner to see if the scan bar moves.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Scanner Tests

FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Manual Sensor Test
- b. Select the Flatbed Motor test.
 - c. If the scanner head does not move freely and looks like it is binding or not installed correctly, replace the image scanner assembly.


For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

- d. If the head moves freely, run the flatbed motor test multiple times, and then test again. If the error persists, continue to the next step.
4. If the error persists, check the connectors on the SCB for correct seating and secure connection.
 5. If the error persists, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

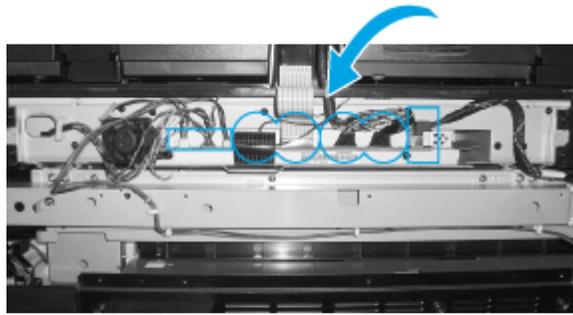

SCB connections

6. If the error persists, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

30.03.45

Scanner control board (SCB) firmware assertion failure. SCB firmware assert controls the scanner head motor.


Recommended action

1. Turn the printer off, and then on.
2. If the error persists, perform a `Format Disk` procedure using the `Preboot` menu.


For the steps to perform a `Format Disk` procedure, go to: [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#) (c03398779).

3. Reload the firmware with the latest version.
4. Check the cable connections on the SCB and ICB for correct seating and secure connection.
 - Ensure that the USB cable between the ICB and the SCB is connected correctly.
 - Pay special attention to the two FFC cables at the SCB which come from the scanner and the document feeder (the FFC cable from the document feeder comes from its internal scanner).

FCC and USB connections on the SCB

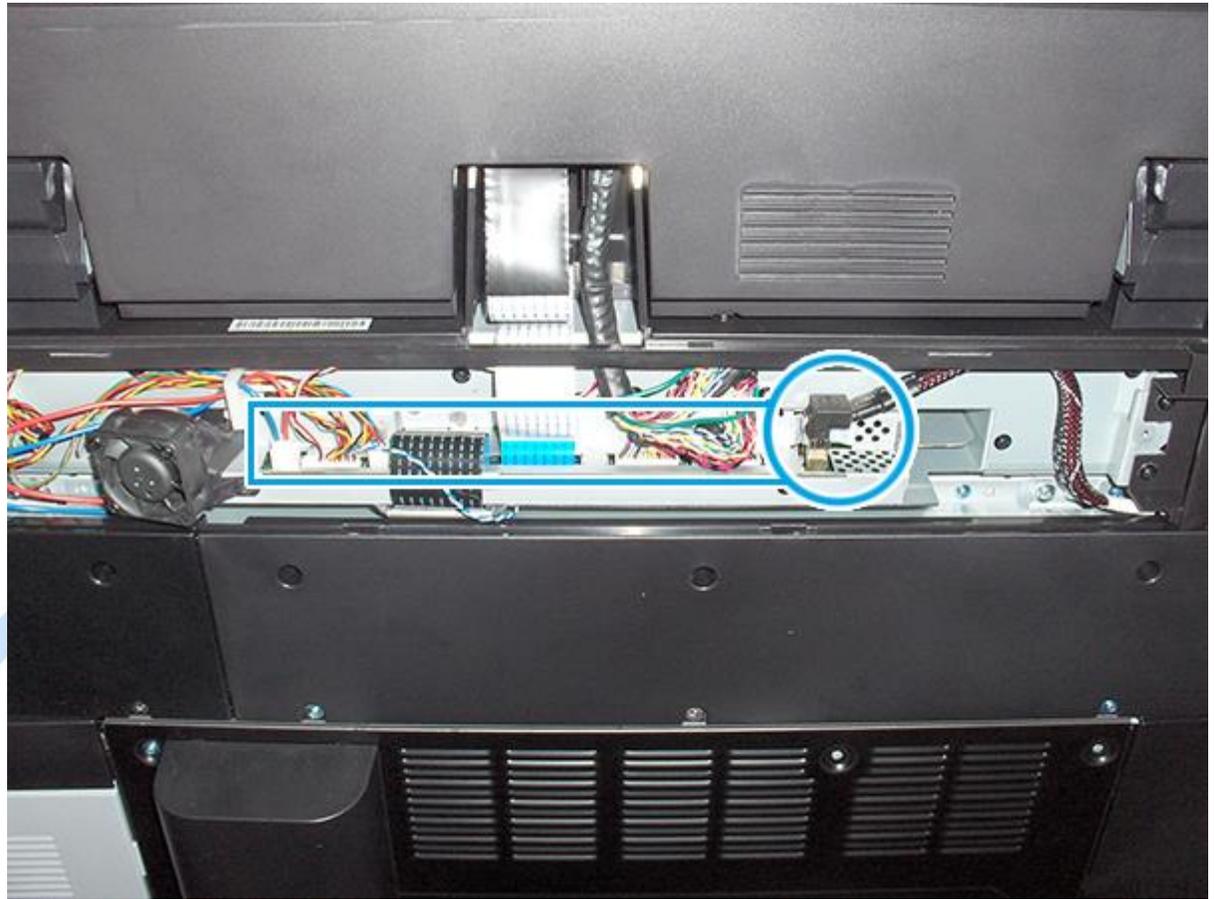

USB connection on the ICB

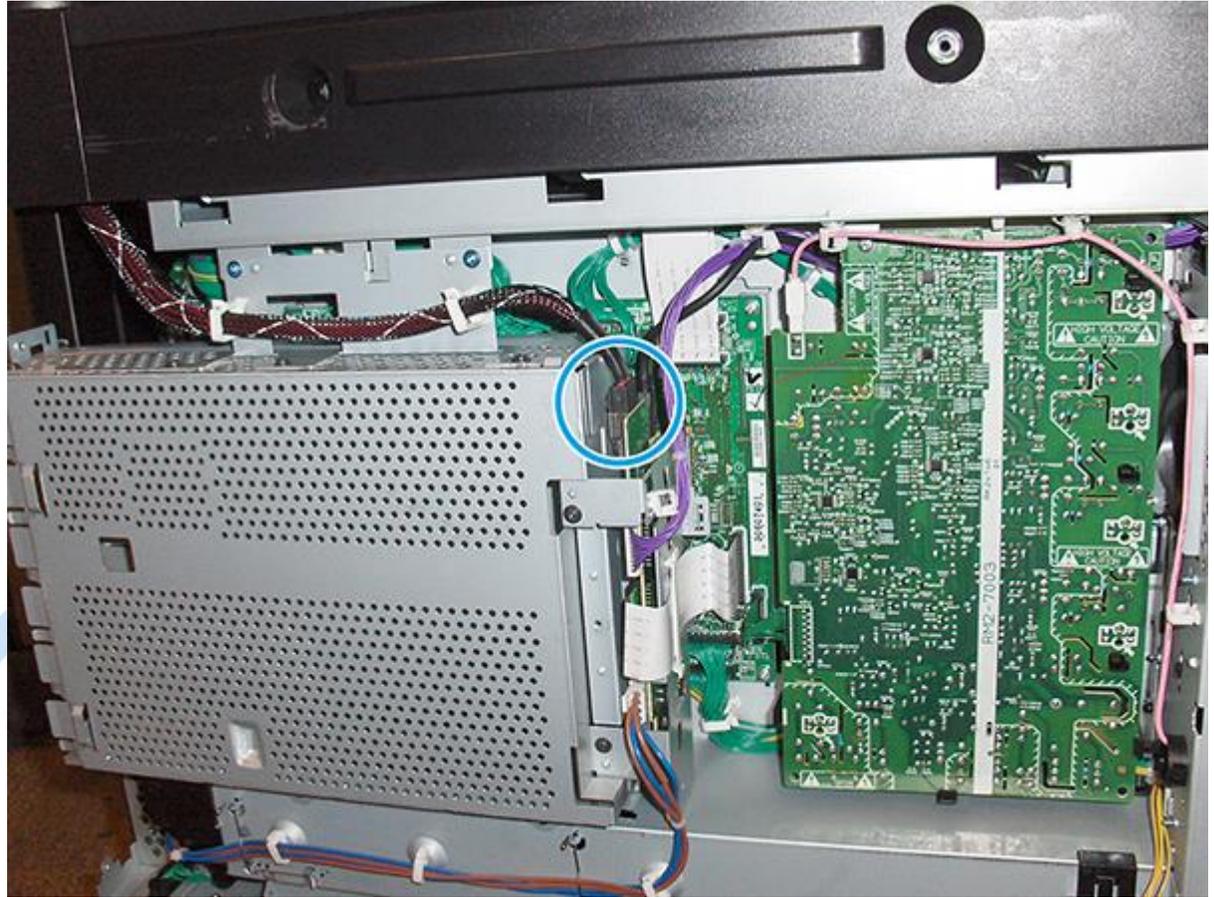

5. Check the event log for any errors that might have occurred prior to the 30.03.45 error.
 - If there are error codes starting with 31.XX.XX listed, the internal scanner inside the document feeder might be faulty. Replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

- If there are error codes starting with 30.XX.XX, replace the image scanner assembly.

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67908

6. If the error persists after checking all the connections on the SCB, replacing the document feeder, and replacing the scanner, then replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

31.XX.YZ error messages

31.* errors

Errors in the 31.* family are related to the document feeder.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Verify the document feeder top cover is completely closed when feeding pages through it.
2. Verify the document feeder input tray is not overloaded and that the guides are adjusted correctly.
3. Open the document feeder top cover and check the rollers. Clean or replace them if necessary.
4. Clean the scanner glass and all the calibration strips.
5. Calibrate the scanner. Open these menus: Device Maintenance > Calibrate-Cleaning > Calibrate Scanner.
6. Clean the scanner glass and glass strips, and clean the white strips used for calibration.
7. Perform the tests for scanner diagnostics. Open these menus: Administration > Troubleshooting > Diagnostic Tests > Scanner Tests. Look for tests related to the document feeder, such as the Jam Cover Sensor test.
8. Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).


9. Check all connections from the document feeder to the scanner control board, and reseal them if necessary.
10. If the error persists, replace the document feeder assembly.

31.01.47 Document feeder not detected

The document feeder was not detected. The document feeder might not be connected. The flatbed glass is still available for scanning.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, check the connections between the document feeder and the SCB for correct seating and secure connection.

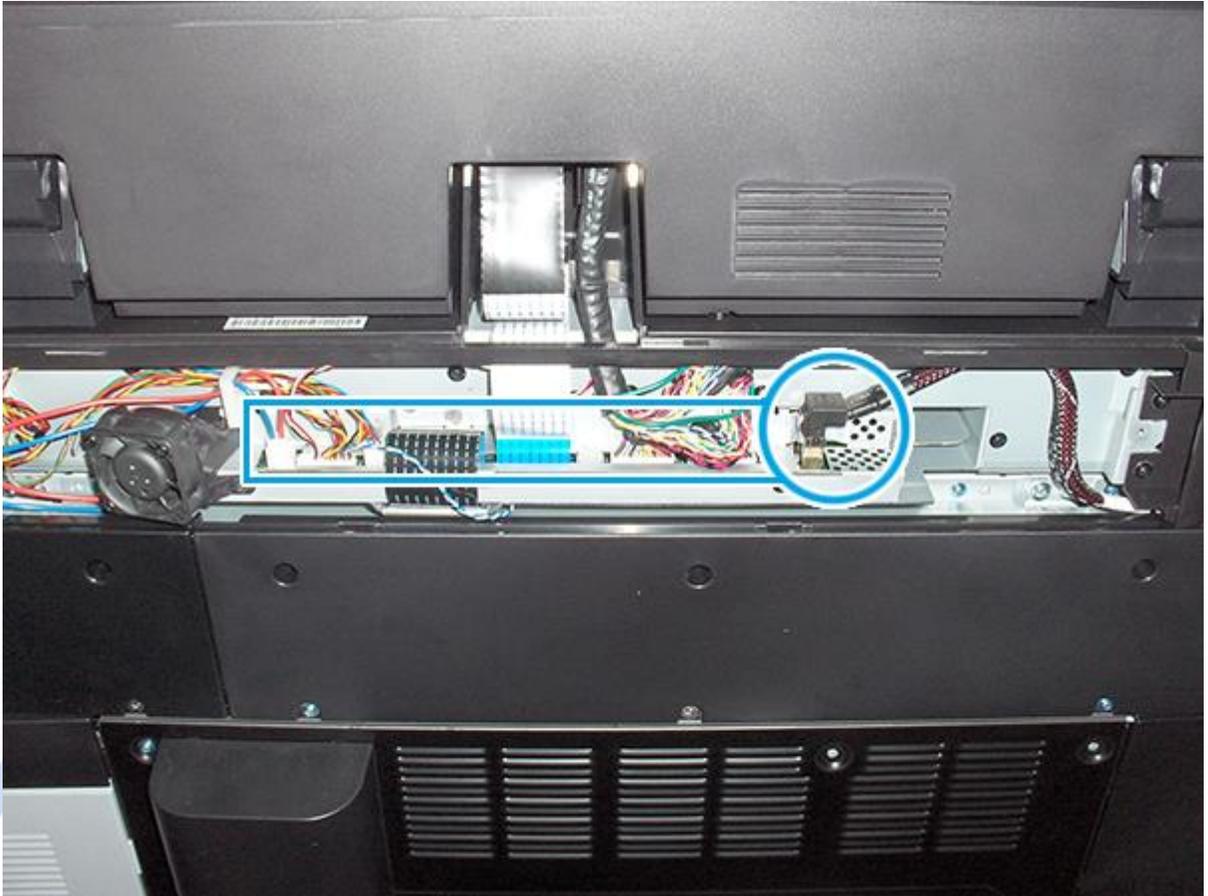

3. If the error persists, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

31.03.14

Backside scanner EEPROM (NVM) error occurred.

A non-fatal error has occurred.

Recommended action

No action required.


31.03.20

Backside scanner not detected.


Recommended action

1. Turn the printer off, and then on.
2. Ensure that the back side background selector is installed correctly.
3. Clean the back side background selector.

Remove background selector

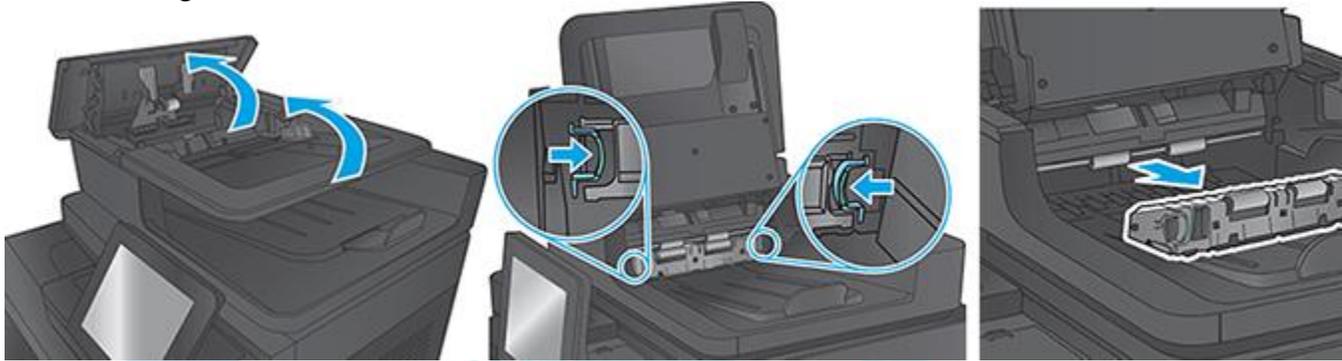

Clean back side background selector

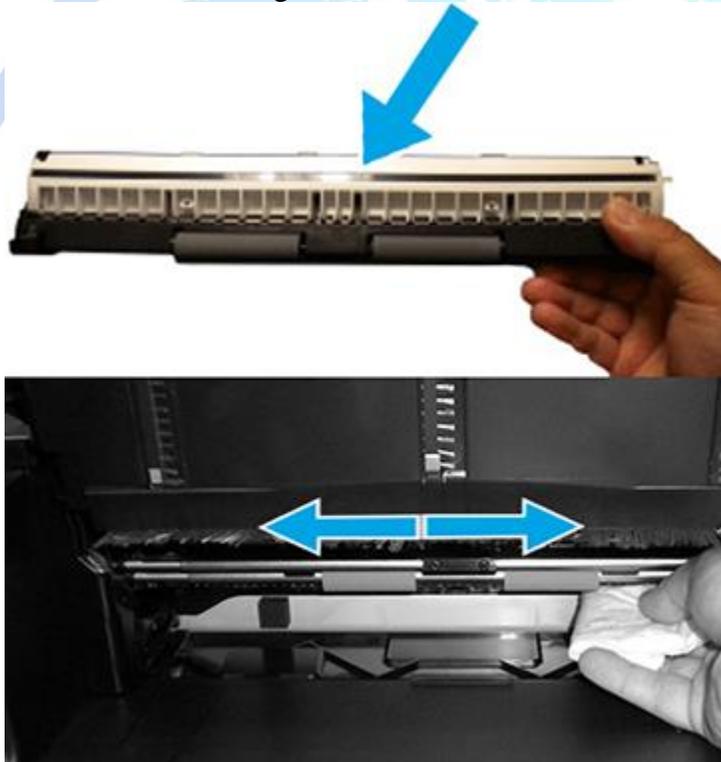

4. If the error persists, check the connections on the SCB for correct seating and secure connection.
5. If the error persists, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

31.03.22


Backside illumination calibration failure.

This error code indicates a failure in the S2 scanner located inside the document feeder assembly.

Recommended action for customers


1. Turn the printer off, and then on.
2. Upgrade the firmware.
3. Make sure the S2 background selector is installed correctly and is clean.
 - a. Remove the S2 background selector from the document feeder assembly.

Remove background selector

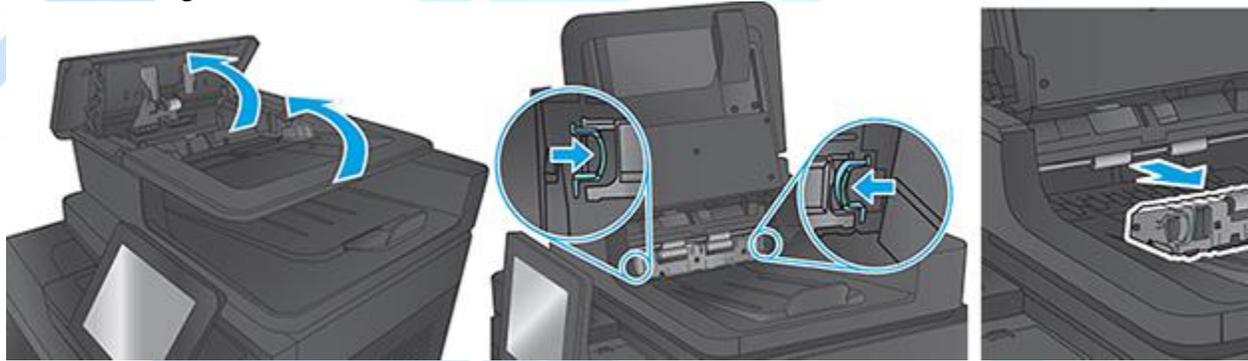

- b. Using a dampened, lint-free cloth, clean the white area located on the S2 background selector, and then clean the S2 scanner glass area.

Clean back side background selector

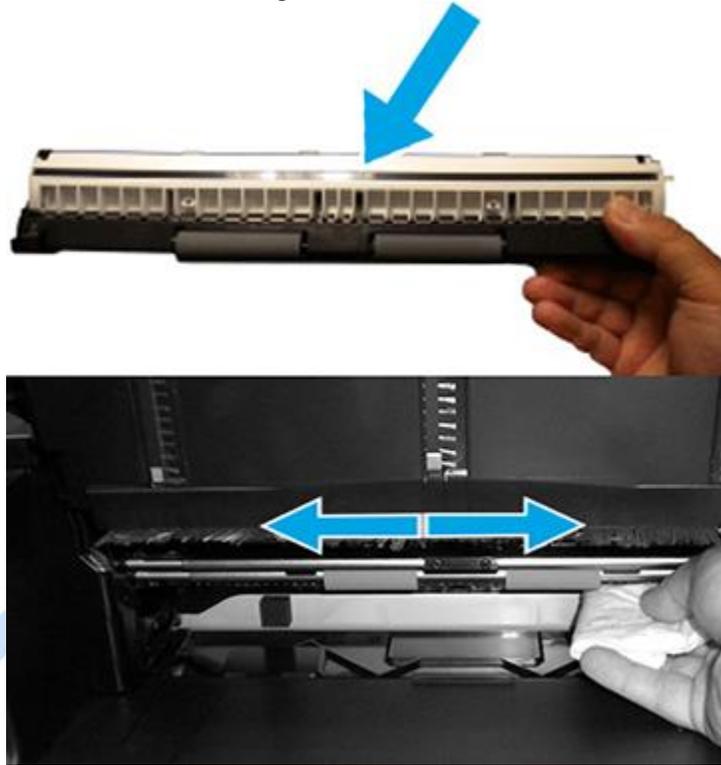

- c. Reinstall the S2 background selector.

Note:


When installing the S2 background selector, listen for the two distinct clicking sounds on both sides to be sure that it has been re-installed securely.

4. Turn the printer off, and then on.
5. Attempt a new duplex copy job.
6. If the error persists, contact HP Support.

Recommended action for call agents


1. Turn the printer off, and then on.
2. If needed, walk the customer through the following steps to clean the printer.
 - a. Make sure the S2 background selector is installed correctly and is clean.
 - b. Remove the S2 background selector from the document feeder assembly.

Remove background selector

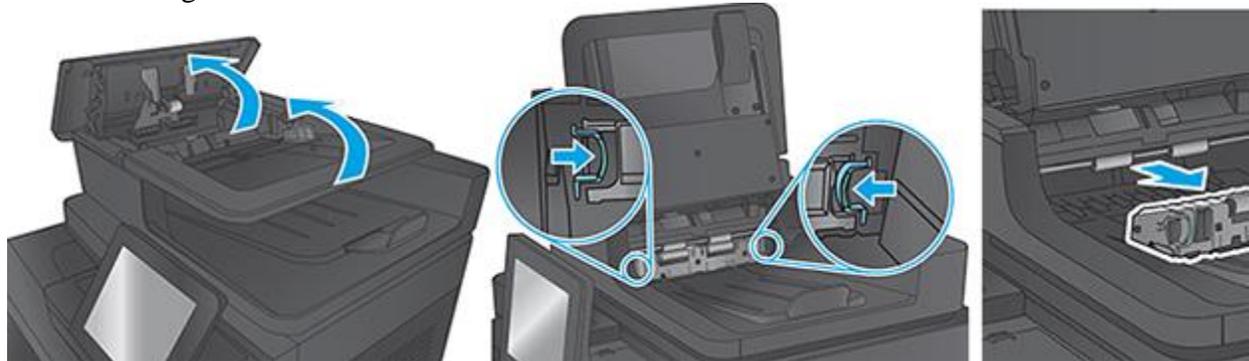

- c. Using a dampened, lint-free cloth, clean the white area located on the S2 background selector, and then clean the S2 scanner glass area.

Clean back side background selector

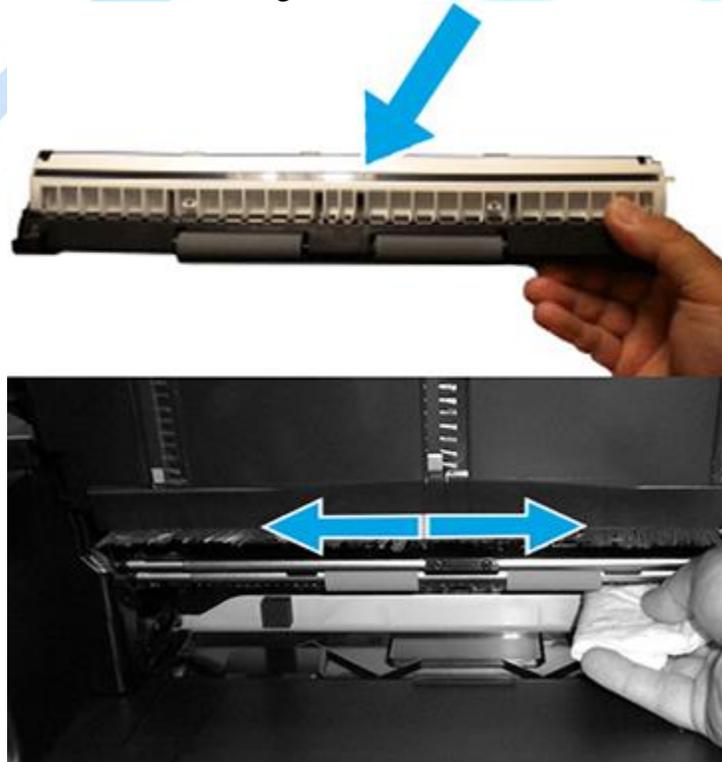

- d. Reinstall the S2 background selector.

Note:

When installing the S2 background selector, listen for the two distinct clicking sounds on both sides to be sure that it has been re-installed securely.

3. Update the printer's firmware to version 3.4 or newer.
4. Reseat all connections from the document feeder to the scanner control board (SCB).

5. If the error persists, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920


Important:

Do not replace the flatbed scanner or the formatter for this error.

Recommended action for on-site technicians


1. Turn the printer off, and then on.
2. Ensure that the S2 background selector is installed correctly and is clean.
 - a. Remove the S2 background selector from the document feeder assembly.

Remove background selector

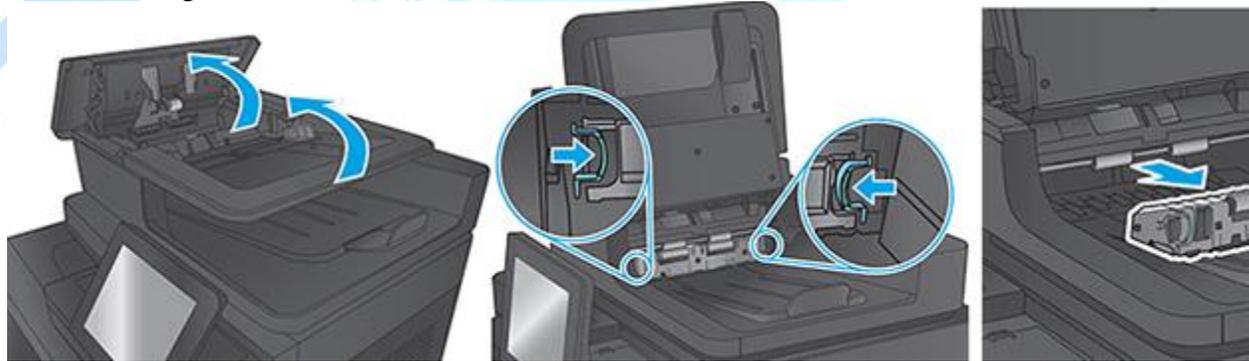

- b. Using a dampened, lint-free cloth, clean the white area located on the S2 background selector, and then clean the S2 scanner glass area.

Clean back side background selector

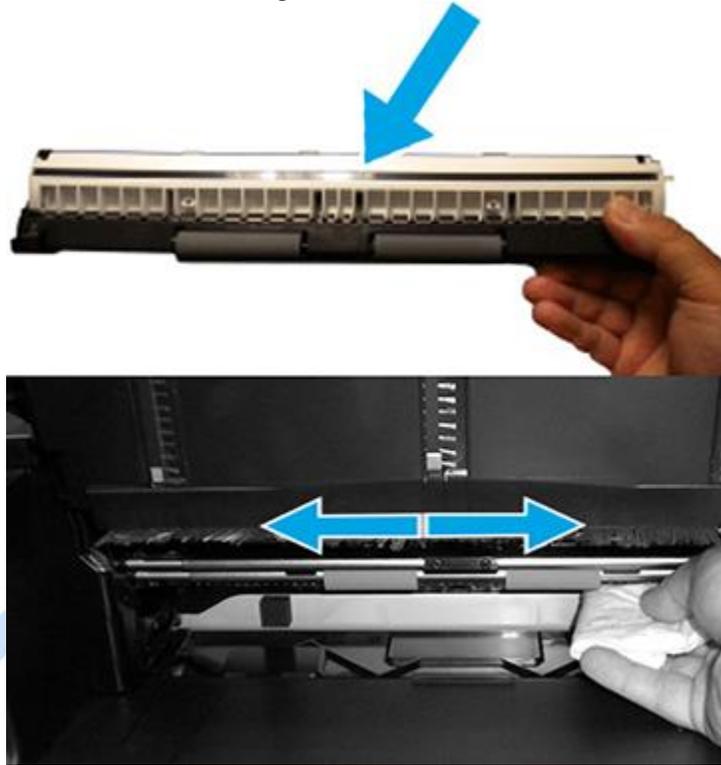

- c. Reinstall the S2 background selector.

Note:

When installing the S2 background selector, listen for the two distinct clicking sounds on both sides to be sure that it has been re-installed securely.

3. Turn the printer on and attempt a duplex job from the document feeder assembly. Before the paper is picked the calibration for the S2 scanner will occur.
4. Make sure the scanner lamp is on and the background selector white area moves back and forth. After the calibration is complete, the paper in the document feeder input tray will be picked up.
5. If the 31.03.22 error is displayed during the calibration, perform the following procedure:
 - a. Make sure that the firmware has been upgraded to version 3.4 or newer. If not, upgrade the firmware to the current version.
 - b. If the firmware is current and the error persists, verify all the connections on the SCB.
 - Verify that the end of the white FFC that comes from the document feeder is in good condition. If the FFC is damaged, replace the document feeder.


For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

- Verify that the corresponding connector on the SCB is not damaged. If the connector is damaged, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

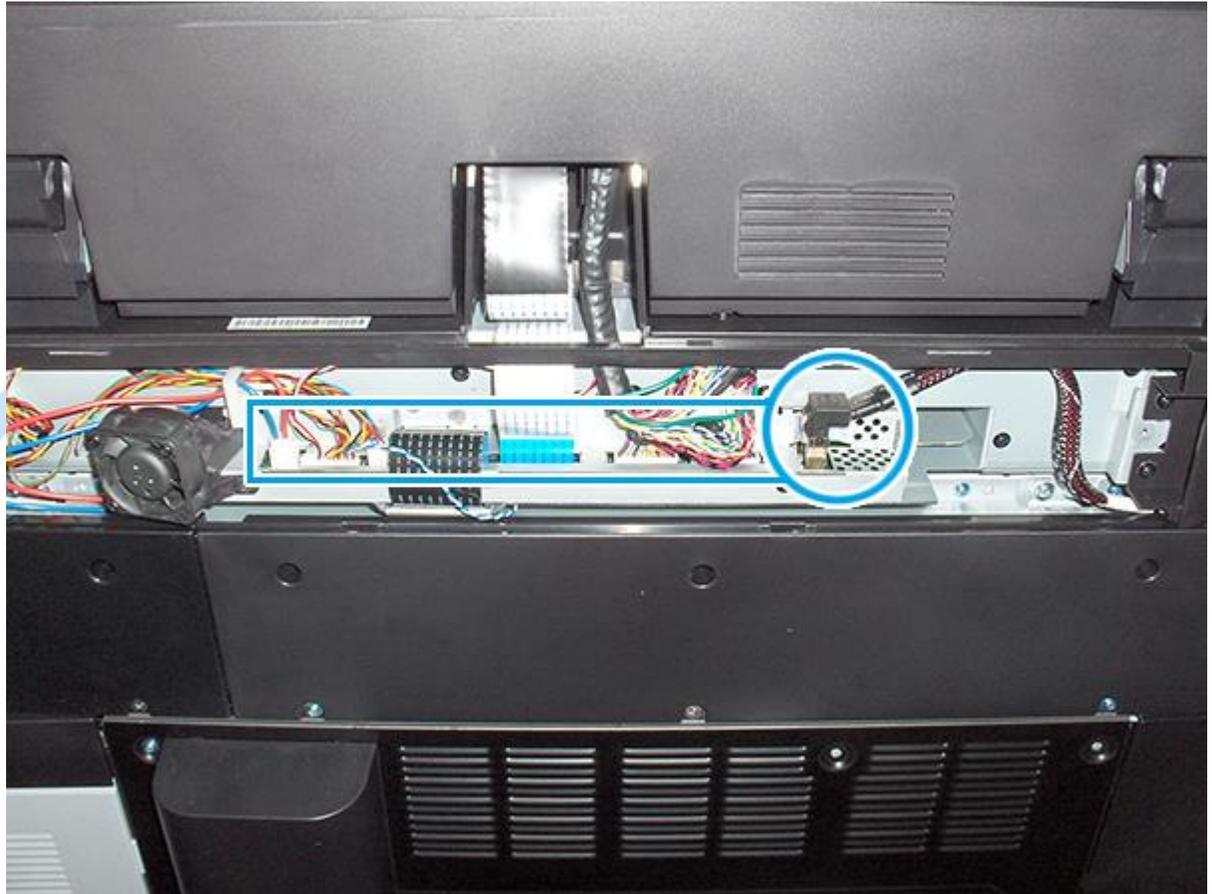

- c.
- d. If any cables leading up to the document feeder are damaged, replace the document feeder assembly only.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

Important:

Do not replace the flatbed scanner or the formatter for this error.

6. Turn the printer off, and then on.
7. Perform a document feeder duplex job and verify that the issue is resolved.

31 . 03 . 30

The document feeder pick motor is not turning.

Recommended action

1. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
2. Ensure that the input tray is not overloaded and that the tray guide is set to the correct size and not tight against the paper.
3. Check the event log for document feeder errors, and then resolve any errors first.
4. Open and close the top cover to see if the pick motor turns without posting this error. If the motor turns, then the motor is in good condition.
5. If the motor tested OK, reload the paper in the document feeder making sure that the tray guides are set correctly and the tray is not overfilled. Perform another copy job to test.
6. If the error persists, check the connections on the SCB for correct seating and secure connection.
7. If the error persists, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

31 . 03 . 31

The document feeder feed motor is not turning.

Recommended action

1. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
2. Ensure that the input tray is not overloaded and that the tray guide is set to the correct size and not tight against the paper.
3. Check the event log for document feeder errors, and then resolve any errors first.
4. If the error persists, check the connections on the SCB for correct seating and secure connection.
5. If the error persists, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

31 . 03 . 32

The document feeder de-skew motor is not turning.

Recommended action

1. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
2. Ensure that the input tray is not overloaded and that the tray guide is set to the correct size and not tight against the paper.
3. Check the event log for document feeder errors, and then resolve any errors first.
4. If the error persists, check the connections on the SCB for correct seating and secure connection.
5. If the error persists, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

31 . 03 . 33


Backside scanner calibration error.

Glass or the background selector at the back side scanner calibration area are dirty.

Recommended action for customers


1. Turn the printer off, and then on.
2. Remove the S2 background selector from the document feeder assembly.

Remove background selector

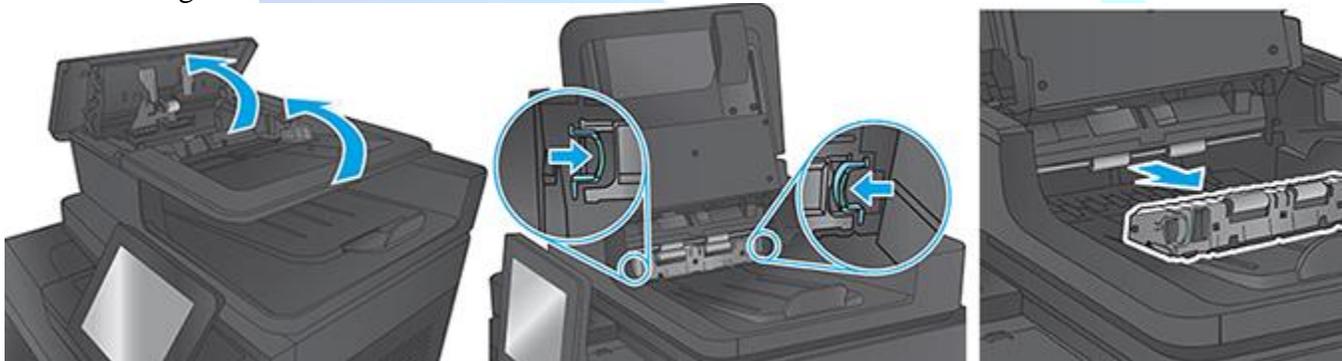

3. Using a dampened, lint-free cloth, clean the white area located on the S2 background selector, and then clean the S2 scanner glass area.

Clean back side background selector

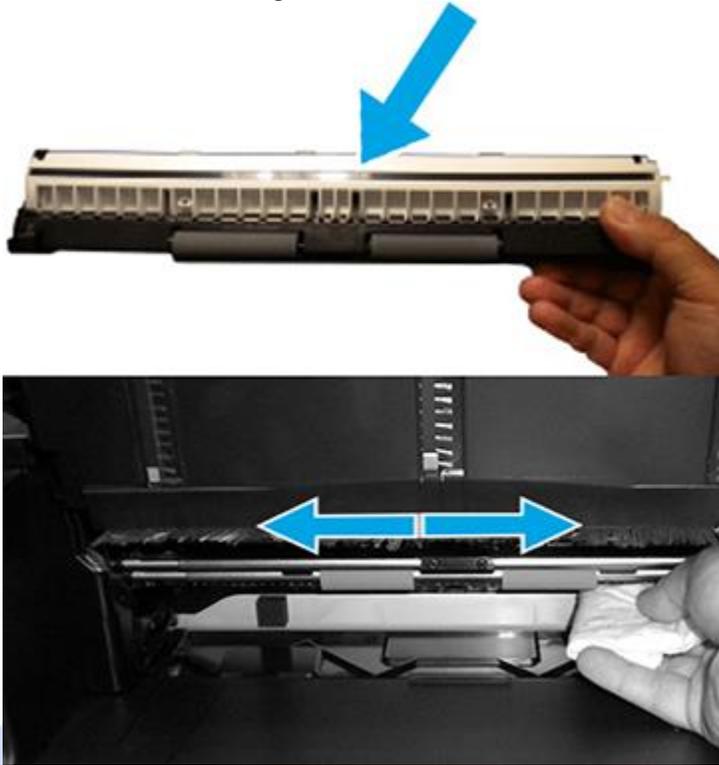

4. Reinstall the S2 background selector.

Note:


When installing the S2 background selector, listen for the two distinct clicking sounds on both sides to be sure that it has been re-installed securely.

5. Turn the printer off, and then on.
6. Attempt a duplex copy job.
7. If the error persists, contact HP Support.

Recommended action for call agents


1. Turn the printer off, and then on.
2. Obtain the scan count for the document feeder (both simplex and duplex). Enter the information into the case notes.
3. Confirm the 31.03.33 error is only present in the event log. At the control panel, the status line must show the message "Clean document feeder area".
4. If needed, walk the customer through the following steps to clean the printer.
 - a. Ensure that the S2 background selector is clean and installed correctly.
 - b. Remove the S2 background selector from the document feeder assembly.

Remove background selector

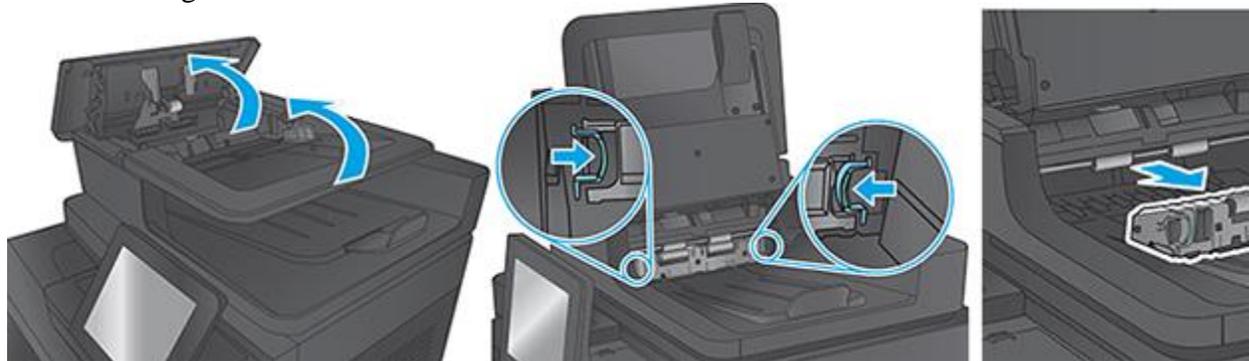

- c. Using a dampened lint free cloth, clean the white area located on the S2 background selector and the S2 scanner glass area.

Clean back side background selector

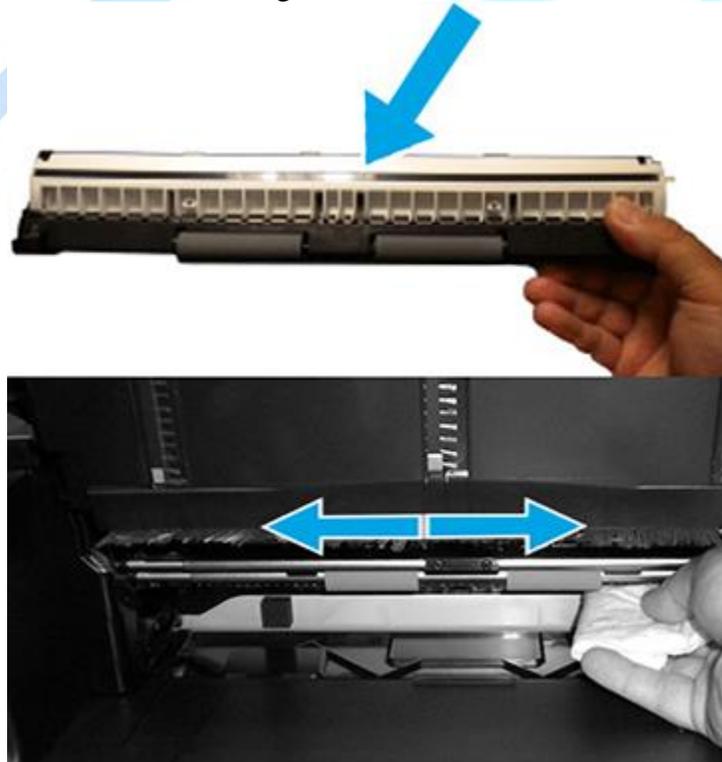

- d. Reinstall the S2 background selector.

Note:

When installing the S2 background selector, listen for the two distinct clicking sounds on both sides to be sure that it has been re-installed securely.

5. Reseat all connections from the document feeder to the scanner control board (SCB).
6. If the error persists, replace the document feeder assembly.


For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

Recommended action for on-site technicians


1. Turn the printer off, and then on.
2. Ensure that the S2 background selector is clean and installed correctly.
 - a. Remove the S2 background selector from the document feeder assembly.

Remove background selector

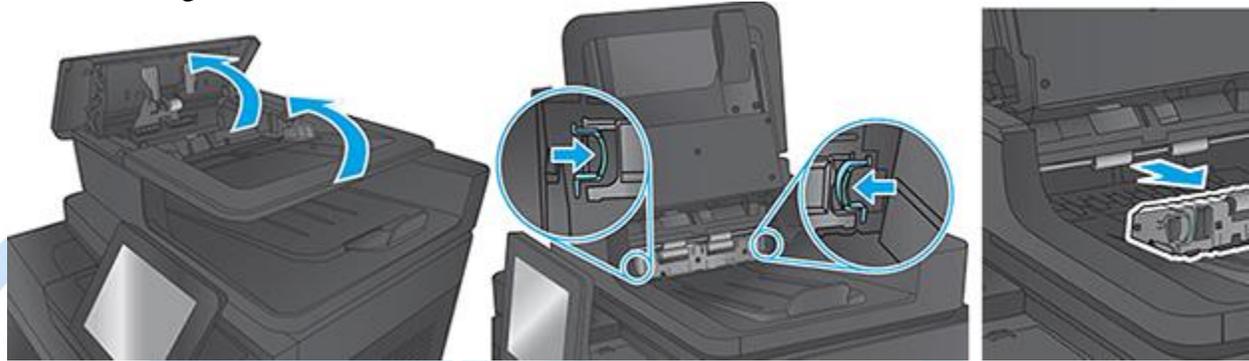

- b. Using a dampened, lint-free cloth, clean the white area located on the S2 background selector, and then clean the S2 scanner glass area.

Clean back side background selector

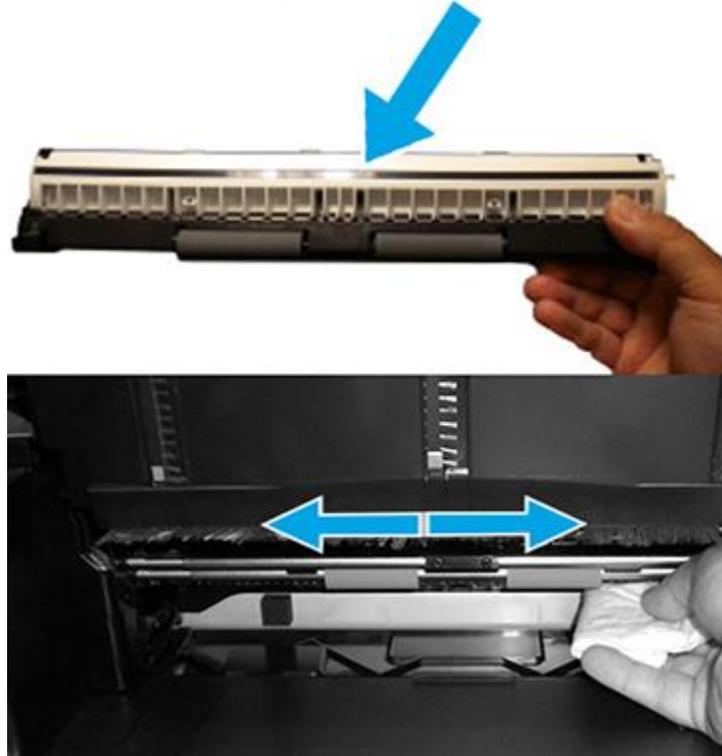

- c. Reinstall the S2 background selector.

Note:

When installing the S2 background selector, listen for the two distinct clicking sounds on both sides to be sure that it has been re-installed securely.

- 3. Verify all the connections on the SCB.
 - o Verify that the end of the white FFC that comes from the document feeder is in good condition. If the FFC is damaged, replace the document feeder.


For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

- o Verify that the corresponding connector on the SCB is not damaged. If the connector is damaged, replace the scanner control board (SCB).


For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

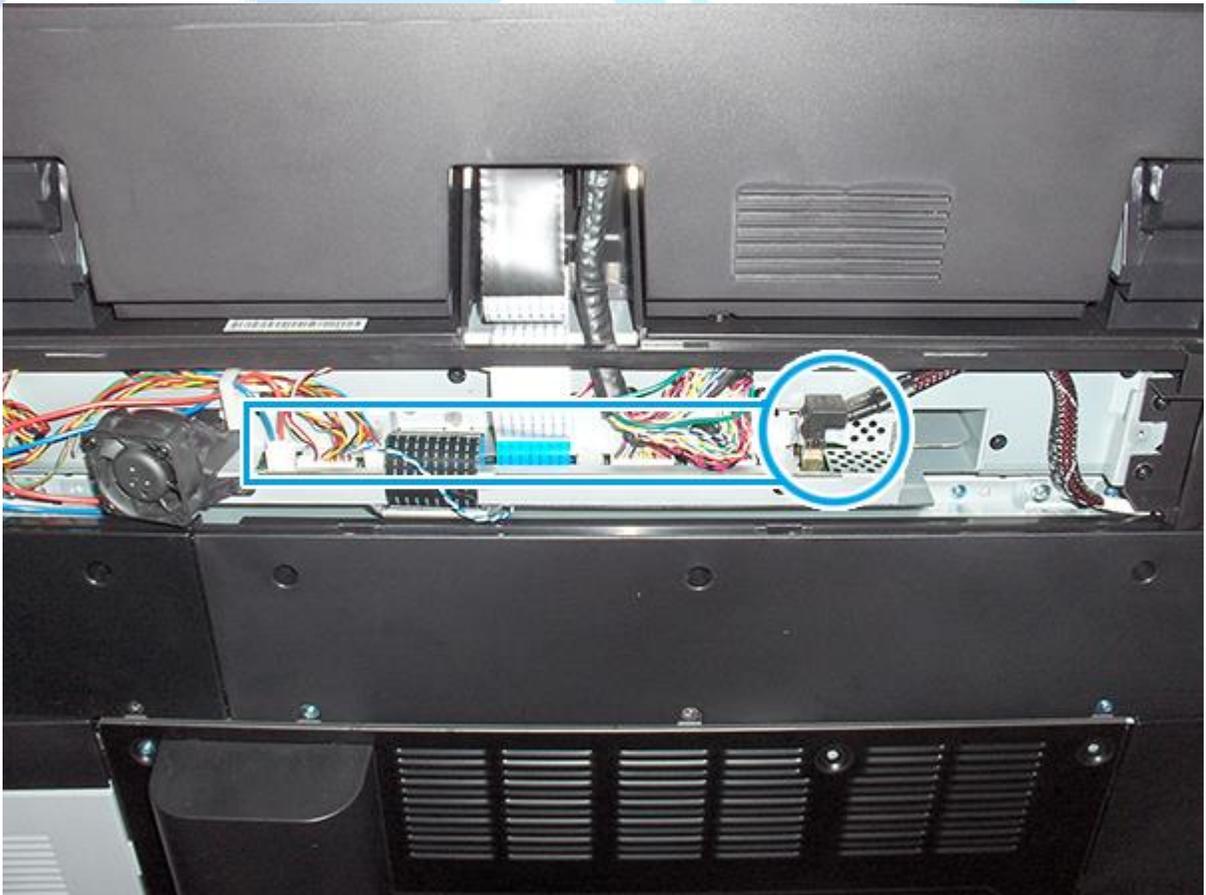

4.

5. Check all connections on the SCB between the document feeder and the scanner.

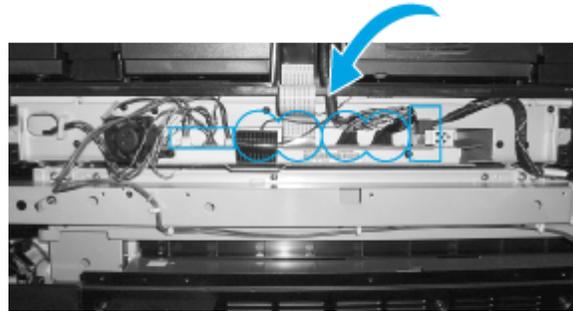

SCB connections

6. If the error persists, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

31.03.34

The removable background for the back side scanner is either missing or not fully snapped into place.

Recommended action


1. Update the printer firmware to version 3.4 or newer.

Important:

Do **not** replace any parts for this error before upgrading the firmware.


2. If the firmware upgrade does not resolve the error, perform the following steps:
 - a. Ensure that the S2 background selector is clean and installed correctly.
 - b. Remove the S2 background selector from the document feeder assembly.

Remove background selector

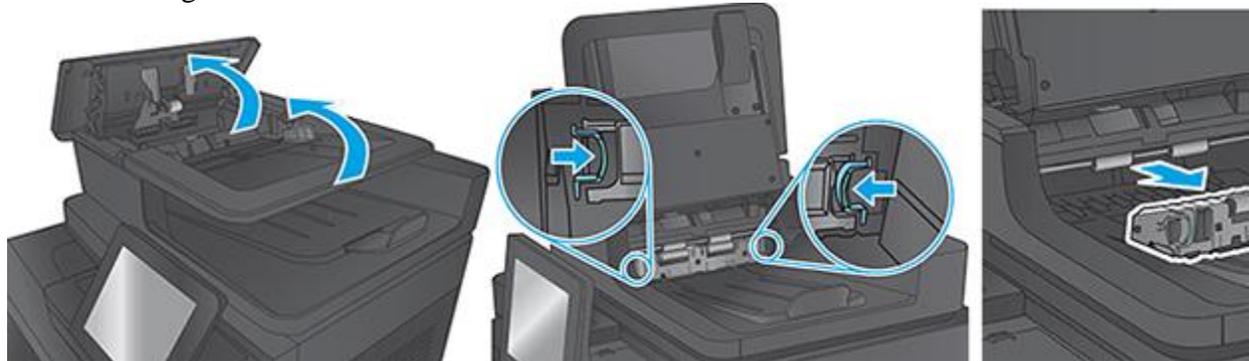

- c. Using a dampened lint free cloth, clean the white area located on the S2 background selector and the S2 scanner glass area.

Clean back side background selector

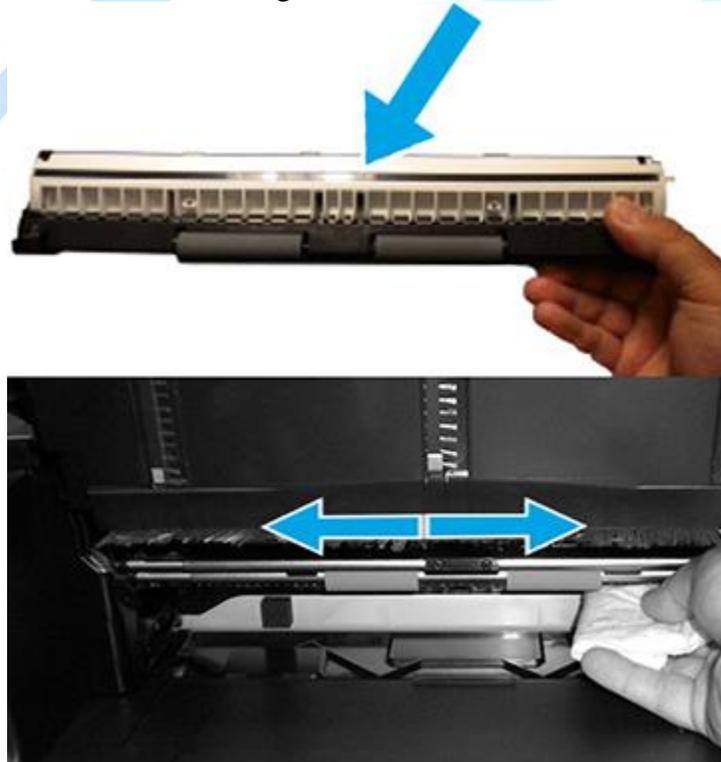


- d. Reinstall the S2 background selector.

Note:

When installing the S2 background selector two distinct click sounds must be heard at both sides, which will indicate that it has been installed correctly.

- e. If the error persists, check all connections on the SCB between the document feeder and the scanner.

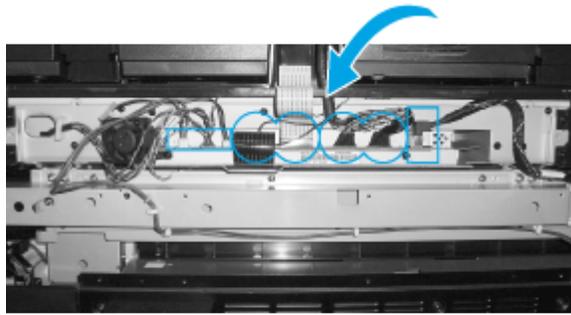

SCB connections

- f. If the error persists, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

31.13.00 Document feeder multi-pick error

A multiple pick error was reported by the document feeder assembly.

Recommended action for customers

1. Open the document feeder cover, pull all the sheets back into the tray and then resume the job.
2. Verify that the paper meets the HP specifications for the printer.
3. Ensure that the input tray is not overloaded and the tray guides are correctly aligned to the correct size for the paper being used.
4. Check the document feeder page count to assess roller life and replace as necessary.


ADF Roller Maintenance Kit

Part number: C1P70-67901

5. Check to ensure the document feeder pick roller cover is securely closed.
 - a. Open the document feeder.



- b. Locate and release the document feeder pick roller cover.

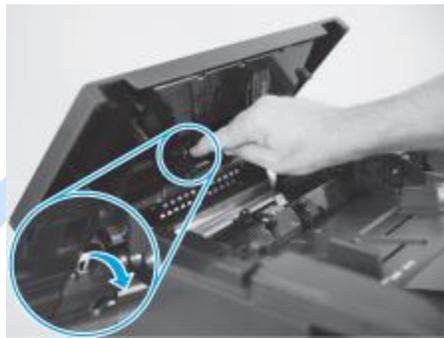

- c. Close the document feeder pick roller cover



- d. Make sure that the roller access door snaps closed.



6. Verify the roller assembly and separation pad are installed correctly.

Open the top cover of the document feeder. Push down on the separation pad and then release – it should spring back up. If it does not, the spring might be missing.

Note:

The separation pad assembly is mounted to a spring loaded paper access guide, which also moves when pushed down.

7. Clean the separation pad and feed rollers. Use a soft, lint-free cloth moistened with water to clean the two rollers and the separation pad.

If the rollers or pad are damaged or are excessively worn, replace the roller kit.

ADF Roller Maintenance Kit

Part number: C1P70-67901

Recommended action for call center agents

1. Open the document feeder cover, pull all the sheets back into the tray and then resume the job.
2. Verify that the paper meets the HP specifications for the printer.
3. Ensure that the input tray is not overloaded and the tray guides are correctly aligned to the correct size for the paper being used.
4. Check the document feeder page count to assess roller life and replace as necessary.


ADF Roller Maintenance Kit

Part number: C1P70-67901

5. Check to ensure the document feeder pick roller cover is securely closed.
 - a. Open the document feeder.



- b. Locate and release the document feeder pick roller cover.

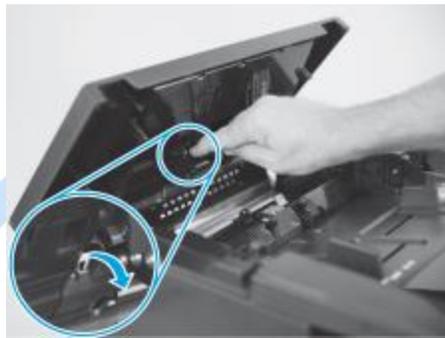

- c. Close the document feeder pick roller cover



- d. Make sure that the roller access door snaps closed.



6. Verify the roller assembly and separation pad are installed correctly.

Open the top cover of the document feeder. Push down on the separation pad and then release – it should spring back up. If it does not, the spring might be missing.

Note:

The separation pad assembly is mounted to a spring loaded paper access guide, which also moves when pushed down.

7. Clean the separation pad and feed rollers. Use a soft, lint-free cloth moistened with water to clean the two rollers and the separation pad.

If the rollers or pad are damaged or are excessively worn, replace the roller kit.

ADF Roller Maintenance Kit

Part number: C1P70-67901

8. Execute the scanner diagnostic test to manually test the ADF paper path pick success document feeder sensors.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Scanner Tests

FutureSmart 4

- Support Tools
- Troubleshooting
- Diagnostic Tests (touch Continue).
- Manual Sensor Test

- b. Actuate the ADF pick-success sensor.
- c. If the sensor fails to register, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

ADF whole unit assembly - White backing A3 paper size kit.

Part number: CF367-67920

Recommended action for onsite technicians

1. Open the document feeder cover, pull all the sheets back into the tray and then resume the job.
2. Verify that the paper meets the HP specifications for the printer.
3. Ensure that the input tray is not overloaded and the tray guides are correctly aligned to the correct size for the paper being used.
4. Check the document feeder page count to assess roller life and replace as necessary.


ADF Roller Maintenance Kit

Part number: C1P70-67901


5. Check to ensure the document feeder pick roller cover is securely closed.
 - a. Open the document feeder.




- b. Locate and release the document feeder pick roller cover.

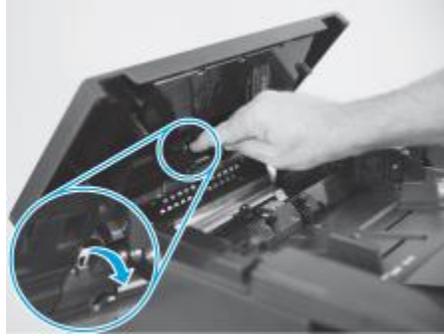

- c. Close the document feeder pick roller cover

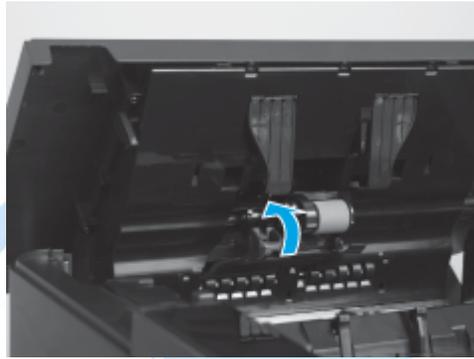

- d. Make sure that the roller access door snaps closed.

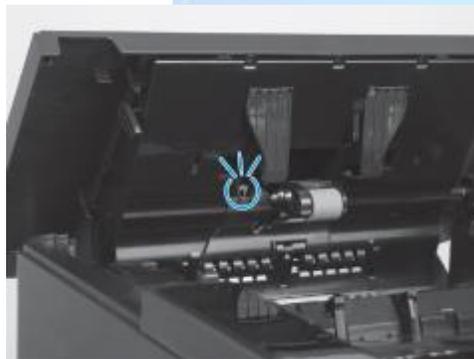

6. Verify the roller assembly and separation pad are installed correctly.

Open the top cover of the document feeder. Push down on the separation pad and then release – it should spring back up. If it does not, the spring might be missing.

Note:

The separation pad assembly is mounted to a spring loaded paper access guide, which also moves when pushed down.

7. Clean the separation pad and feed rollers. Use a soft, lint-free cloth moistened with water to clean the two rollers and the separation pad.

If the rollers or pad are damaged or are excessively worn, replace the roller kit.

ADF Roller Maintenance Kit

Part number: C1P70-67901

8. Execute the scanner diagnostic test to manually test the ADF paper path pick success document feeder sensors.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Scanner Tests


FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Manual Sensor Test
- b. Actuate the ADF pick-success sensor.
 - c. If the sensor fails to register, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

ADF whole unit assembly - White backing A3 paper size kit. Part number: CF367-67920

9. Verify that the motor cables are connected.
10. Reseat all document feeder cables on the scanner control board (SCB).

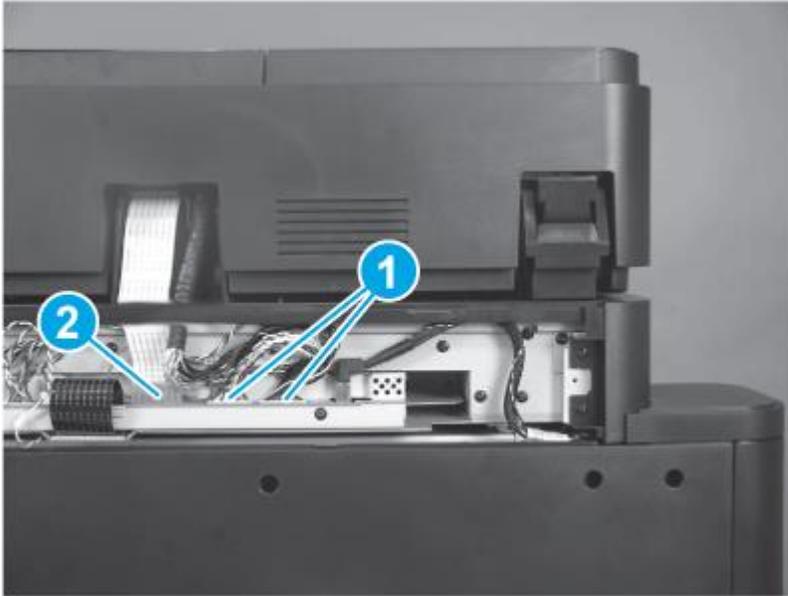

1. Re-seat two connectors

2. Re-seat flat cable

11. Execute the scanner diagnostic test to manually test the following document feeder sensors:

- ADF paper present
- ADF Y (length)
- ADF jam cover
- ADF paper path skew
- ADF paper path pick success
- Paper path sensor 1 (unreachable)
- g. Open the following menus to initiate the scanner diagnostic test:

FurtureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Scanner Tests
- Sensors

FurtureSmart 4

- Support Tools
- Troubleshooting
- Diagnostic Tests
- Manual Sensor Test

- h. Actuate each sensor on the document feeder. If any of the sensors fail, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

31.13.01

Document feeder paper pick error.

A paper pick was initiated, but the page did not make it to the pick success sensor.

Recommended action for customers

1. If the customer is attempting to copy high toner coverage originals with a new printer or a newly replaced separation pad, perform the following the steps listed. If not, skip to the next step.

This jam condition may coincide with the installation of a new separation pad for the document feeder or with a new printer where the document feeder has not been used much. The separation pad requires a break in process so it can feed originals that contain high toner coverage in the area where the separation pad is installed.

- a. Feed 300 **blank** pages through the document feeder to create a break in process for the new separation pad.

Note:

The separation pad requires a break in process so it can feed originals that contain high toner coverage in the area where the separation pad is installed. The originals with high toner coverage should feed okay after feeding the blank pages.

2. If the error persists, open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
3. Check the paper guides and ensure that they are set to the correct paper width.
4. Ensure that the input tray is not overloaded.
5. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
6. Clean the document feeder pick and feed rollers and clean the separation pad.
7. If any pick and feed rollers are worn or damaged, check the event log for the 10.39.70 code and replace the roller kit.

Note:

After an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.39.70 error is listed, the supply is past very low. Inform the customer that he or she must order and pay for the replacement.
- If an active low warning is not listed, replace the part under warranty.

Part number: C1P70-67901

8. After replacing the document feeder maintenance kit, reset the maintenance kit page counter by selecting New Document Feeder Kit in the Manage Supplies sub-menu.

Recommended action for call-center agents and onsite technicians

1. If the customer is attempting to copy high toner coverage originals with a new printer or a newly replaced separation pad, perform the following the steps listed. If not, skip to the next step.

This jam condition may coincide with the installation of a new separation pad for the document feeder or with a new printer where the document feeder has not been used much. The separation pad requires a break in process so it can feed originals that contain high toner coverage in the area where the separation pad is installed.

- a. Feed 300 **blank** pages through the document feeder to create a break in process for the new separation pad.

Note:

The separation pad requires a break in process so it can feed originals that contain high toner coverage in the area where the separation pad is installed. The originals with high toner coverage should feed okay after feeding the blank pages.

2. If the error persists, open the document feeder lid, pull the sheets back into the input tray, and then resume the job.
3. Check the paper guides and ensure that they are set to the correct paper width.
4. Ensure that the input tray is not overloaded.
5. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
6. Clean the document feeder pick and feed rollers and clean the separation pad.
7. If any pick and feed rollers are worn or damaged, check the event log for the 10.39.70 code and replace the roller kit.

Note:

After an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.39.70 error is listed, the supply is past very low. Inform the customer that he or she must order and pay for the replacement.
- If an active low warning is not listed, replace the part under warranty.

ADF Roller Maintenance Kit. Part number: C1P70-67901

8. After replacing the document feeder maintenance kit, reset the maintenance kit page counter by selecting New Document Feeder Kit in the Manage Supplies sub-menu.
9. If the rollers and pad are in good condition, execute the scanner diagnostic test to manually test the ADF paper path pick success document feeder sensors.
 - . Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Scanner Tests


FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Manual Sensor Test
- a. Actuate the pick-success sensor.
 - b. If the sensor fails to register, replace the document feeder.

For instructions: See the Repair Service Manual for this product.

ADF whole unit assembly - White backing A3 paper size kit. Part number:
CF367-67920

10. If the sensor test fails, check all connections on the SCB between the document feeder and the scanner.

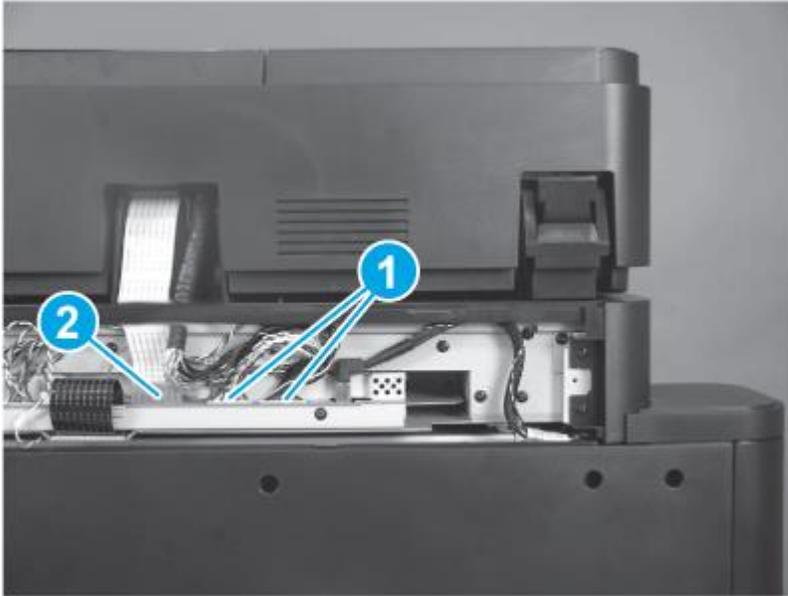

1. Re-seat two connectors

2. Re-seat flat cable

11. If the error persists, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

31 . 13 . 02

Document feeder job error, feed jam.

The paper passed the pick success sensor and then jammed in the document feeder paper path.

Recommended action for customers

1. If the customer is attempting to copy high toner coverage originals with a new printer or a newly replaced separation pad, perform the following the steps. If not, skip to the next step.

This jam condition might coincide with the installation of a new separation pad for the document feeder or with a new printer where the document feeder has not been used much.

- a. Feed 300 **blank** pages through the document feeder to create a break-in process for the new separation pad.

Note:

The separation pad requires a break-in process so it can feed originals that contain high toner coverage in the area where the separation pad is installed. The originals with high toner coverage should feed correctly after feeding the blank pages.

2. If the error persists, open the document feeder cover, pull all of the sheets back into the tray, and then resume the job.
3. Check the paper guides and ensure that they are set to the correct paper width.
4. Ensure that the input tray is not overloaded.
5. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
6. Clean the document feeder pick and feed rollers and clean the separation pad.
7. If any pick and feed rollers are worn or damaged, check the Event Log for the 10.39.70 code and replace the roller kit.

Note:

After an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If 10.39.70 error is listed, the supply is past very low. Inform the customer that he or she must order and pay for the replacement.
- If an active low warning is not listed, replace the part under warranty.

ADF roller maintenance kit part number: C1P70-67901

8. After replacing the document feeder maintenance kit, reset the maintenance kit page counter by selecting New Document Feeder Kit in the Manage Supplies sub-menu.

Recommended action for call-center agents and onsite technicians

1. If the customer is attempting to copy high toner coverage originals with a new printer or a newly replaced separation pad, perform the following steps. If not, skip to the next step.

This jam condition might coincide with the installation of a new separation pad for the document feeder or with a new printer where the document feeder has not been used much.

- a. Feed 300 **blank** pages through the document feeder to create a break-in process for the new separation pad.

Note:

The separation pad requires a break-in process so it can feed originals that contain high toner coverage in the area where the separation pad is installed. The originals with high toner coverage should feed correctly after feeding the blank pages.

2. If the error persists, open the document feeder cover, pull all of the sheets back into the tray, and then resume the job.
3. Check the paper guides and ensure that they are set to the correct paper width.
4. Ensure that the input tray is not overloaded.
5. Ensure that the type and quality of the paper that is being used meets the HP specifications for the printer.
6. Clean the document feeder pick and feed rollers and clean the separation pad.
7. If any pick and feed rollers are worn or damaged, check the Event Log for the 10.39.70 code and replace the roller kit.

Note:

After an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If 10.39.70 error is listed, the supply is past very low. Inform the customer that he or she must order and pay for the replacement.
- If an active low warning is not listed, replace the part under warranty.

ADF roller maintenance kit part number: C1P70-67901

8. After replacing the document feeder maintenance kit, reset the maintenance kit page counter by selecting New Document Feeder Kit in the Manage Supplies sub-menu.
9. If the rollers and pad are in good condition, execute the scanner diagnostic test to manually test the ADF paper path pick success sensor.
 - . Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Scanner Tests
- Sensors

FutureSmart 4


- Support Tools
- Troubleshooting
- Diagnostic Tests
- Manual Sensor Test

- a. Actuate the ADF paper path pick success sensor on the document feeder. If the sensor fails to register, replace the document feeder.

ADF whole unit assembly - White backing A3 paper size kit part number: CF367-67920

For instructions: See the Repair Service Manual for this product.

10. Ensure that the background selector is installed correctly and that it moves freely when removed from the document feeder assembly.

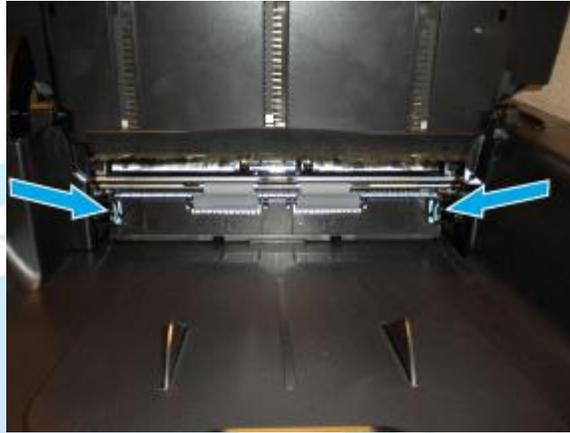

Background selector

11. If the background selector is broken or damaged, replace the background selector.

Part number: 5851-5861

12. If the background selector is in good condition, test the Paper Path Sensor.
 - . Open the following menus:


FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Scanner Tests

FutureSmart 4

- Support Tools
- Troubleshooting
- Diagnostic Tests

- a. Actuate the Paper Path Sensor.
13. If the sensor test fails, check all the connectors to the SCB between the document feeder and the scanner.

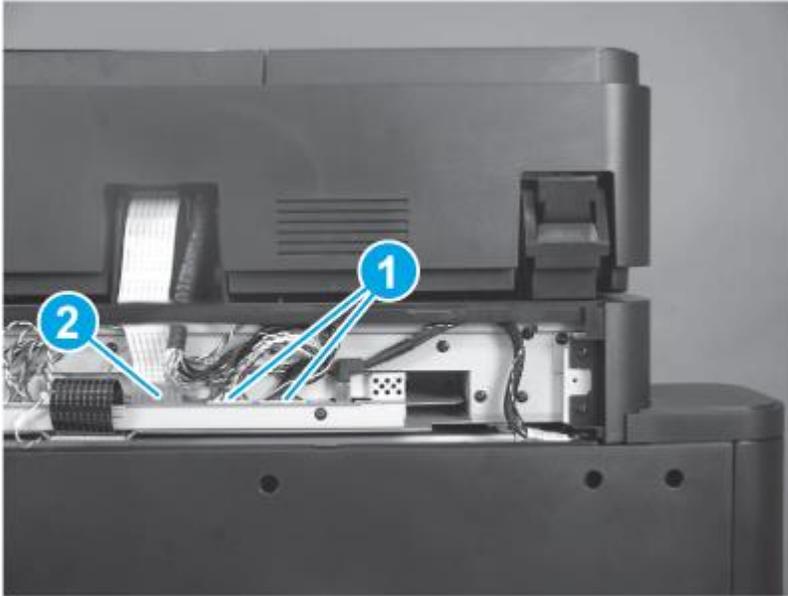

1. Re-seat two connectors

2. Re-seat flat cable

14. If the error persists, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

ADF whole unit assembly - White backing A3 paper size kit

Part number: CF367-67920

15. If the error persists, and all the SCB connections are seated correctly and not damaged, replace the scanner control board (SCB).

For instructions: See the Repair Service Manual for this product.

Part number: A2W75-67904

16. If the error persists, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

ADF whole unit assembly - White backing A3 paper size kit

Part number: CF367-67920

The document feeder jam access door is open.

Recommended action


1. Verify that the jam access cover is closed.
2. Verify that the flag is not broken off.
3. Test the sensor.
 - a. Open the following menus:

FutureSmart 3

- Administration
- Troubleshooting
- Diagnostic Tests
- Scanner Tests

FutureSmart 4

- Support Tools
 - Troubleshooting
 - Diagnostic Tests (touch Continue).
 - Manual Sensor Test
- b. Actuate the document feeder jam cover sensor.
 - c. If the sensor does not show functionality when tested, check all connections on the SCB between the document feeder and the scanner.

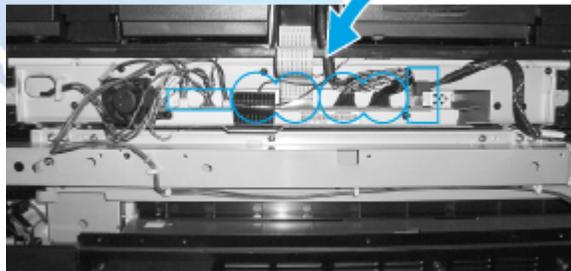

SCB connections

4. If the error persists, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.


Part number: CF367-67920

Document feeder job error: over current.

This is a feed jam in the document feeder which causes the motor to not turn.

Recommended action

1. Open the document feeder cover, pull all the sheets back into the tray, and then resume the job.
2. Verify that the paper meets the HP specifications for the printer.
3. Ensure that the input tray is not overloaded.
4. Ensure that the tray guides are correctly aligned to the correct size for the paper being used.
5. Check the event log for document feeder errors, and then resolve any other errors listed.
6. Open and close the top cover to see if the pick motor turns without posting this error. If there is no error, then the motor is in good condition.
7. If the error persists, check all the connectors to the SCB between the document feeder and the scanner.

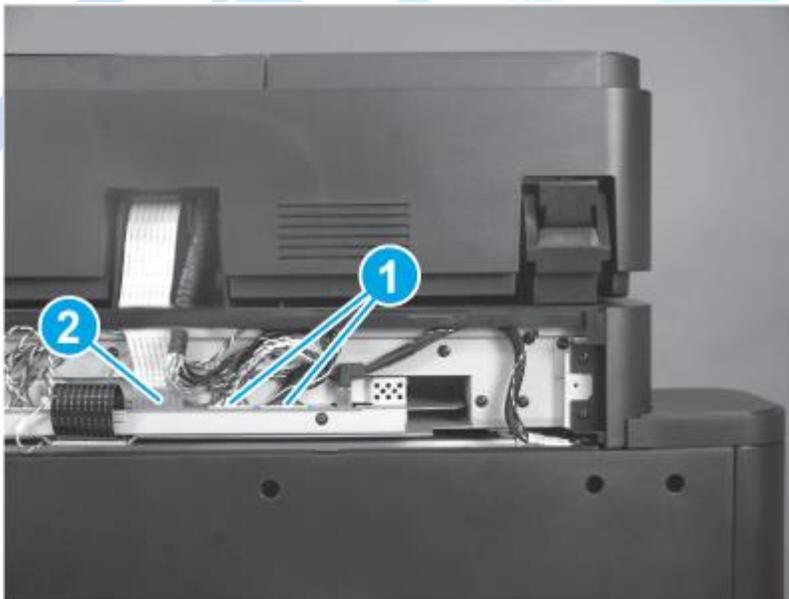

1. Re-seat two connectors

2. Re-seat flat cable

8. If the error persists and the connectors are not damaged, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

31.13.15

Duplex re-feed jam in the document feeder assembly.

The paper jam occurs on the back-side copy. The duplex re-feed does not make it to the deskew sensor.

Recommended action

1. Remove the jammed paper.
2. Verify that there is nothing in the paper path of the duplex refeed area.
3. Retry the copy job.
4. If the error persists, check all connections on the SCB between the document feeder and the scanner.
5. If the error persists, replace the document feeder assembly.

For instructions: See the Repair Service Manual for this product.

Part number: CF367-67920

32.XX.YZ error messages

32.* errors

Errors in the 32.* family are related to either product start events or to backup and restore events.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Retry the job.

32.08.A1 , 32.08.A2 , 32.08.A3

An event related to starting the printer.

32.08.A1 (event code)

Shutdown event. Boot after abnormal shutdown.

32.08.A2 (event code)

Boot from normal shutdown event.

32.08.A3 (event code)

Regular boot event.

Recommended action

No action necessary.

32.1C.05

The restore job ticket was submitted with invalid credentials.

Recommended action

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.06 (event code)

The backup job ticket was submitted with invalid credentials.

Recommended action

1. Verify the credentials that were submitted.
2. Check the domain, user name, and password.

32.1C.07 (event code)

Backup restore permissions error.

There was an error during the creation, read, or write of the restore file.

Recommended action

Retry the job.

32.1C.08 (event code)

Not enough disk space to perform backup/restore, or a network share issue.

There was an error during the creation, read, or write of the backup file.

Recommended action

1. Retry the job.
2. Remove stored jobs and retry.
3. If the error persists, try using a larger capacity storage device for the share location and check the network share settings.
4. Check the network share or try setting up a new shared network drive or folder.

32.1C.09 (event code)

Tried to restore a backup file that was not valid for this printer.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

Use a valid backup file.

32.1C.0A (event code)

Backup file is invalid.

The data in the backup file specified in the restore job ticket is no longer valid due to a corruption of the data, or the data is no longer present.

Recommended action

1. Use a valid backup file.
2. Reboot, and then observe the state of the printer.
3. If the error persists, perform a partition clean from the Preboot menu.

32.1C.0D (event code)

Backup/restore failed, auto-reboot failed, or the printer might be busy.

Recommended action

Reboot, and then retry the backup/restore.

32.1C.11 (event code)

Backup/restore time-out while communicating with the engine.

The backup operation was aborted because the printer is busy.

Recommended action

Wait until the printer is idle, and then try again.

32.1C.13, 32.1C.14

Not enough space exists to perform the backup.

The backup was aborted because the disk is at a critical level or full.

Scheduled backup failure.

Recommended action

Free up disk space, and then try again.

32.1C.15

The restore operation was aborted because the backup file was created by a previous version of firmware no longer supported by the feature.

Recommended action

Use the current backup file.

32.1C.2E

The restore operation was aborted because the printer is busy.

Recommended action


1. Wait until the printer is idle, and then retry.
2. Turn the printer off then on, and then retry.

32.1C.2F

Reset failure.

Recommended action

Turn the printer off, and then on. Retry the job.

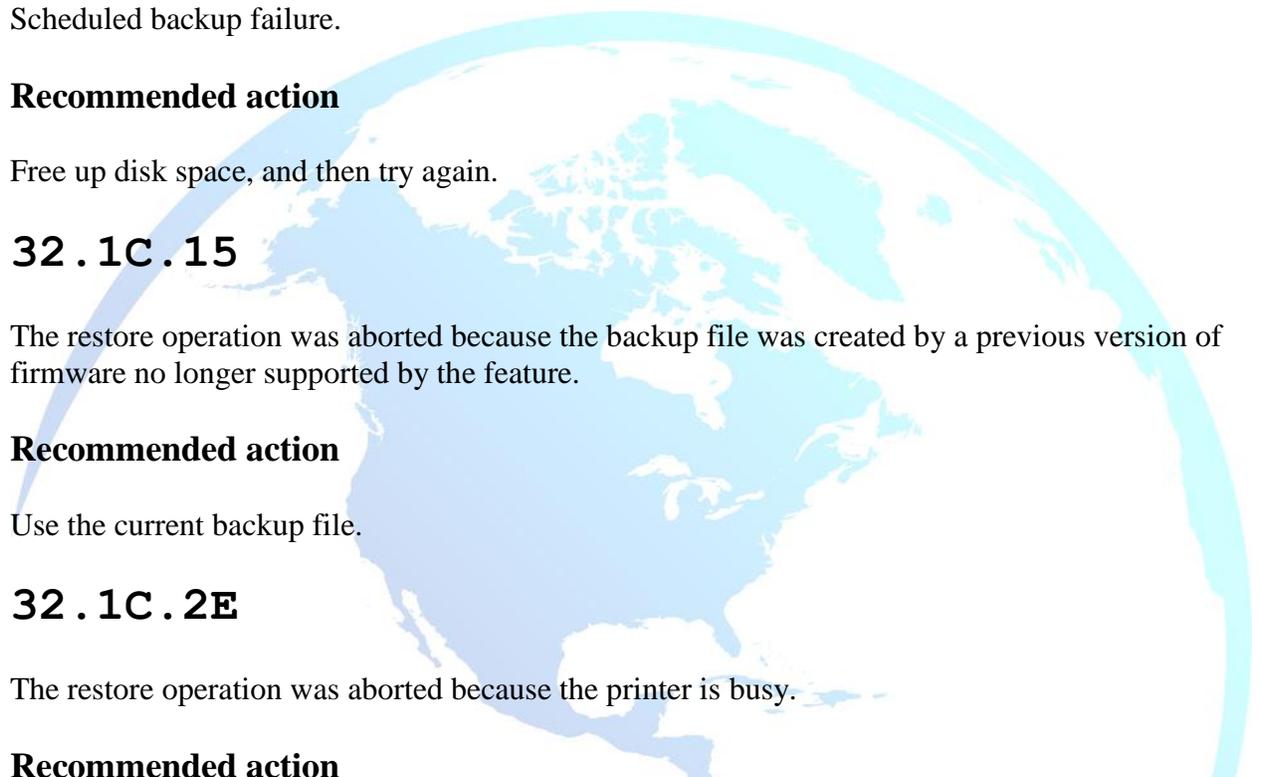

32 . 1C . 40

The backup operation completed successfully (informational).

Recommended action

No action necessary.

32 . 1C . 41

The backup operation encountered an error (informational).

Recommended action

No action necessary.

32 . 1C . 42

The backup operation completed, but with a warning message (informational).

Recommended action

No action necessary.

32 . 1C . 43

A component in the backup file is not supported by the current version of firmware and will not be restored (informational).

Recommended action

No action necessary.


32 . 1C . 44

A component in the backup file is not transferable to another printer and will not be restored (informational).

Recommended action

No action necessary.

32 . 1C . 45

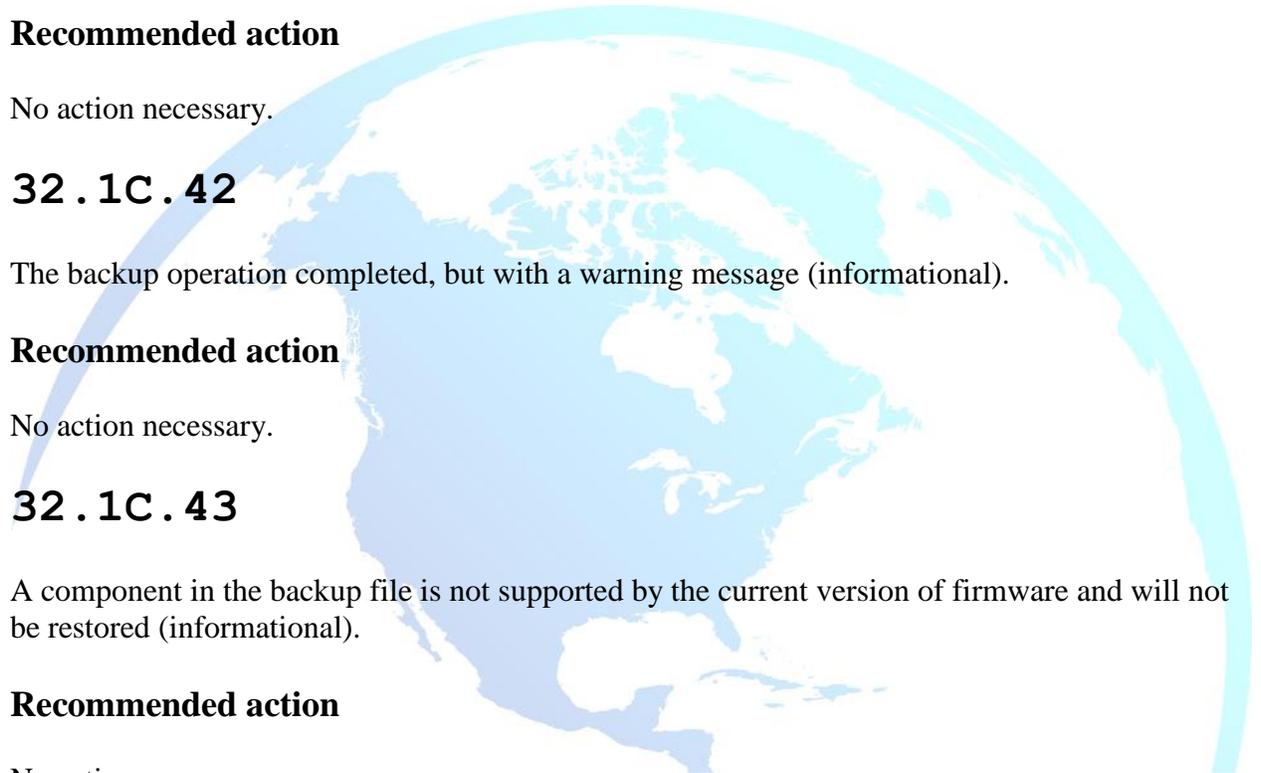

Some data was not included in the backup file (informational).

Recommended action

No action necessary.

32 . 1C . 46

An expected component could not be found and was thus not backed up. Because components should be known on backups, this code is a warning (informational).

Recommended action

No action necessary.

32 . 1C . 47

Some data was not restored from the backup file (informational).

Recommended action

No action necessary.

32 . 1C . 48

The backup job ticket was submitted using an invalid network path.

Recommended action

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exists.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.

32 . 1C . 49

The backup job ticket was submitted with a bad encryption.

Note:

This would only apply to a web services call to perform a backup with a blank PIN

Recommended action

Verify that the encryption personal identification number (PIN) meets the restrictions for the printer.

32 . 1C . 4A

An error occurred when creating the temporary directories used to store the backup files in transition to and from the compressed (ZIP) file.

Recommended action

1. Retry the job.
2. If this does not resolve the issue, turn the printer off then on again and retry the job.
3. If the error persists, perform a `Format Disk` procedure using the `Preboot` menu.

For the steps to perform a `Format Disk` procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

32 . 1C . 56

Reset aborted. Backup/restore in progress (informational).

Recommended action

No action necessary.

32 . 1C . 57

Reset aborted (informational).

Recommended action

No action necessary.

32 . 1C . 58

Unknown reset error (informational).

Recommended action

No action necessary.

32 . 1C . 60



The restore operation completed successfully (informational).

Recommended action

No action necessary.

32 . 1C . 61

The restore operation encountered an error.

Recommended action

Review the printer's event log to see specific details about the failure.

32 . 1C . 62

The restore operation completed, but with a warning message.

Recommended action

Review the error log to see specific details about the failure.

32 . 1C . 68

The restore job ticket was submitted using an invalid network path.

Recommended action

1. Check that a shared folder was provided as part of the network path and not left blank.
2. Check that the server and the shared folder exist.
3. Check that you (or the applicable user) has permission to access the shared folder on the provided server.
4. Check that the path includes the compressed .ZIP file name as part of the path.

32 . 1C . 69

The restore job ticket was submitted with a bad encryption personal identification number (PIN).

Recommended action

Verify the encryption personal identification number (PIN) is the same PIN used to encrypt the backup file.

32.1C.6A

An error occurred when creating the temporary directories used to store the restore files in transition to and from the compressed (ZIP) file.

Recommended action

Retry the job.

32.1C.6D

An unusual error occurred when running the restore operation.

Recommended action

Retry the job.

33.XX.XX error messages

33.* errors

Errors in the 33.* family are related to the printer's storage system or the formatter. The component might have been previously installed in another printer and is therefore locked to that other printer. Or, the component might be incorrect for this printer.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem.

Install the correct component for this printer.

33.01.xx

A save or restore process has occurred.

- **33.01.01** (event code)

A restore process has occurred.

- **33.01.02** (event code)

A save process has occurred.

- **33.01.03** (event code)

Save recover functionality OK after previously being disabled.

Recommended action

No action necessary.

33.02.01 Used board/disk installed

Used board or disk was installed.

An encrypted board or disk with existing data previously locked to a different printer has replaced the original. If you continue, data is permanently lost.

Recommended action

1. If the firmware has just been upgraded, go to: [HP LaserJet Enterprise - A 33.02.01 error received after upgrading the firmware to FutureSmart version 3.4.](#)
2. Update the printer firmware to FutureSmart Bundle Version 3.5 or greater.
3. Press OK on the control panel or remotely by using the new Remote Control Panel feature in the Embedded Web Server. The printer will return to a Ready state.
4. If the error persists, reinstall the used board or disk back into its original printer.
5. To save the data on the board or disk, turn the printer off. Replace the hard disk drive (HDD) with a new board or disk.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: HDD](#)

HDD replacement kit part number: A2W75-67905

Solid state memory kit part number: A2W77-67909

6. To delete the data on the board or disk and continue, touch the OK button.

33.03.02

Data size mismatch occurred. Unable to recover the DCC NVRAM.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, replace the interconnect board (ICB) and return it to HP for evaluation.

M855 part number: RM2-0296-000CN

M880 part number: RM2-5035-000CN

33.03.03 Incompatible formatter installed

This is an EFI BIOS event to prevent booting with the wrong formatter installed.

Recommended action

1. Turn the printer off.
2. Replace the formatter with the correct part for the printer.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

Note:

If the formatter appears to be the correct part number and model for this printer, install a replacement formatter, and then return the formatter in question to HP for evaluation.

For instructions: [Removal and replacement: Formatter](#)

Part number formatter PCA assembly (M855): A2W77-67902

Part number formatter PCA Assembly (M880): A2W75-67903

Part number formatter PCA Assembly (M855 China/India ONLY): A2W77-67903

Part number formatter PCA Assembly (M880 China/India ONLY): A2W75-67902

33.05.0z SureStart errors

A SureStart error has occurred.

The printer detected and recovered from a corrupted version of BIOS.

- **33.05.01** Boot code corrupt (event code)
- **33.05.02** Boot code corrupt (event code)

- **33.05.03** Boot code corrupt (event code)

The newly downloaded firmware failed to cryptographically validate the BIOS code.

- **33.05.04** Security alert
- **33.05.04** Upgrade corrupt (event code)
- **33.05.05** Security alert
- **33.05.05** Boot code corrupt (event code)
- **33.05.06** Security alert
- **33.05.06** Upgrade corrupt (event code)
- **33.05.07** Security alert
- **33.05.07** Upgrade corrupt (event code)
- **33.05.08** Invalid boot attempt (event code)
- **33.05.09** Downgrade attempted (event code)

Recommended action

1. For 33.05.01, 33.05.02, and 33.05.03: No action is necessary.
2. For all other errors: Download a firmware bundle to the printer from the Preboot menu.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

Note:

For more information on SureStart, go to: [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#) (Doc ID: c04863614).

33.05.1x Whitelisting errors

An error occurred with a firmware file digital signature or an error with the certificate used to validate the firmware file certificate.

- **33.05.10** Security alert
- **33.05.10** Firmware verification Error: XX (Event code)
- **33.05.11** Security alert
- **33.05.11** Firmware verification Error: XX (Event code)
- **33.05.12** Security alert
- **33.05.12** Firmware verification Error: XX (Event code)

Recommended action

1. Perform a Format Disk procedure.

[HP Enterprise, HP Managed - Perform a Partial Clean or Format Disk to reset the printer](#)

2. If the device does not reboot to Ready, download a firmware bundle to the device from the Preboot menu.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

Note:

Performing a Format Disk procedure is required before downloading a firmware bundle.

For more information on SureStart, go to [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#). Doc ID c04863614.

33.05.2x Intrusion detection errors

The intrusion detection system has encountered an error.

The intrusion detection memory process determined an unauthorized change in system memory.

- **33.05.21** Security alert
- **33.05.21** Potential intrusion (Event code)

The intrusion detection memory process heartbeat was not detected.

- **33.05.22** Security alert
- **33.05.22** Cannot scan for potential intrusions (Event code)

The intrusion detection memory process did not initialize.

- **33.05.23** Security alert
- **33.05.23** Intrusion detection not initialized (Event code)
- **33.05.24** Intrusion detection initialization error (Event code)

Recommended action

Turn the printer off then on.

Note:

Selecting Continue from the Preboot menu will not resolve the error. The printer must be turn off then on to clear the error allowing the device to reboot to Ready.

Note:

With firmware version 3.7 the error “A disk or boot error has occurred. Clear Error. Press Any Key” is displayed when selecting Continue from the Preboot menu after encountering a 33.05.2X error. This message should be ignored

For more information on SureStart, go to [HP SureStart Whitelisting and Intrusion Detection Troubleshooting Manual](#). Doc ID c04863614.

40.XX.YZ error messages

40.* errors

Errors in the 40.* family are related to input/output accessories, such as USB storage devices, Jetdirect cards, or EIO cards or on-board network functions.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Touch the OK button to clear the error.
2. Remove and then reinstall the accessory.

40.00.01 USB I/O buffer overflow To continue, touch "OK"

The USB buffer has overflowed.

Recommended action

1. Touch the OK button to print the transferred data (some data might be lost).
2. Check the host configuration.

40.00.02 Embedded I/O buffer overflow To continue, touch "OK"

The product has experienced a JetDirect buffer overflow.

Recommended action

1. Touch the OK button to print the transferred data (some data might be lost).
2. Check the host configuration.

40.00.03 EIO <x> buffer overflow To continue, touch "OK"

Too much data was sent to the EIO card in the specified slot (x). An incorrect communications protocol might be in use.

Recommended action

Touch the OK button to print the transferred data (some data might be lost).

40.00.04 EIO <x> bad transmission To continue, touch "OK"

The connection between the product and the USB device has been broken.

Recommended action

1. Touch the OK button to clear the error message and continue printing.
2. Remove, and then reinstall the USB device.

40.00.05 Embedded I/O bad transmission To continue, touch "OK"

The USB device has been removed.

Recommended action

1. Touch the OK button to clear the error message (data will be lost).
2. Install the USB device.

40.08.0x USB storage accessory removed

The USB storage accessory has been removed.

x = 0 or 1; information code.

Secure file erase is enabled.

Recommended action

No action necessary.

40.0x.05 USB storage accessory removed

The USB storage accessory was removed.

x = 1, 2, 3, 5, or 6; information code.

Recommended action

No action necessary.

40.80.04 Failed to read NVRAM

Cannot read the contract-requested value from NVRAM. Either the value was not populated or NVRAM was unreadable.

Recommended action

Turn printer off, and then on.

41.WX.YZ error messages

41.01.YZ

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light paper 1, 2, or 3 mode
- Y = 4: Heavy paper 1
- Y = 5: Heavy paper 2
- Y = 6: Heavy paper 3
- Y = 7: Glossy paper 1
- Y = 8: Glossy paper 2
- Y = 9: Glossy paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode

- Z = 0: From unknown tray
- Z = 1: From Tray 1
- Z = 2: From Tray 2
- Z = 3: From Tray 3
- Z = 4: From Tray 4

- Z = 5: From Tray 5
- Z = 6: From Tray 6
- Z = 7: From Tray 7
- Z = 8: From Tray 8
- Z = 9: From Tray 9
- Z = D: From duplex

Recommended action

1. Touch OK to clear the error.
2. If the error is not cleared, turn the printer off, and then on.
3. If the error persists, check and reseat the wire harness from the laser/scanner to the DC controller.
4. If the error persists, replace the laser scanner with the malfunction.

For instructions: See the Repair Service Manual for this product.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-5176-000CN

5. If the error persists, replace the DC controller.

For instructions: See the Repair Service Manual for this product.

M855 part number: RM2-7005-000CN

M880 part number: RM2-7006-000CN

41 . 02 . 00

A beam detected a misprint error.

41.02.05 – Black station

41.02.06 – Cyan station

41.02.07 – Magenta station

41.02.08 – Yellow station

Recommended action

1. To clear the error message, touch OK.
2. If the error persists, turn the printer off, and then on.

3. If the error persists, check the wire harness from the laser scanner to the DC controller.
4. If the error persists, replace the laser scanner with the malfunction.

For instructions: See the Repair Service Manual for this product.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-5176-000CN

41.03.YZ Unexpected size in tray <X> or Unexpected size in envelope feeder

The printer detected a different paper size than expected.

Y = Type, Z = Tray

- Y = 0 Size mismatch. Detected paper is longer or shorter than expected.
- Y = A Size mismatch. Detected paper too long.
- Y = B Size mismatch. Detected paper too short.
- Y = C Size mismatch. Inter-page gap error.

- Z = D Source is the duplexer.
- Z = E Source is the envelope feeder.
- Z = 1 Source is tray 1.
- Z = 2 Source is tray 2.
- Z = 3 Source is tray 3.
- Z = 4 Source is tray 4.
- Z = 5 Source is tray 5.

Recommended action (trays)

1. Touch OK to use another tray.
2. Ensure that the tray is loaded with the correct paper size and that the sliding paper guides are adjusted correctly.
3. Use the Diagnostic Tests menu to test the cassette paper switch.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Tray/Bin Manual Sensor Test
4. If the sensor test fails, replace the lifter drive assembly.


Tray 2 part number: RM1-3222-000CN

1x550 part number: RK2-1331-000CN

3x550 part number: RK2-1331-000CN

3,500/HCI part number: RM1-8879-000CN

5. If the sensor test passes, and the error persists, remove and reinstall the ITB unit.
6. Check all connections from the DC controller to the lifter drive assembly.
7. Reconnect the connectors for the paper sensor, intermediate-transfer belt, and the DC controller PCA.
8. Check the paper width sensors in the secondary transfer unit.
 - a. Open the right door.
 - b. Lower the green handle to open the cover.

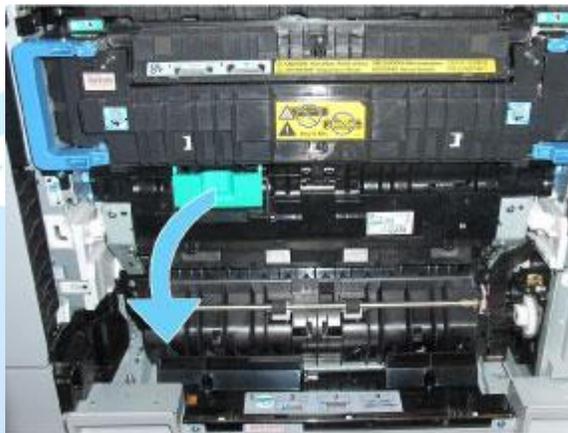


Green handle

- c. Use a small flat-blade screwdriver to release the two retaining tabs.




Release the retaining tabs

- d. Use a small flat-blade screwdriver to release the third retaining tab under the secondary transfer assembly.
 - e. Check the two paper width sensors for correct functionality and that they are seated correctly.

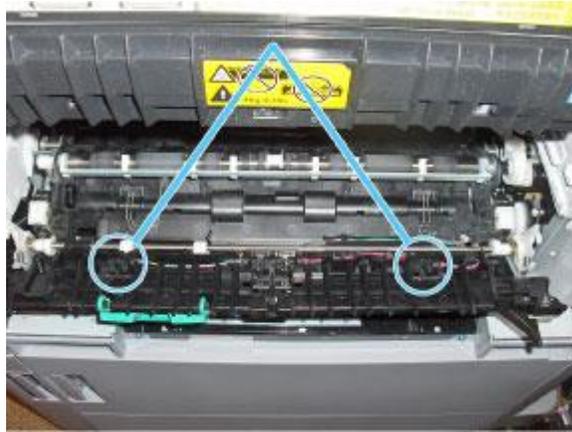

Sensor location

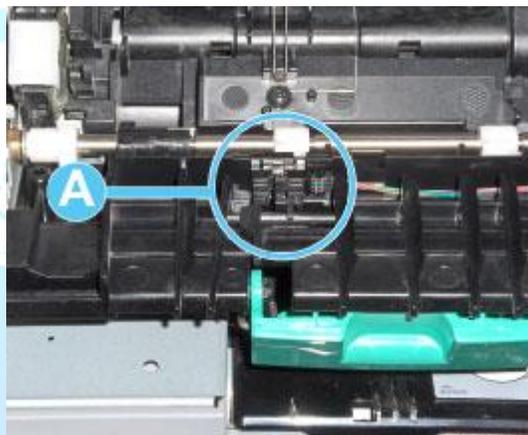


Width sensor seated correctly



Width sensor not seated correctly

- f. When replacing the sensor cover, make sure that the tabs are placed correctly before locking the retaining tabs.

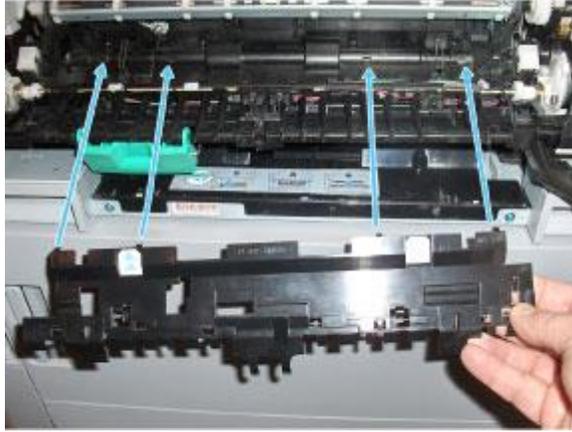

Reinstall the cover

9. If the paper width sensors are not functioning correctly, check the event log for the 10.22.70 code and replace the secondary transfer unit.

Note:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement. At minimum, the customer must order and pay for a replacement intermediate transfer belt (ITB). However, HP recommends that the customer order and install a maintenance kit at this time.
- If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

Part number: RY7-5213-000CN (includes the ITB, transfer roller and tray rollers)

10. Reconnect the connectors for the paper sensor, intermediate-transfer belt, and the DC controller PCA.
11. If the error persists, check the event log for the 10.22.70 code and replace the ITB unit.

Note:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement. At minimum, the customer must order and pay for a replacement intermediate transfer belt (ITB). However, HP recommends that the customer order and install a maintenance kit at this time.
- If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

Part number: RY7-5211-000CN

Recommended action (envelope feeder)

1. Touch OK to use another tray.
2. Ensure that the tray is loaded with the correct paper size and that the paper guides are adjusted correctly.
3. Use the Diagnostic Tests menu to test the cassette paper switch.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Tray/Bin Manual Sensor Test
4. If the sensor test passes, and the error persists, remove and reinstall the ITB unit, and then check all connectors between the DC controller and the lifter drive assembly.
5. If the sensor test fails, or if the error persists, replace the lifter drive assembly.

Tray 2 part number: RM1-3222-000CN

1x550 part number: RK2-1331-000CN

3x550 part number: RK2-1331-000CN

3,500/HCI part number: RM1-8879-000CN

6. Reconnect the connectors for the paper sensor, intermediate-transfer belt, and the DC controller PCA.
7. If the error persists, replace the following parts:

T2 assembly part number: RM2-6856-000CN

For instructions: [Removal and replacement: ITB Transfer roller](#)

ITB unit part number: RY7-5211-000CN

41.03.FZ Unknown Misprint Error

This is a general misprint error. Either paper is loaded off-center with the side guides in the tray, or a paper width sensor failure occurred from an unknown tray.

One of the following errors might occur:

- 41.03.F0
- 41.03.F1

- 41.03.F2
- 41.03.F3
- 41.03.F4
- 41.03.F5
- 41.03.FD

Recommended action

1. Reload the paper in the tray, and ensure that the tray sliding paper guides are adjusted correctly.
2. Try the print job again, and observe the mechanism to see if it is functioning correctly.
3. If the mechanism is broken, replace the paper tray.

Tray 2 part number: RM2-5014-000CN

1x550 tray 3 part number: RM2-0273-000CN

3x550 tray 3-4 part number: RM2-0273-000CN

3x550 tray 5 part number: RM2-0276-000CN

4. If the error persists, print a configuration page and note the paper size for the tray in question.
5. If the size is not reported correctly, use the Diagnostic Tests on the control panel to test the tray size sensor.
6. If the sensor test passes, replace the paper tray.

Tray 2 part number: RM2-5014-000CN

1x550 tray 3 part number: RM2-0273-000CN

3x550 tray 3-4 part number: RM2-0273-000CN

3x550 tray 5 part number: RM2-0276-000CN

7. If the sensor test fails, check the cable connections between the tray size sensor and the DC controller.
8. If the cable connections are plugged in correctly and the cables are not compromised, replace the component that contains the tray size sensing switches.

Tray 2 part number: RM1-3222-000CN

Trays 3-5 (1x550, 3x550) part number: RM1-3531-000CN

Trays 3-4 (3,500/HCI) part number: RM1-8869-000CN

41.03.DX, 41.EX Unexpected size in tray <X>

The printer detected a different paper size than expected.

Y = Type, Z = Tray

- Y = 0 Size mismatch. Detected paper is longer or shorter than expected.
- Y = A Size mismatch. Detected paper too long.
- Y = B Size mismatch. Detected paper too short.
- Y = C Size mismatch. Inter-page gap error.

- Z = D Source is the duplexer.
- Z = E Source is the envelope feeder.
- Z = 1 Source is tray 1.
- Z = 2 Source is tray 2.
- Z = 3 Source is tray 3.
- Z = 4 Source is tray 4.
- Z = 5 Source is tray 5.

Recommended action

1. Touch OK to use another tray.
2. Ensure that the tray is loaded with the correct paper size and that the sliding paper guides are adjusted correctly.
3. Use the Diagnostic Tests menu to test the cassette paper switch.
 - a. Open the following menus:
 - Administration
 - Troubleshooting
 - Diagnostic Tests
 - Tray/Bin Manual Sensor Test
4. If the sensor test fails, check all connectors from the DC controller to the lifter drive assembly, and then test again.
5. If the sensor test passes, and the error persists, remove and reinstall the ITB unit.
6. Reconnect the connectors for the paper sensor, intermediate-transfer belt, and the DC controller PCA, and then test again.
7. If the error persists and the connectors are not damaged, replace the lifter drive assembly.

Tray 2 part number: RM1-3222-000CN


1x550 part number: RK2-1331-000CN

3x550 part number: RK2-1331-000CN

3,500/HCI part number: RM1-8879-000CN

8. If the error persists, check the paper width sensors in the secondary transfer unit.

- a. Open the right door.
- b. Lower the green handle to open the cover.

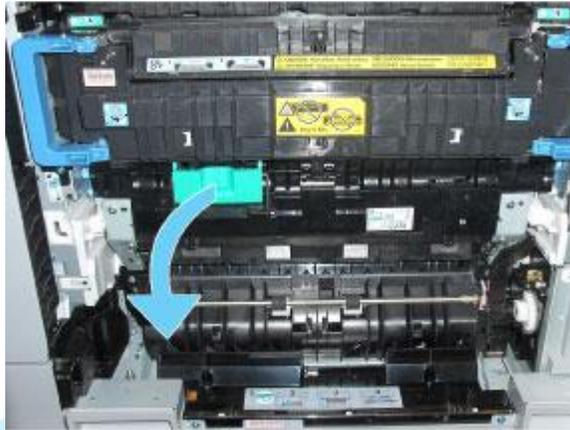


Green handle

- c. Use a small flat-blade screwdriver to release the two retaining tabs.




Remove the cover

- d. Use a small flat-blade screwdriver to release the third retaining tab under the secondary transfer assembly.
- e. Check the two paper width sensors for correct functionality and make sure that they are seated correctly.

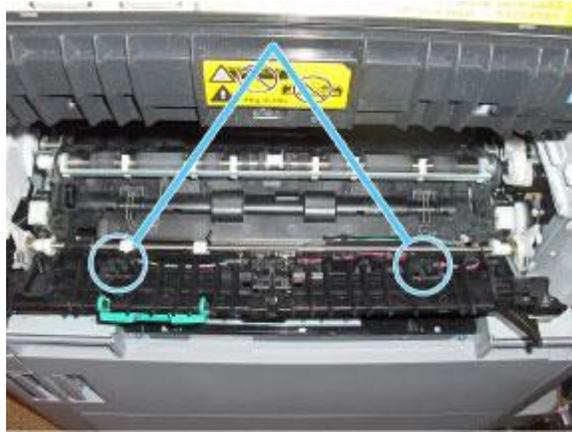

Sensor location

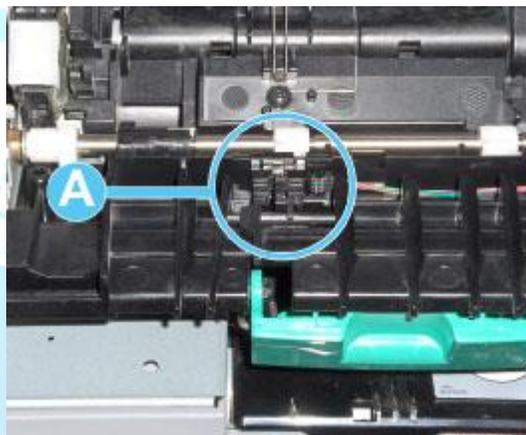

Width sensor seated correctly



Width sensor not seated correctly

- f. When replacing the sensor cover, make sure that the tabs are positioned correctly before locking the retaining tabs.



Reinstall the cover

9. If the paper width sensors are not functioning correctly, check the event log for the 10.22.70 code and replace the secondary transfer unit.
 - If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement. HP recommends that the customer order and install a maintenance kit at this time.
 - If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

Part number: RY7-5213-000CN

10. Important:
11. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.
12. Reconnect the connectors for the paper sensor, intermediate-transfer belt, and the DC controller PCA.
13. If the error persists, check the event log for the 10.22.70 code and replace the ITB unit.
 - If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement. HP recommends that the customer order and install a maintenance kit at this time.
 - If an active low warning is not listed, replace the part under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

Part number: RY7-5211-000CN

14. Important:
15. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

41.04.YZ Printer Error

An unknown misprint error occurred on the printer.

Y = Type, Z = Tray

- Y = 0: Photo paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light paper 1, 2, or 3 mode
- Y = 4: Heavy paper 1
- Y = 5: Heavy paper 2
- Y = 6: Heavy paper 3
- Y = 7: Glossy paper 1
- Y = 8: Glossy paper 2
- Y = 9: Glossy paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode

- Z = D Source is the duplexer.
- Z = 0 Source is the envelope feeder.
- Z = 1 Source is tray 1.
- Z = 2 Source is tray 2.
- Z = 3 Source is tray 3.
- Z = 4 Source is tray 4.
- Z = 5 Source is tray 5.

Recommended action

1. Touch OK to use another tray.
2. If the error does not clear, turn the printer off, and then on.
3. Swap out or reseal each toner cartridge to test it.
4. Check the toner cartridges before replacing any other parts.
 - Ensure that the cartridges are HP genuine supplies.
 - Verify that the high-voltage contacts are clean and not damaged.
5. Reseat the connections to the laser scanner and the DC controller.
6. If the error persists, replace the laser scanner with the malfunction.

For instructions: See the Repair Service Manual for this product.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-5176-000CN

7. If the error persists, replace the DC controller.

For instructions: See the Repair Service Manual for this product.

M855 part number: RM2-7005-000CN

M880 part number: RM2-7006-000CN

41.05.YZ Unexpected type in tray <X>

Tray X is loaded with a paper type (transparencies, envelopes, etc.) that is different than what the tray is configured to use.

The printer is able detect the type of paper in the paper path, and it adjusts the print mode accordingly.

The printer uses two types of paper sensors:

- **Reflection:** Detects the glossiness of the paper
- **Transmission:** Detects the thickness of the paper

Y = Expected type, Z = Detected type

- Y = 0: Photo paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light paper 1, 2, or 3 mode
- Y = 4: Heavy paper 1
- Y = 5: Heavy paper 2
- Y = 6: Heavy paper 3
- Y = 7: Glossy paper 1
- Y = 8: Glossy paper 2
- Y = 9: Glossy paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode

- Z = 0: Photo paper (1, 2, or 3)
- Z = 1: Auto Sense (Normal)
- Z = 2: Normal (typed not from Auto Sense)
- Z = 3: Light paper 1, 2, or 3 mode
- Z = 4: Heavy paper 1
- Z = 5: Heavy paper 2
- Z = 6: Heavy paper 3
- Z = 7: Glossy paper 1

- Z = 8: Glossy paper 2
- Z = 9: Glossy paper 3
- Z = A: Glossy film
- Z = B: OHT
- Z = C: Label
- Z = D: Envelope 1, 2, or 3 mode
- Z = E: Rough
- Z = F: Other mode

Recommended action

1. Load the tray with the size and type of paper indicated, or use another tray if available.
2. If this message displays and the tray is loaded with the correct paper type, check the print driver settings to make sure they match the tray type settings.
3. Check all application and printer settings to make sure that the Type setting is correct.
4. Remove and reinstall the ITB unit.
5. Reconnect the connectors for the paper sensor, intermediate-transfer belt, and the DC controller PCA.
6. Replace the ITB unit.

For instructions: [Removal and replacement: ITB Transfer roller](#)

Part number: RY7-5211-000CN

41.06.YZ Error To continue, touch "OK"

ITB top detection error occurred.

Y= paper Type / Z= Tray

- Y = 0: Photo paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light paper 1, 2, or 3 mode
- Y = 4: Heavy paper 1
- Y = 5: Heavy paper 2
- Y = 6: Heavy paper 3
- Y = 7: Glossy paper 1
- Y = 8: Glossy paper 2
- Y = 9: Glossy paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode

- Z = 1 Source is Tray 1.
- Z = 2 Source is tray 2.
- Z = 3 Source is tray 3.
- Z = 4 Source is tray 4.
- Z = 5 Source is tray 5.
- Z = D Source is the duplexer.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, remove and reinstall the ITB.
3. Reconnect the connectors for the paper sensor, intermediate-transfer belt, and the DC controller PCA
4. Replace the ITB unit.

For instructions: [Removal and replacement: ITB Transfer roller](#)

Part number: RY7-5211-000CN

41.07.YZ Error To continue, touch "OK"

A paper transportation error has occurred. Optional input source delay.

Y= paper Type / Z= Tray

- Y = 0: Photo paper (1, 2, or 3)
 - Y = 1: Auto Sense (Normal)
 - Y = 2: Normal (typed not from Auto Sense)
 - Y = 3: Light paper 1, 2, or 3 mode
 - Y = 4: Heavy paper 1
 - Y = 5: Heavy paper 2
 - Y = 6: Heavy paper 3
 - Y = 7: Glossy paper 1
 - Y = 8: Glossy paper 2
 - Y = 9: Glossy paper 3
 - Y = A: Glossy film
 - Y = B: OHT
 - Y = C: Label
 - Y = D: Envelope 1, 2, or 3 mode
 - Y = E: Rough
 - Y = F: Other mode
-
- Z = 1 Source is tray 1.
 - Z = 2 Source is tray 2.
 - Z = 3 Source is tray 3.
 - Z = 4 Source is tray 4.

- Z = 5 Source is tray 5.
- Z = D Source is the duplexer.


Recommended action

1. Turn the printer off, and then on.
2. Verify that the paper being used is high quality and meets the specifications for the printer.
3. If the error persists, open the right side door and use the green handle to open the jam access cover.
4. Verify that the spring located on the right-hand side of the deskew shutter is in the correct position.




Spring positioned correctly

The arrow points to the spring clip positioned correctly in the deskew shutter

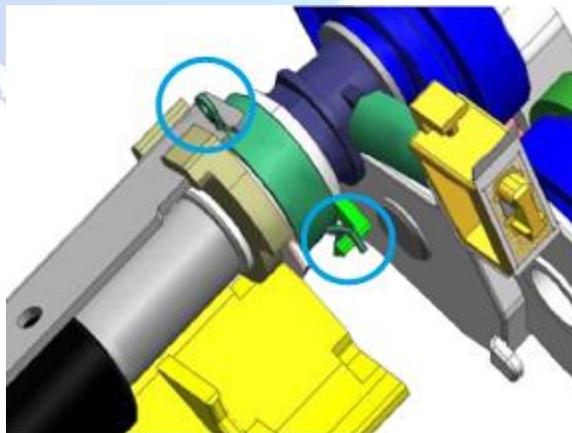

Spring installed correctly


The circles show the correct spring position. If the spring is out of position, try to put it into place, and then check the results.

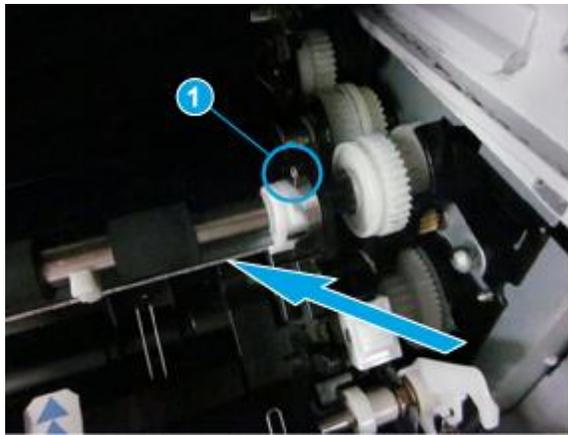

Spring out of position

Call-out 1 - Spring is not clipped into the deskew shutter. The arrow points to the deskew shutter in lowered position.


- a. Rotate the deskew shutter up.

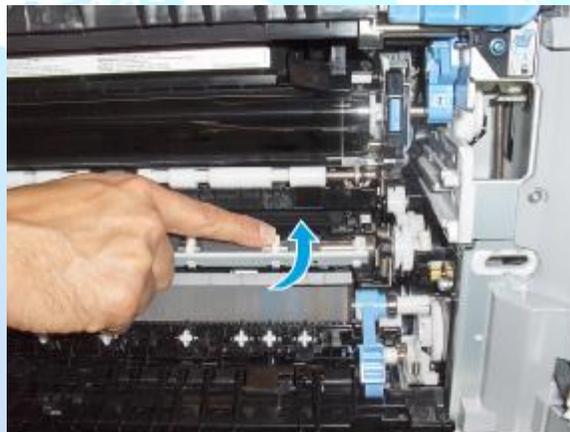

Rotate deskew shutter


- b. While holding the shutter up in place, rotate the spring into position and place it into cutout in the deskew shutter.

Move the spring into the correct position

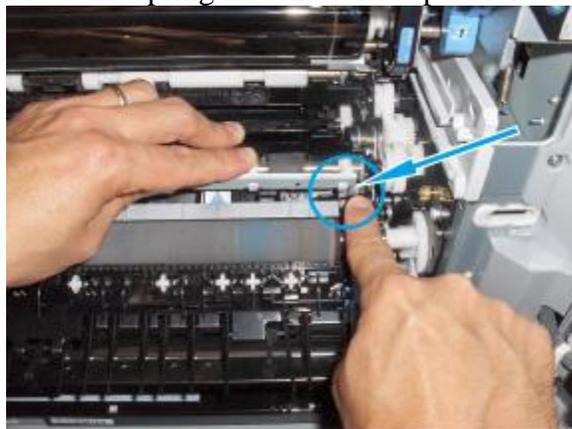

- c. After placing the spring into the correct position, check that the deskew shutter springs back up into position after being pulled down.

Pull down the deskew shutter to check the spring operation

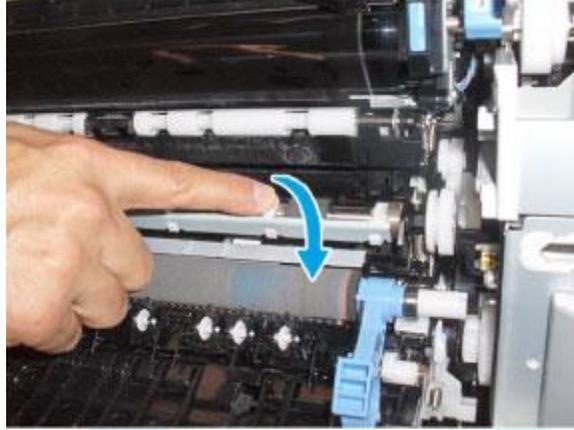

5. If the spring is damaged, then replace the secondary transfer unit assembly.

Part number: RM2-6856-000CN

6. If the issue only occurs while duplexing, replace the duplexing feed assembly.

M855 part number: A2W77-67913

M880 part number: A2W75-67911

7. After replacing the duplexing feed assembly make sure you reset the duplex roller.

Installing a replacement duplexing feed assembly: If a replacement duplexing feed assembly is installed, do the following:

- a. From the Home screen on the control panel, scroll to and touch the Device Maintenance button.
 - b. Open the Service menu.
 - c. On the sign-in screen, select the Service Access Code option from the drop-down list.
 - d. Enter one of the following service access codes:
 - **M855:** 11085513
 - **M880:** 11088013
 - e. Reset the following value:
 - New Duplex Roller; set to Yes
8. If the error persists, elevate the issue using the Standard Support Process.

41.WX.YZ Error To continue, touch "OK"

A printer error has occurred.

XX = error type

Y = fuser mode

Z = input tray

- XX = 02 Beam detect misprint
- XX = 08 paper transportation error
- XX = 09 Sub thermistor abnormally high
- XX = 10 Pickup failure.
- XX = 11 Illegal Duplex.
- XX = 18 Scan line inclination adjustment
- XX = 20 Image drum HV

- Y = 0: Photo paper (1, 2, or 3)
- Y = 1: Auto Sense (Normal)
- Y = 2: Normal (typed not from Auto Sense)
- Y = 3: Light paper 1, 2, or 3 mode
- Y = 4: Heavy paper 1
- Y = 5: Heavy paper 2
- Y = 6: Heavy paper 3
- Y = 7: Glossy paper 1
- Y = 8: Glossy paper 2
- Y = 9: Glossy paper 3
- Y = A: Glossy film
- Y = B: OHT
- Y = C: Label
- Y = D: Envelope 1, 2, or 3 mode
- Y = E: Rough
- Y = F: Other mode


- Z = 0 Envelope feeder
- Z = 1 Tray 1
- Z = 2 Tray 2
- Z = 3 Tray 3
- Z = 4 Tray 4
- Z = 5 Tray 5
- Z = 6 Tray 6
- D Duplexer

Recommended action

1. Select OK to clear the message.
2. If the message displays again, turn the printer off, and then on.

3. Check the event log for 54.XX errors that might indicate the media sensor is not calibrating correctly. If the error is present, make sure the CPR sensor is not contaminated with toner or paper dust.
4. Clean the sensor with compressed air and a soft brush.

Cleaning locations

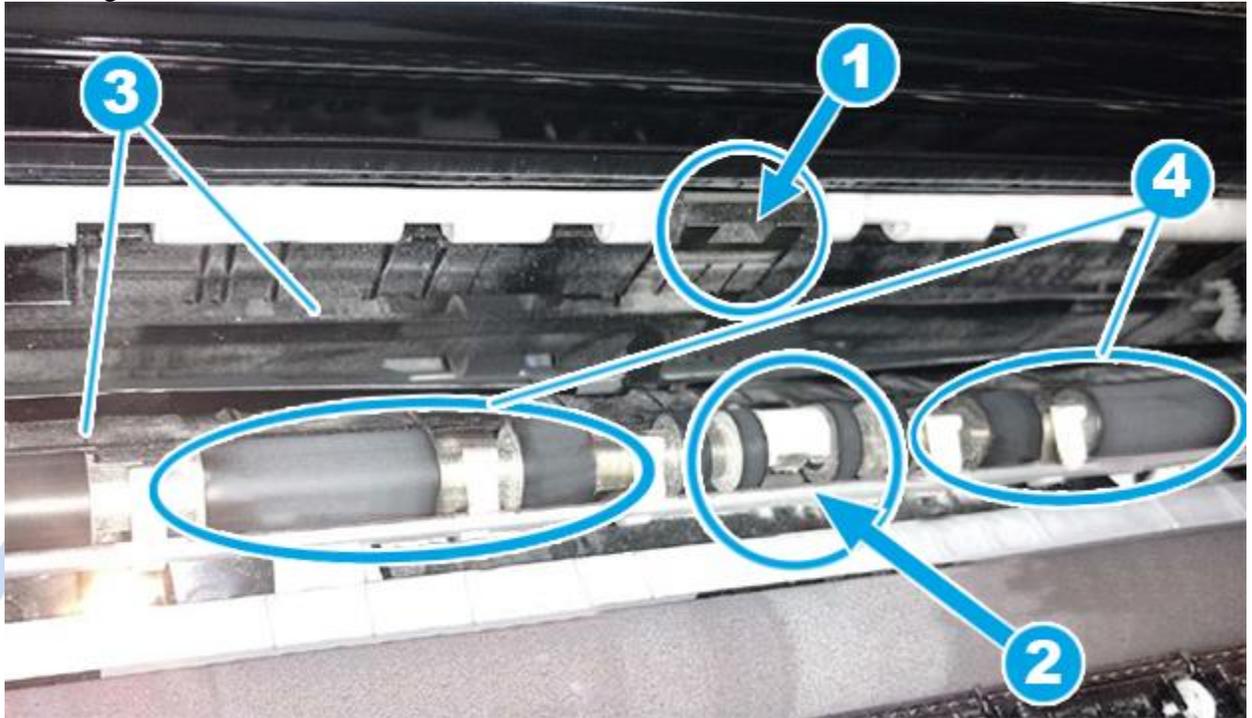

Callout 1: SR2501

Callout 2: Location of media sensor (Note the dust on the shaft).

Callout 3: Excessive dust in paper path.

Callout 4: Registration rollers are not clean.

View of a completely clean registration assembly area.



5. If the error persists, elevate the case using the Standard Support Process.

42.WX.YY error messages

42.* errors

Errors in the 42.* family indicate an internal system failure has occurred.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, perform a `Format Disk` procedure using the `Preboot` menu.

For the steps to perform a Format Disk procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

42 . B0 . 01

UI or EWS requests a string ID that does not exist in the localization database

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on. Retry the job.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents, and onsite technicians

1. Turn the printer off, and then on. Retry the print job.
2. If the error persists, clear the firmware image from the active partition by using the Partial Clean item in the Preboot menu.

Note:

The Partial Clean option erases all data from the partitions, except for the firmware repository where a backup copy of the firmware file is stored. This allows the disk drive to be reformatted without having to download a firmware upgrade file to return the printer to a bootable state. Characteristics of a Partial Clean

- Customer-defined settings, third-party solutions, firmware files, and the operating system are deleted
- Rebooting the printer restores the firmware files from the Repository location, but does not restore any customer-defined settings.
- For previous HP products, a Hard Disk Initialization is similar to executing the Partial Clean function for this printer

CAUTION:

HP recommends backing-up printer configuration data before executing a Partial Clean to retain customer-defined settings (if needed). See the Backup/Restore item in the Device Maintenance menu.

3. How to execute a Partial Clean from a touchscreen control panel.
 - a. Touch in the middle of the control panel display when you see the 1/8 under the HP logo.



Open the Pre-Boot menu

- b. Use the down arrow button to highlight the +3:Administrator item, and then touch the OK button.
- c. Use the down arrow button to highlight Partial Clean and then touch the OK button.
- d. Touch the OK button again.
- e. Touch the Home button to highlight Continue, and then touch the OK button.

Note:

The printer initializes.

44.WX.XX error messages (MFP only)

44.* errors

Errors in the 44.* family are related to the digital send functionality: fax, email, send to SharePoint, or save to folder.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. In many cases, the error will automatically clear, and you can try the job again.
2. Verify the digital send feature has been correctly configured at the control panel and with the HP Embedded Web Server (EWS).

Note:

To access the EWS, open a Web browser, and in the address line, enter the printer IP address.

3. Turn the printer off, and then on. Retry the job.
4. For fax errors, verify the fax card is correctly installed on the formatter.
5. For SharePoint or save-to-folder errors, verify the permissions are set correctly for access to the SharePoint or network folder.

6. For email errors, verify connectivity to the network, and verify the SMTP gateway is configured correctly. Also verify if there is a size limit on email attachments.
7. If the error persists, reset the printer to factory settings, and then upgrade the firmware to the latest version.

Go to [HP FutureSmart - Latest Firmware Versions](#).

44.01.xx Error Event log message

A digital send error has occurred.

Recommended action

1. No action necessary. This error message should automatically clear.
2. Try to send the job again.
3. If the error does not clear or it returns:
 - a. Use optimal resolution and image quality settings.
 - b. Wait until all the digital send jobs have been processed.
 - c. Turn the printer off, and then on. Retry the job.
 - d. Verify if there is an attachment limit on the email.
 - e. Verify network connectivity, SMTP gateways, access to folder share.

44.03.xx Error Event log message

A digital send error has occurred.

Recommended action for customers

Try to send the job again.

Recommended action

1. Use optimal resolution and image quality settings.
2. Wait until all the digital send jobs have been processed.
3. Turn the printer off, and then on and retry the job.
4. Verify if there is an attachment limit on the email.
5. Verify network connectivity, SMTP gateways, access to folder share.

44.10.xx Error Event log message (*Multifunction product only.*)

A send to email error has occurred.

Recommended action

1. Try to send the job again.
2. Check the digital send configuration.

For more information, go to [HP LaserJet Enterprise MFP - Set up Scan to Email](#).

44.16.01 Error Event log message (*Multifunction product only.*)

A digital send error has occurred while trying to create file type.

XX =

- 01 – RTF File
- 03 – CSV File
- 04 – HTML File
- 05 – XML File
- 06 – XPS File
- 07 – PDF File

Recommended action

1. Try to send the job again.
2. Check the digital send configuration.

44.16.02 Error Event log message (*Multifunction product only.*)

The destination URL was found to be invalid or unreachable.

Recommended action

1. If this is the first time the error has occurred, cancel and then restart the job.
2. If the error persists, turn the product off and then on and retry the job.
3. If the error still persists, reset to factory settings. Upgrade to the current firmware version.

44.16.04 Error Event log message (*Multifunction product only.*)

Credentials associated with the SharePoint destination were found to be invalid or missing.

Recommended action

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists:
 - Check network connection settings.
 - Verify access to the SharePoint site.

44.16.05 Error Event log message (*Multifunction product only.*)

Credentials do not have write access to the SharePoint destination.

Recommended action

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists:
 - Check network connection settings.
 - Verify access to the SharePoint site.

44.16.06 Error Event log message (*Multifunction product only.*)

Upload of image file failed. Reason unknown.

Recommended action

1. If this is the first time the error has occurred, verify settings in job configuration and then restart the job.
2. If the error persists, turn the product off then on again and retry the job.
3. If the error still persists, reset to factory settings. Upgrade to the current firmware version.

44.16.07 Error Event log message (*Multifunction product only.*)

Upload of image file failed.

The file exceeded the maximum form submission length on the Web server.

Recommended action

1. If this is the first time the error has occurred, send fewer pages in the job, lower the DPI of the scanned pages, or select a file type that splits pages into separate files (for example, jpeg).
2. If the error occurs repeatedly, contact the SharePoint site administrator to increase the Web server's maximum form submission length.

44.16.08 Error Event log message (*Multifunction product only.*)

Upload of image file failed. The SharePoint site storage quota limit was exceeded.

Recommended action

1. If this is the first time the error has occurred, make space on the SharePoint site by deleting some files, and then retry the job.
2. If the error occurs repeatedly, contact the SharePoint site administrator to increase the storage quota limit.

44.16.09 Error Event log message (*Multifunction product only.*)

Upload of image file failed. A folder or filename length is too long.

Recommended action

1. If this is the first time the error has occurred, check the destination URL and filename in the SharePoint job configuration to verify no folder or filename exceeds the maximum of 128 characters.
2. If the error occurs repeatedly, try sending to a different folder on the SharePoint site or changing the filename (which could include prefix or suffix).

44.16.0A Error Event log message (*Multifunction product only.*)

Upload of the image file failed.

The image file already exists on the server and is checked out for editing by another user.

Recommended action

1. If this is the first time the error has occurred, verify that the filename used by the job is not checked out on the SharePoint site.
2. If the error persists, use a different filename for the job.

44.16.0B Error Event log message (*Multifunction product only.*)

Upload of the image file failed.

The image file already exists on the server and the job was set to not overwrite files.

Recommended action

1. If this is the first time the error has occurred, set the job to overwrite existing files.
2. If the error persists, use a different filename for the job.

44.16.0D Error Event log message (*Multifunction product only.*)

Encountered an unexpected processing error while transferring attachments to the destination SharePoint.

Recommended action

1. If this is the first time the error has occurred, verify settings in job configuration and restart the job.
2. If the error persists, turn the product off, and then on and retry the job.
3. If the error persists, reset to factory settings. Upgrade to the current firmware version.

44.16.0E Error Event log message (*Multifunction product only.*)

The attachment filename already exists at the destination, and the fail-on-filename-collisions flag was set. This file will not be sent.

Recommended action

1. If this is the first time the error has occurred, use a different filename or verify that the filename is not already in use.
2. If the error persists, use a unique filename or disable the fail-on-filename-collisions flag.

44.16.0F Error Event log message (*Multifunction product only.*)

Not enough memory to process the current SharePoint Job.

Recommended action

1. If this is the first time the error has occurred, cancel and/or restart the job, breaking it up into small jobs.
2. Repeat this process if the error persists until job goes through.

44.16.10 Error Event log message (*Multifunction product only.*)

The SharePoint server is using an invalid certificate.

Recommended action

1. If this is the first time the error has occurred, send the SharePoint job to a non-secure address, or send the job to a SharePoint server that has a valid certificate.
2. If the error occurs repeatedly, send the job to a different, trusted SharePoint server.

44.16.FF Error Event log message (*Multifunction product only.*)

An unexpected error occurred in the SharePoint resource device code.

Recommended action

1. If this is the first time the error has occurred, verify settings in job configuration and restart the job.
2. If error persists, turn the product off, and then on and retry the job.
3. If the error persists, reset to factory settings. Upgrade to the current firmware version.

44.34.xx Error Event log message

A fax error has occurred.

Recommended action

1. Try to send the job again.
2. Check the fax settings to make sure they are set to the proper settings for the environment.
3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems.](#)

44.34.03 Fax Modem Failure

A digital send error occurred. Fax result modem fail.

Recommended action

1. Turn the printer off.
2. Verify that the fax card is installed correctly on the formatter.
3. Verify that the fax card is aligned with the slot on the formatter chassis and is firmly seated against the formatter board.
4. Turn the printer on.
5. If the error persists, replace the fax kit.

Part number: A2W77-67910

44.34.E5 Fax Modem Failure

A fax error has occurred.

Recommended action

1. Turn the printer off.
2. Verify that the fax card is installed correctly on the formatter.
3. Verify that the fax card is aligned with the slot on the formatter chassis and is firmly seated against the formatter board.
4. If the error persists, download and reinstall the firmware.
5. If the error persists, perform a `Format Disk` procedure using the Preboot menu.
 - a. Turn the printer off, and then on.
 - b. The HP logo displays on the printer control panel. When a "1/8" with an underscore displays below the HP logo, touch the logo to open the Pre-boot menu.
 - c. Use the arrow buttons on the touchscreen to navigate the pre-boot menu.
 - d. Use the down arrow to highlight `Format Disk`, and then touch the OK button.
 - e. Touch the OK button again.
 - f. Touch the Back button to highlight Continue, and then touch the OK button.

The printer will continue to boot to Ready state.

6. If the error persists, replace the fax kit.

Part number: A2W77-67910

44.90.xx, 44.91.xx, 44.92.xx Error Event log message

A fax error has occurred.

Recommended action

1. Try to send the job again.
2. Check the fax settings to make sure they are set to the proper settings for the environment.
3. If the issue persists, for additional fax troubleshooting information go to [HP LaserJet Enterprise MFP, HP PageWide Enterprise MFP - Checklist for solving fax problems.](#)

44.A0.YZ Error Event log message

The validation certificate is missing for digital send security (Login/LDAP/SSL).

Recommended action

1. Turn the printer off, and then on, and try again to login or send the job.
2. Ensure all digital sending devices are operational and configured correctly.

Note:

One or more control panel icons for digital send features might be grayed-out and marked with an exclamation point (!).

3. Contact the system administrator to check the domain controller certificate, and ensure that a valid SSL exists in the location on the LDAP server to which the SSL extension is pointing in the certificate.

46.WX.YZ error messages

46.* error messages

Errors in the 46.* family occur when the printer is trying to perform an action that it is not able to complete.

- No network connectivity
- A problem with the file being printed, with the software application sending the job, or with the print driver

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Verify the printer is connected to the network, look at the network port connection on the back of the printer, and verify that the amber activity light flashes indicating network

traffic, and the green link-status light is continuously lit indicating a network link. If the problem continues, try a different network cable or port on the hub and check network configuration settings such as the printer's IP address.

3. Send a different file from the same software application to see if the error is specific to the original file. Try sending a job from a different software application to see if the error is specific to the application. Verify the computer has the correct print driver installed.
4. Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

5. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Verify the printer is connected to the network. If it is not, use a different network cable, and check the configuration settings.
3. Send a different file from the same software application to see if the error is specific to the original file. Try sending a job from a different software application to see if the error is specific to the application. Verify the computer has the correct print driver installed.
4. Upgrade the printer firmware.
5. If the error persists, use the troubleshooting flowcharts in this document: [HP LaserJet FutureSmart Devices - 49 error Troubleshooting \(Persistent and Intermittent\)](#)

47.WX.YZ error messages

47.* errors

Errors in the 47.* family indicate an internal error has occurred.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a `Format Disk` procedure using the `Preboot` menu.

For the steps to perform a `Format Disk` procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

47.00.xx

Back channel internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a `Format Disk` procedure using the `Preboot` menu.

For the steps to perform a `Format Disk` procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

47.01.xx

Image transformer internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the Format Disk item in the Preboot menu.

For the steps to perform a Format Disk procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

47.02.xx

Job parser internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the Format Disk item in the Preboot menu.

For the steps to perform a Format Disk procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

47.03.xx

Print job internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the Format Disk item in the Preboot menu.

For the steps to perform a Format Disk procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

47.04.xx

Print spooler 9100 internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the Format Disk item in the Preboot menu.

For the steps to perform a Format Disk procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

47.05.xx

Print spooler framework internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, perform a `Format Disk` procedure using the `Preboot` menu.

For the steps to perform a `Format Disk` procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

47.06.xx

Print application internal error.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Resend the print job.
3. If the error persists, clear the active partition by using the `Format Disk` item in the `Preboot` menu.

For the steps to perform a `Format Disk` procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

47.FC.yz Printer Calibration Failed To continue, touch "OK"

The device is unable to access or implement one of the image patterns files.

y = Calibration type, z = Event

- 47.FC.00 (event code) Color plane registration (CPR) Image not found at system initialization
- 47.FC.01 (event code) CPR Store Image failure
- 47.FC.02 (event code) CPR Image not found
- 47.FC.03 (event code) CPR Print engine execution failure

- 47.FC.10 (event code) Consecutive Dmax Dhalf Image not found at system initialization
- 47.FC.11 (event code) Consecutive Dmax Dhalf Store image failure
- 47.FC.12 (event code) Consecutive Dmax Dhalf Image not found
- 47.FC.13 (event code) Consecutive Dmax Dhalf Print engine execution failure
- 47.FC.20 (event code) Error Diffusion Image not found at system initialization
- 47.FC.21 (event code) Error Diffusion Store image failure
- 47.FC.22 (event code) Error Diffusion Image not found
- 47.FC.23 Error Diffusion Print engine execution failure
- 47.FC.30 0 (event code) Drum Speed Adjustment Image not found at system initialization
- 47.FC.31 (event code) Drum Speed Adjustment Store image failure
- 47.FC.32 (event code) Drum Speed Adjustment Image not found
- 47.FC.33 (event code) Drum Speed Adjustment Print engine execution failure
- 47.FC.40 (event code) Pulse Width Modulation Image not found at system initialization
- 47.FC.41 (event code) Pulse Width Modulation Store image failure
- 47.FC.42 (event code) Pulse Width Modulation Image not found
- 47.FC.43 (event code) Pulse Width Modulation Print engine execution failure

Recommended action for customers

1. Turn the product off, and then on again.
2. If the error persists, reload the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the product off, and then on again.
2. If the error persists over multiple power cycles, then do the following.
 - In the Support Tools/Troubleshooting/Diagnostics menu, run the hard disk tests to validate the health of the device. Fix any issue found with the mass storage device.
3. If the error persists, reload the firmware.
4. If the error persists, perform a `Format Disk` procedure using the `Preboot` menu.

For the procedure to perform a `Format Disk` procedure., go to: [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#) (c03398779).

48.WX.YZ error messages

48.* errors

Errors in the 48.* family indicate an internal error has occurred.

Recommended action for customers

1. Turn the printer off, and then on.
2. Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. In most cases, no action is necessary.
2. If the error persists, upgrade the printer firmware.
3. If the error persists, use the troubleshooting flowcharts in this document: [HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)

Note:

48.wx.yz are similar to 49.wx.yz errors and use the same troubleshooting steps and procedures.

48.01.YZ Error

A job framework internal error has occurred.

Recommended action

1. No action necessary.
2. If the error persists, upgrade the printer firmware.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 49 error troubleshooting (whichever is appropriate) in document c03122817, "[HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)".

48.03.YZ Error

A job framework internal error has occurred.

Recommended action

1. No action necessary.
2. If the error persists, upgrade the printer firmware.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 49 error troubleshooting (whichever is appropriate) in document c03122817, [“HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)”](#).

48.05.YZ Error

A job framework internal error has occurred.

Recommended action

1. No action necessary.
2. If the error persists, upgrade the printer firmware.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 49 error troubleshooting (whichever is appropriate) in document c03122817, [“HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)”](#).

49.WX.YZ error messages

49.XX.YY Error To continue turn off then on

A firmware error occurred.

Possible causes:

- Corrupted print jobs
- Software application issues
- Non-product specific print drivers
- Poor quality USB or network cables
- Bad network connections or incorrect configurations
- Invalid firmware operations
- Unsupported accessories

A 49 error might happen at any time for multiple reasons. Although some types of 49 errors can be caused by hardware failures, it is more common for 49 errors to be caused by printing a specific document or performing some task on the printer.

49 errors most often occur when a printer is asked to perform an action that the printer firmware is not capable of and might not have been designed to comply with, such as:

- Printing files with unsupported programming commands
- A unique combination of user environment and user interactions with the printer

- Interfacing with a third-party solution that was not designed to work with the printer
- Specific timing, network traffic, or concurrent processing of jobs

Recommended action for customers

Note:

LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad USB or network interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Note:

LaserJet formatter PCAs are rarely the root cause of 49 service errors. Please do not replace the formatter unless troubleshooting has identified the formatter as the root cause.

1. Turn the printer off, and then on.
2. If the error persists, check the following:
 - The error might be caused by a network connectivity problem, such as a bad interface cable, a bad USB port, or an invalid network configuration setting.
 - The error might be caused by the print job, due to an invalid print driver, a problem with the software application, or a problem with the file being printed.
 - Upgrading the printer firmware might help resolve the error.
3. If the error persists, continue troubleshooting with the flowcharts for either Intermittent or Persistent 49 error troubleshooting (whichever is appropriate) in document c03122817:

[HP LaserJet FutureSmart Devices - 49 Error Troubleshooting \(Persistent and Intermittent\)](#)

50.WX.YZ error messages

50.* errors

Errors in the 50.* family indicate a problem with the fuser.

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and remove the fuser. Check the fuser for damage or obstructions. Reinstall or replace the fuser as needed.

CAUTION:

The fuser might be hot.

2. Check the connectors between the fuser and the DC controller and from the fuser to the printer.
3. Replace the fuser. If it has already been replaced, replace the fuser power supply.

50.1X.YZ Fuser error

Low fuser temperature failure occurred.

Recommended action

1. Turn the printer off.
2. Remove and reinstall the fuser, and ensure that it is seated correctly.

CAUTION:

The fuser might be hot.

3. Ensure that there is no residual paper in the fuser.
4. Check the printer power source, make sure that it meets printer requirements, and that the printer is the only device using the circuit.
5. Check the connector (J1901) between the fuser and the printer. If the connector is damaged, replace the fuser drive assembly.

Part number: RM1-9606-000CN

6. Reconnect the connectors (J303 and J305) on the fuser control PCA and the connector (J107) on the DC controller PCA.
7. If the error persists, check the event log for a 10.23.60 or 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.60 or 10.23.70 is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the fuser under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

8. If the error persists, replace the fuser power supply assembly.

Fuser power supply assembly (110V) part number: RL1-4005-000CN

Fuser power supply assembly (220V) part number: RL2-0263-000CN

50.20.YZ, 50.21.YZ, or 50.22.YZ Fuser error

Fuser warm-up error occurred.

Some jams in the fuser can cause the power to the fuser to be turned off to prevent possible damage. For example, if envelopes are being printed, multi-feeds can occur if the envelopes stick together. The multiple envelopes fed together can jam in the fuser and cause this error to occur.

The circuit which controls the power to the fuser must be reset before the condition can be cleared. The reset of this circuit requires that the printer be powered off for longer than 15 seconds.

Recommended action

1. Turn the printer off.
2. Remove and reinstall the fuser, and ensure that the fuser is seated correctly.

CAUTION:

The fuser might be hot.

3. Ensure that there is no residual paper in the fuser.
4. Check the printer power source, ensure that the power source meets printer requirements, and that the printer is the only device using the circuit.
5. Check the connector (J1901) between the fuser and the printer. If the connector is damaged, replace the fuser drive assembly.

Part number: RM1-9606-000CN

6. Reconnect the connectors (J303 and J305) on the fuser control PCA and connector (J107) on the DC controller PCA.
7. If the error persists, check the event log for a 10.23.60 or 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.60 or 10.23.70 is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the fuser under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

8. If the error persists, replace the fuser power supply assembly.

Part number (110V): RL1-4005-000CN

Part number (220V): RL2-0263-000CN

50.3X.YZ Fuser error

High fuser temperature error occurred.

Recommended action

1. Turn the printer off.
2. Remove and reinstall the fuser, and ensure that it is seated correctly.

CAUTION:

The fuser might be hot.

3. Check the paper type setting in the printer control panel menus and in the print driver, and ensure that the settings match and are correct for the type of paper being used.
4. If the customer prints high coverage pages, toner can build up on the pressure roller. Schedule a regular cleaning page to prevent the toner build up.
5. Check the connector (J1901) between the fuser and the printer. If the connector is damaged, replace the fuser drive assembly.

Part number: RM1-9606-000CN

6. Reconnect the connectors (J303 and J305) on the fuser control PCA and connector (J107) on the DC controller PCA.
7. If the error persists, check the event log for a 10.23.60 or 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.60 or 10.23.70 is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the fuser under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

8. If the error persists, replace the fuser power supply assembly.

Part number (110V): RL1-4005-000CN

Part number (220V): RL2-0263-000CN

50.4X.YZ Fuser error

Drive circuit fault occurred.

Recommended action

1. Turn the printer off.
2. Check the printer power source, and ensure that the power source meets printer requirements.

Note:

If the power source does not meet the power frequency requirements of 43 to 67Hz, the fuser temperature control does not work correctly and causes this error.

3. If possible, connect the printer to an outlet where another printer is functioning correctly to check the power connection.
4. Remove and reinstall the fuser, and ensure that it is seated correctly.

CAUTION:

The fuser might be hot.

5. Update the firmware to the latest version using hp.com.
6. Check the connector (J1901) between the fuser and the printer. If the connector is damaged, replace the fuser drive assembly and fuser power supply assembly.

Fuser drive assembly part number: RM1-9606-010CN

Fuser power supply assembly (110V) part number: RL1-4005-000CN

Fuser power supply assembly (220V) part number: RL2-0263-000CN

If fuser power supply assembly (220V) part number RL2-0263-000CN is not available, use RL1-4005-000CN.

7. Reconnect the connectors (J303 and J305) on the fuser control PCA and connector (J107) on the DC controller PCA.
8. If the error persists, check the event log for a 10.23.60 or 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.60 or 10.23.70 code is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the fuser under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

9. If the error persists, replace the DC controller.

For instructions: See the Repair Service Manual for this product.

M855 part number: RM2-7005-010CN

M880 part number: RM2-7006-010CN

50.6X.YZ Fuser error

Open fuser circuit (heating element) failure occurred.

Recommended action

1. Turn the printer off.
2. Remove and reinstall the fuser, and ensure that the fuser is seated correctly.

CAUTION:

The fuser might be hot.

3. Check the paper type setting in the printer menus and in the printer driver, and then ensure that the settings match (and are correct) for the type of paper being used.
4. Check the connector (J1901) between the fuser and the printer. If the connector is damaged, replace the fuser drive assembly.

Part number: RM1-9606-000CN

5. Reconnect the connectors (J302, J303 and J305) on the fuser control PCA and connector (J107) on the DC controller PCA.
6. If the error persists, check the event log for a 10.23.60 or 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.60 or 10.23.70 is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the fuser under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

7. If the error persists, replace the fuser power supply assembly.

Part number (110V): RL1-4005-000CN

Part number (220V): RL2-0263-000CN

8. If the error persists, replace the DC controller.

For instructions: See the Repair Service Manual for this product.

M855 part number: RM2-7005-000CN

M880 part number: RM2-7006-000CN

50.7X.YZ Fuser error

Fuser pressure-release mechanism failure occurred.

Recommended action

1. Turn the printer off.
2. Remove and reinstall the fuser, and ensure that it is seated correctly.

CAUTION:

The fuser might be hot.

3. Ensure that there is no residual paper in the fuser.
4. Run the manual sensor test to verify that the fuser home position sensor is functioning correctly.
5. If the test fails, replace the fuser home position sensor assembly (IC photo interrupter).

Part number: WG8-5935-000CN

6. Run the fuser depressurization drive test in the actuator drive mode to verify that the fuser depressurization drive is functioning correctly.
7. If the test fails, replace the fuser motor.

Part number: RM1-4519-000CN

8. If the error persists, reconnect the connector (J1711) of the fuser motor, intermediate connector (J1964) of the fuser home position sensor and connectors (J105 and J121) on the DC controller PCA, and then test again.
9. If the test continues to fail, replace the fuser drive assembly.

Part number: RM1-9606-010CN

10. Check the fuser home position sensor flag.
11. If the sensor flag is damaged, check the event log for a 10.23.60 or 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.60 or 10.23.70 is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the fuser under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

50.8X.YZ Fuser Error

Low fuser temperature 2 error occurred.

Recommended action

1. Turn the printer off.
2. Remove and reinstall the fuser, and ensure that it is seated correctly.

CAUTION:

The fuser might be hot.

3. Ensure that there is no residual paper in the fuser.
4. Check the printer power source, ensure that the power source meets printer requirements, and that the printer is the only device using the circuit.
5. Check the connector (J1901) between the fuser and the printer. If the connector is damaged, replace the fuser drive assembly.

Part number: RM1-9606-000CN

6. Reconnect the connectors (J303 and J305) on the fuser control PCA and connector (J107) on the DC controller PCA.
7. If the error persists, check the event log for a 10.23.60 or 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.60 or 10.23.70 is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the fuser under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

8. If the error persists, replace the fuser power supply assembly.

Part number (110V): RL1-4005-000CN

Part number (220V): RL2-0263-000CN

50.9X.YZ Fuser Error

High fuser temperature 2 error occurred.


Recommended action for customers

1. Turn the printer off.
2. Remove and reinstall the fuser.


CAUTION:

The fuser might be HOT!

- a. Open the right door.

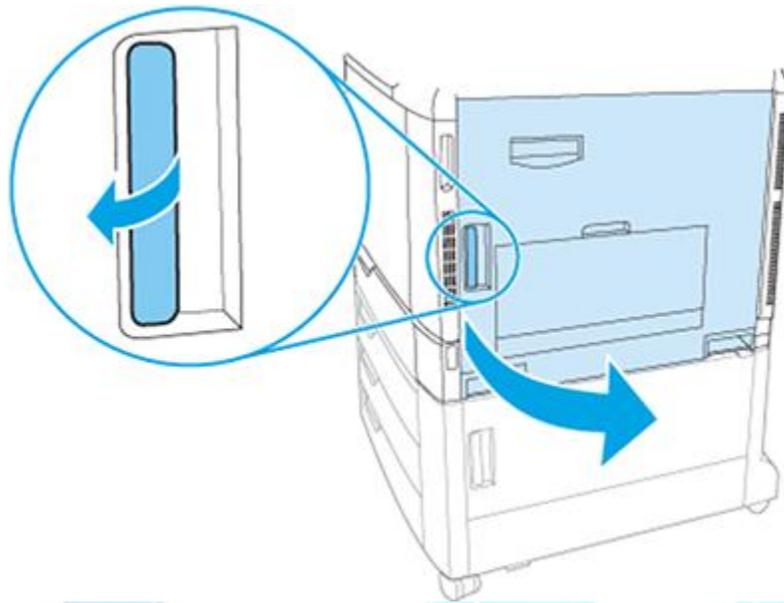


- b. Rotate the two blue fuser handles toward the center of the fuser.

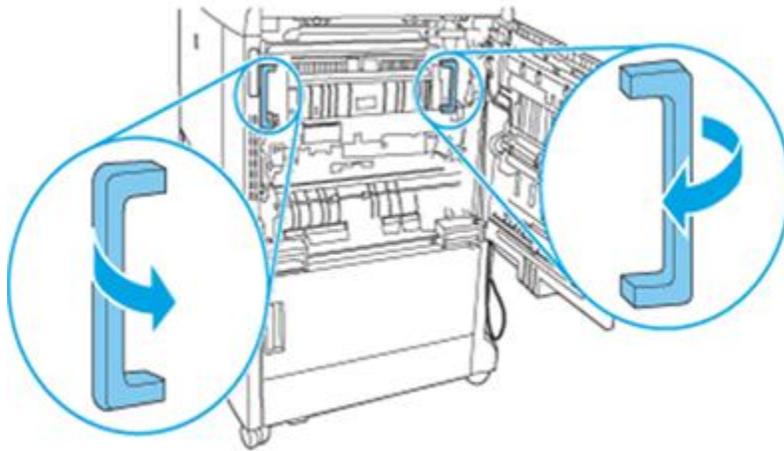


- c. Grasp the handles and slide the fuser toward the right door to remove it.

CAUTION:


The fuser might be **HOT!**

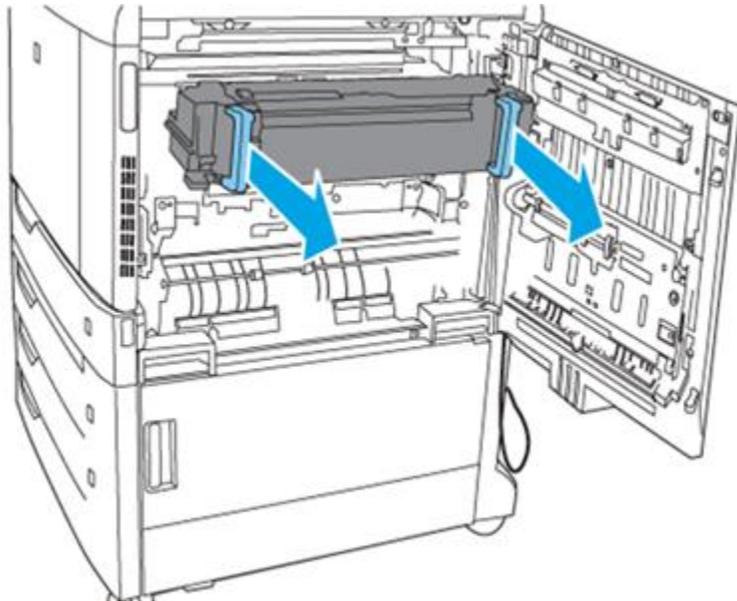


- d. Lift the replacement fuser by the blue handles, and then insert it into the product.

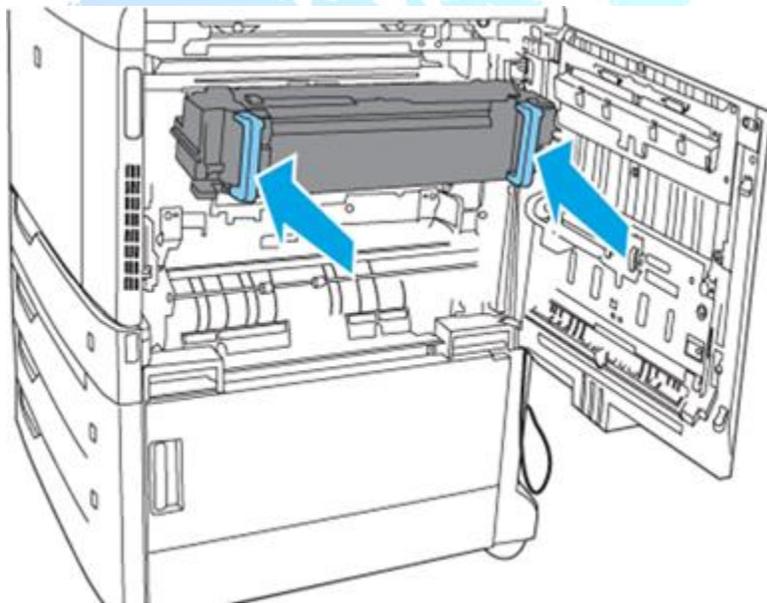

- e. Rotate the blue fuser handles away from the center of the fuser and into a closed position.

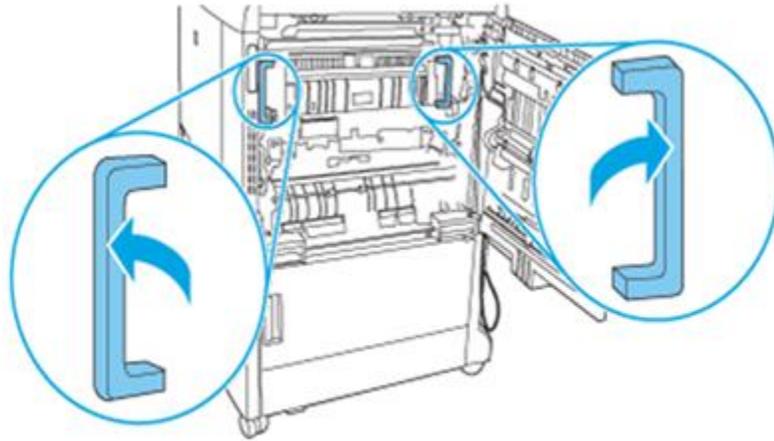

f. Close the right door.

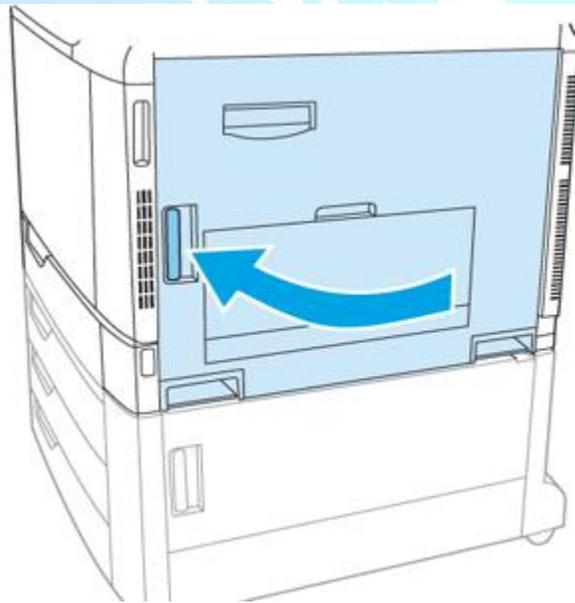

3. If the error persists, please contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

1. Turn the printer off.
2. Remove and reinstall the fuser.


CAUTION:

The fuser might be **HOT!**

- a. Open the right door.

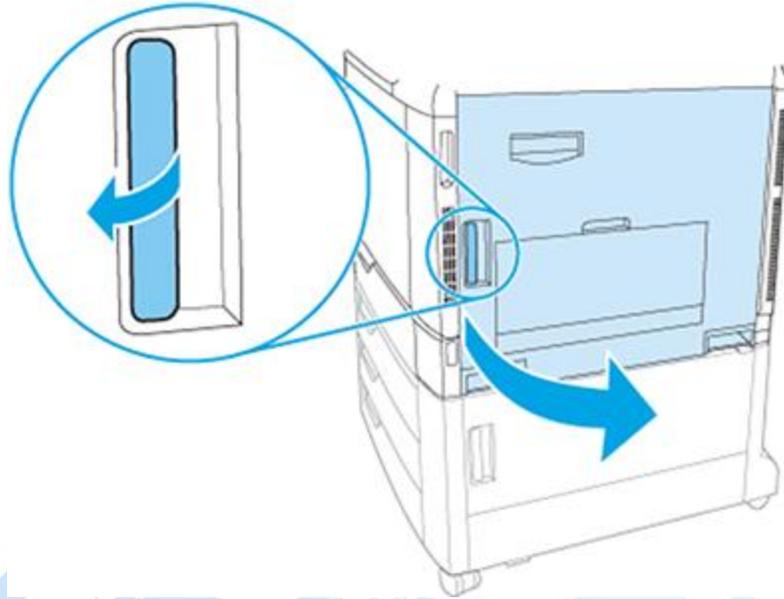


- b. Rotate the two blue fuser handles toward the center of the fuser.

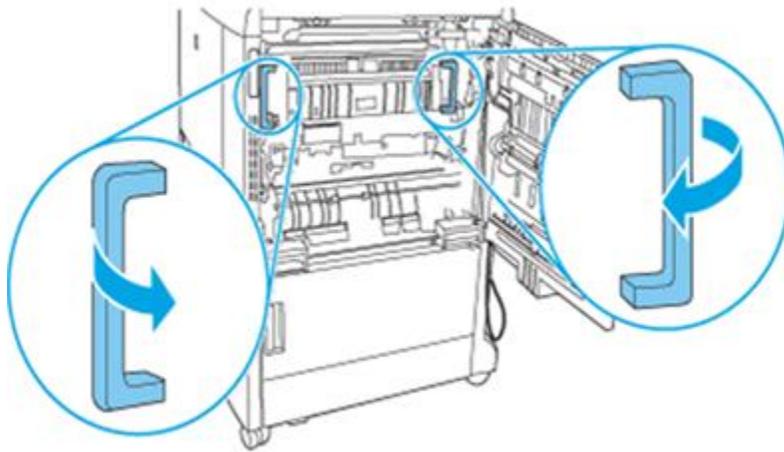


- c. Grasp the handles and slide the fuser toward the right door to remove it.

CAUTION:


The fuser might be **HOT!**

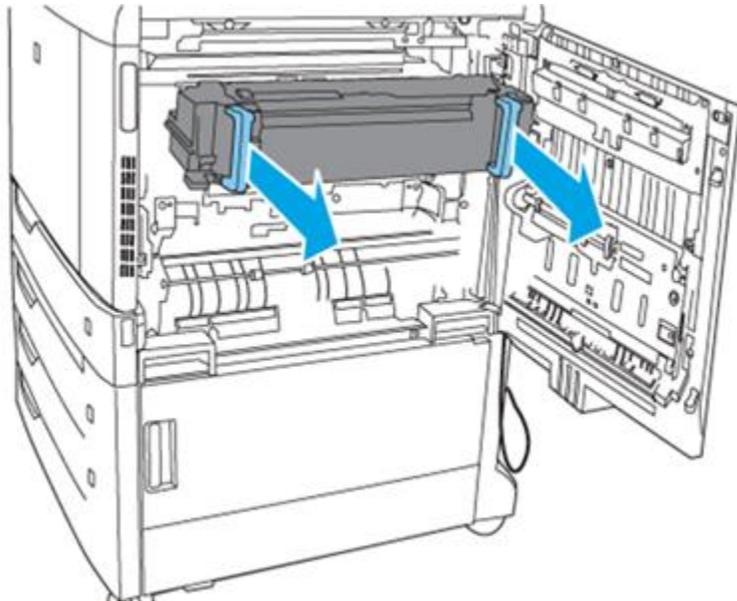


- d. Lift the replacement fuser by the blue handles, and then insert it into the product.

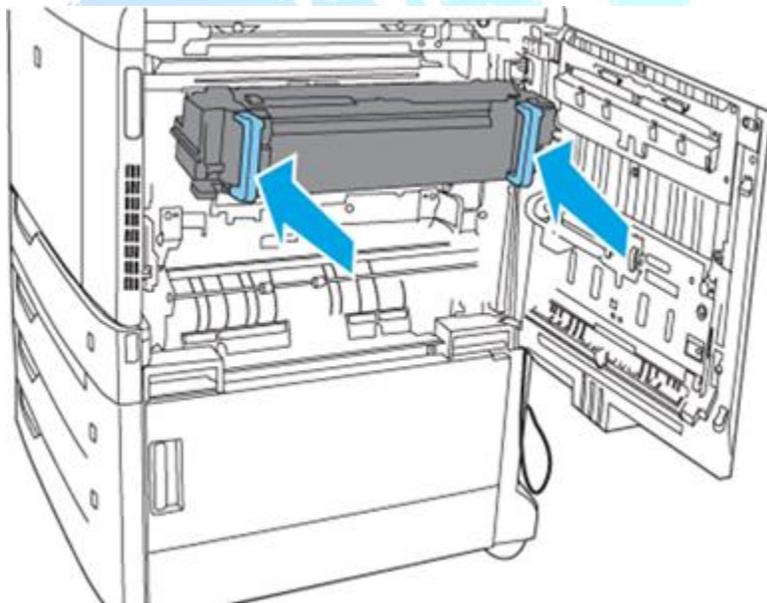

- e. Rotate the blue fuser handles away from the center of the fuser and into a closed position.

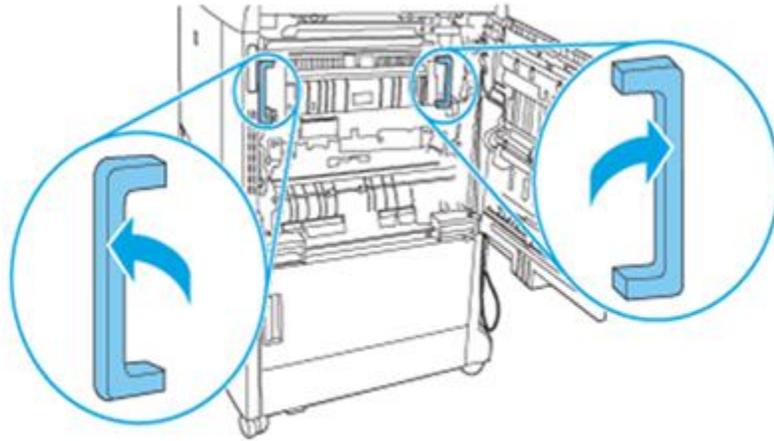

f. Close the right door.

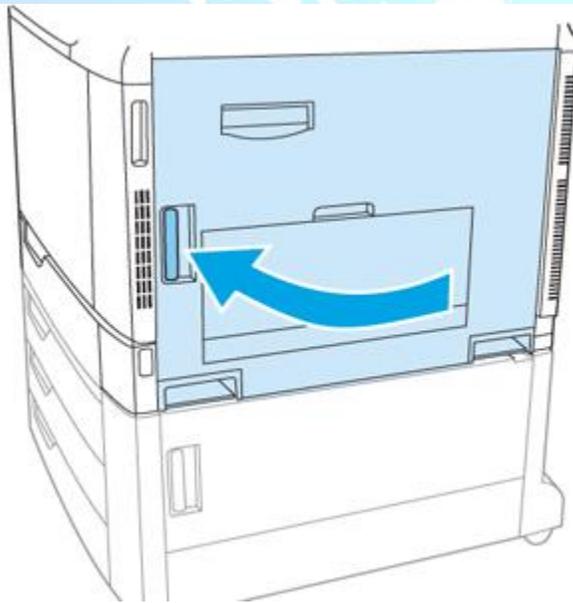

3. If the error persists, check the event log for a 10.23.60 or 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- o If a 10.23.60 or 10.23.70 is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.

- If an active low warning is not listed, replace the fuser under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901 (C1N54-69002 functional equivalent)

Fuser (220V) part number: C1N58-67901 (C1N58-69001 functional equivalent)

Recommended action for onsite technicians

1. Turn the printer off.
2. Remove and reinstall the fuser, and ensure that it is seated correctly.

CAUTION:

The fuser might be hot.

For instructions: See the Repair Service Manual for this product.

3. If the error persists, check the event log for a 10.23.60 or 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.60 or 10.23.70 is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the fuser under warranty.


For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901 (C1N54-69002 functional equivalent)

Fuser (220V) part number: C1N58-67901 (C1N58-69001 functional equivalent)

4. Check the connector (J1901) between the fuser and printer. If the connector is damaged, replace the fuser drive assembly.

Part number: RM1-9606-000CN

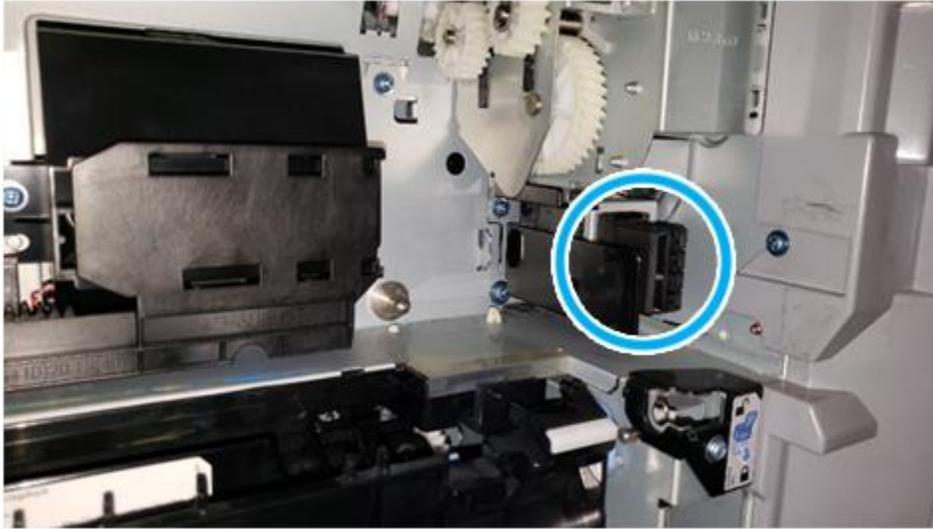

5. Reconnect the connectors (J302, J303 and J305) on the fuser control PCA and connector (J107) on the DC controller PCA.
6. If the error persists, replace the fuser power supply assembly.

Part number (110V): RL1-4005-000CN

Part number (220V): RL2-0263-000CN

For instructions: See the Repair Service Manual for this product.

7. If the issue persists, elevate the case using the Standard Support Process.

50.9F.00 Fuser Error

High fuser temperature 2 error.


Recommended action for customers

1. Turn the printer off.
2. Remove and reinstall the fuser.


CAUTION:

The fuser might be HOT!

- a. Open the right door.

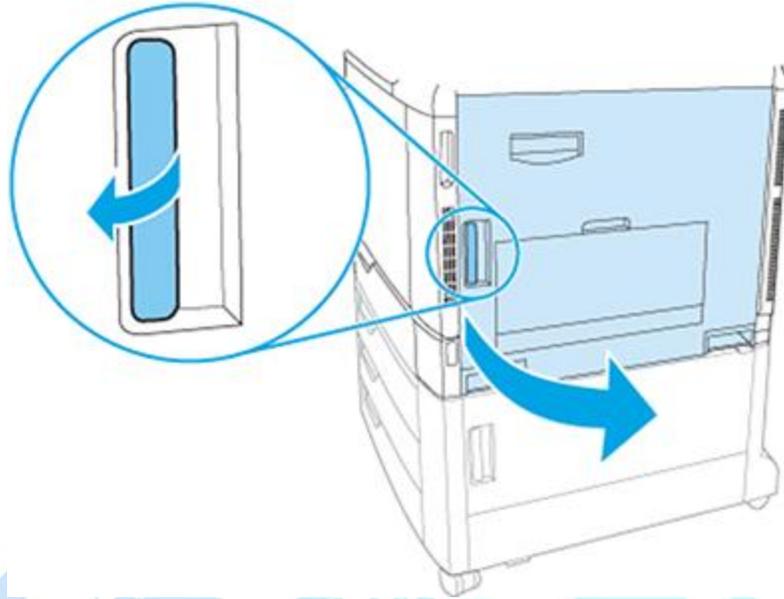


- b. Rotate the two blue fuser handles toward the center of the fuser.

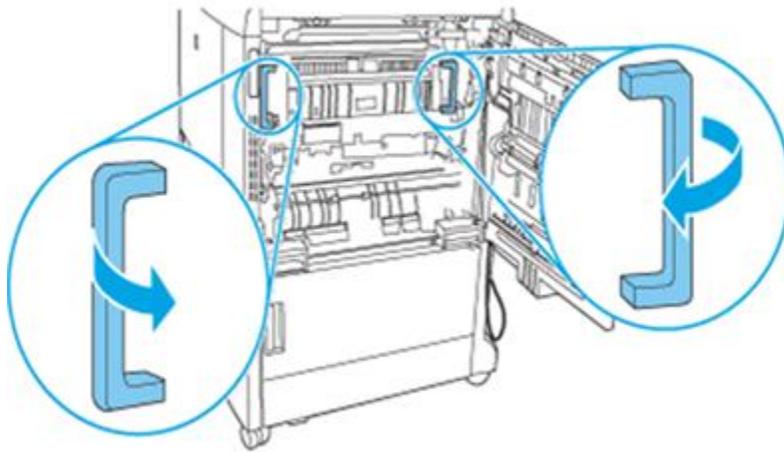


- c. Grasp the handles and slide the fuser toward the right door to remove it.

CAUTION:


The fuser might be HOT!

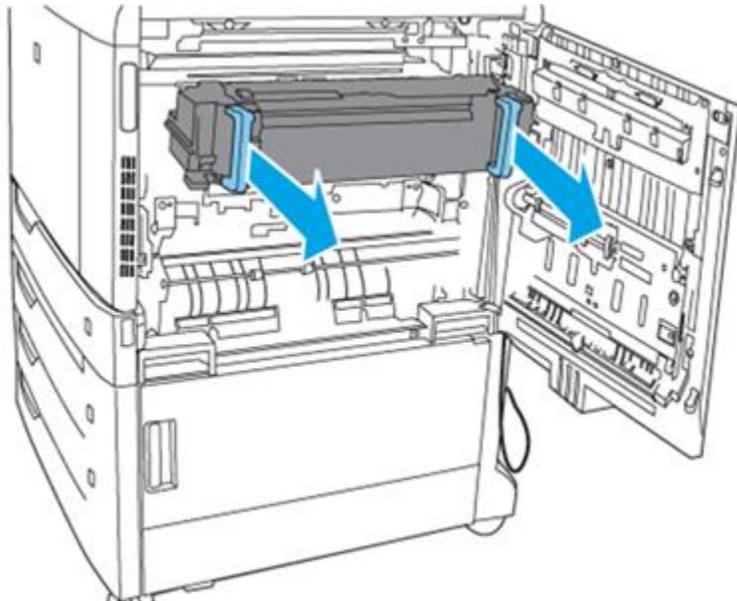


- d. Lift the replacement fuser by the blue handles, and then insert it into the product.

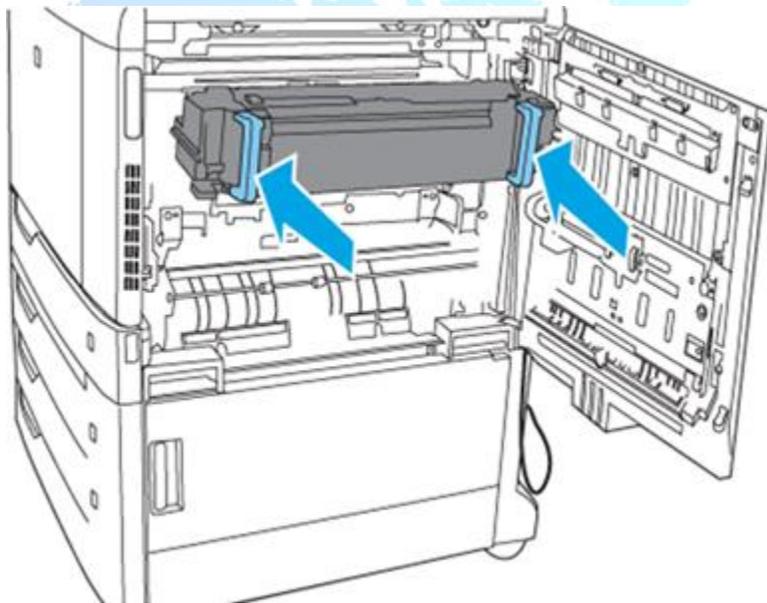

- e. Rotate the blue fuser handles away from the center of the fuser and into a closed position.

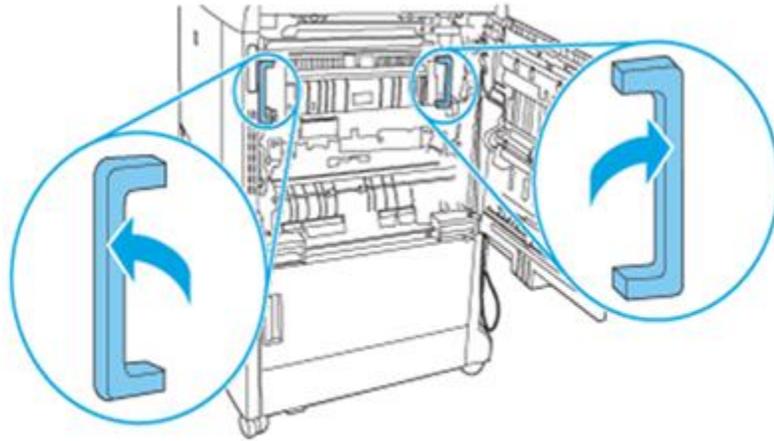

f. Close the right door.

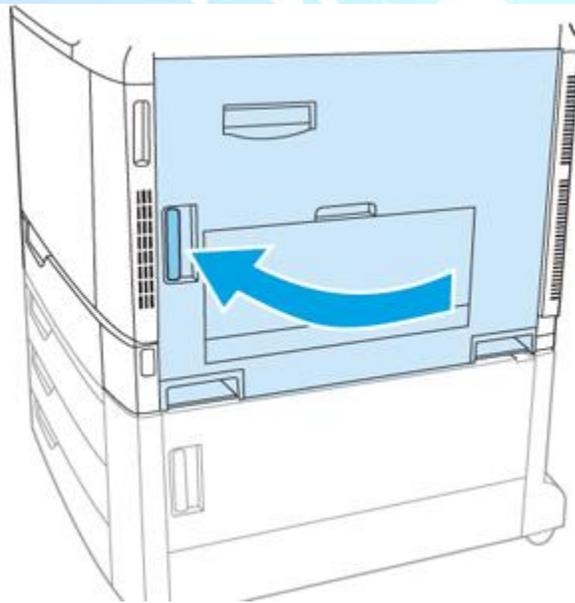

3. If the error persists, please contact customer support at www.hp.com/go/contactHP.


Recommended action for call-center agents

1. Turn the printer off.
2. Remove and reinstall the fuser.


CAUTION:

The fuser might be **HOT!**

- a. Open the right door.

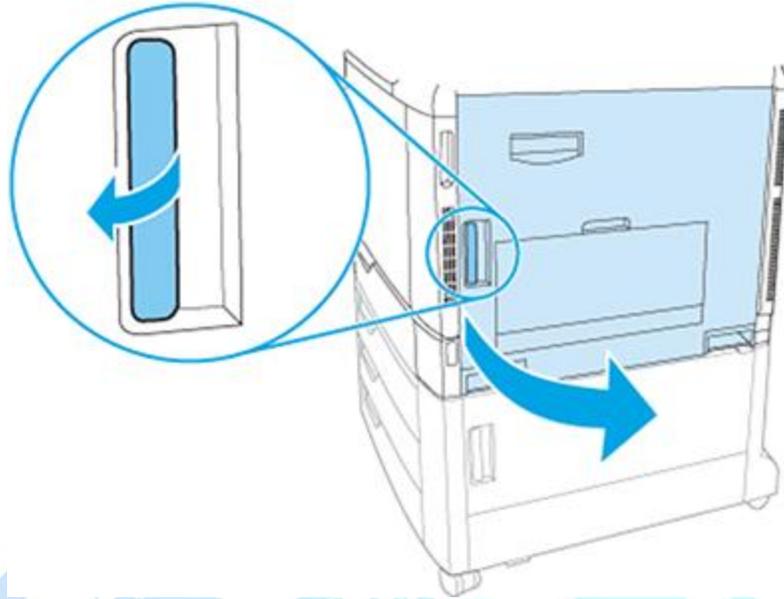


- b. Rotate the two blue fuser handles toward the center of the fuser.

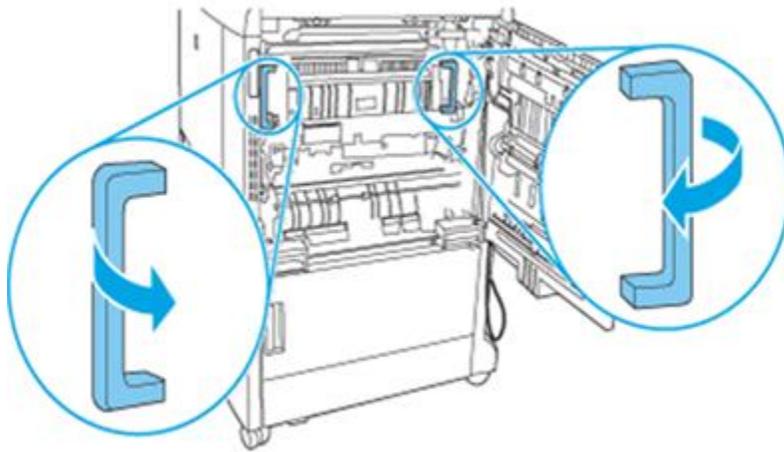


- c. Grasp the handles and slide the fuser toward the right door to remove it.

CAUTION:


The fuser might be HOT!

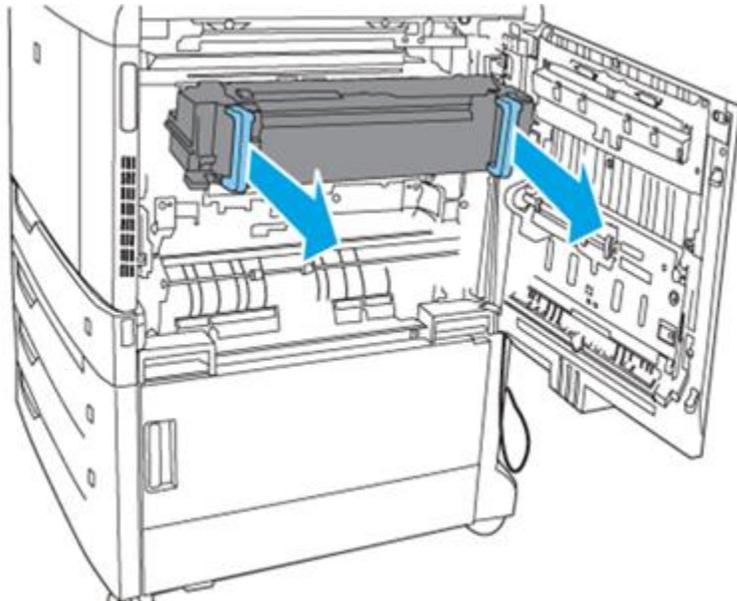


- d. Lift the replacement fuser by the blue handles, and then insert it into the product.

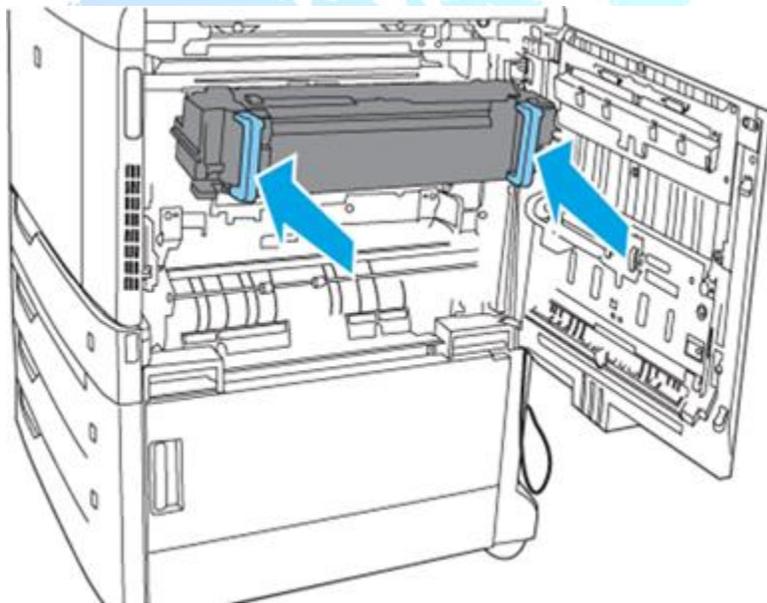

- e. Rotate the blue fuser handles away from the center of the fuser and into a closed position.

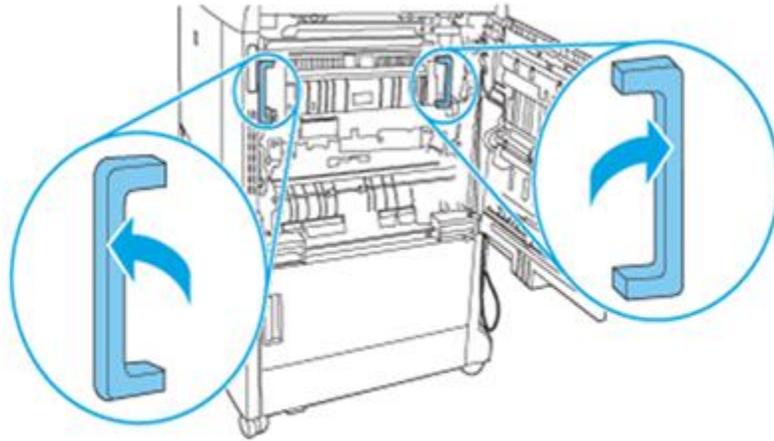

f. Close the right door.

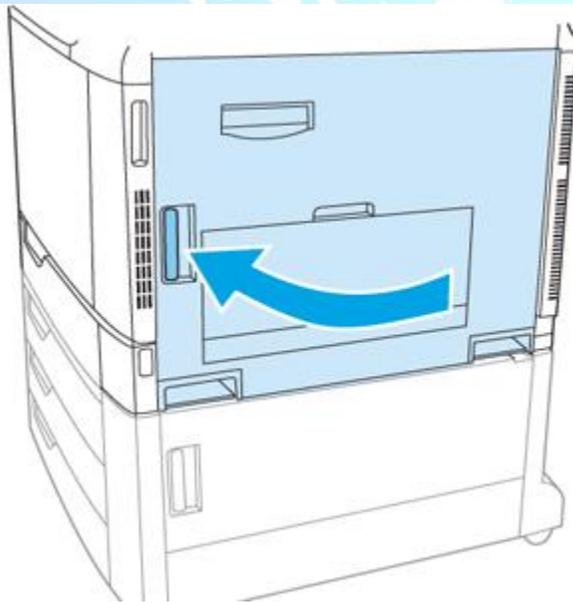

3. If the error persists, check the event log for a 10.23.60 or 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- o If a 10.23.60 or 10.23.70 is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.

- If an active low warning is not listed, replace the fuser under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901 (C1N54-69002 functional equivalent)

Fuser (220V) part number: C1N58-67901 (C1N58-69001 functional equivalent)

Recommended action for onsite technicians

1. Turn the printer off.
2. Remove and reinstall the fuser, and ensure that it is seated correctly.

CAUTION:

The fuser might be hot.

For instructions: See the Repair Service Manual for this product.

3. If the error persists, check the event log for a 10.23.60 or 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.60 or 10.23.70 is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the fuser under warranty.


For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901 (C1N54-69002 functional equivalent)

Fuser (220V) part number: C1N58-67901 (C1N58-69001 functional equivalent)

4. Check the connector (J1901) between the fuser and printer. If the connector is damaged, replace the fuser drive assembly.

Part number: RM1-9606-000CN

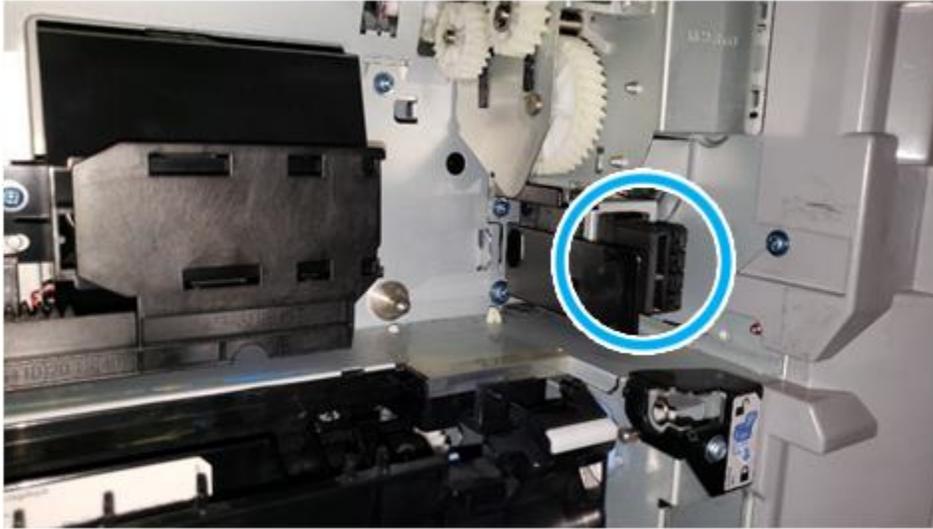

5. Reconnect the connectors (J302, J303 and J305) on the fuser control PCA and connector (J107) on the DC controller PCA.
6. If the error persists, replace the fuser power supply assembly.

Part number (110V): RL1-4005-000CN

Part number (220V): RL2-0263-000CN

For instructions: See the Repair Service Manual for this product.

7. If the issue persists, elevate the case using the Standard Support Process.

50.AX.YZ Fuser error

Low fuser temperature 3 error occurred.

Recommended action

1. Turn the printer off.
2. Remove and reinstall the fuser, and ensure that it is seated correctly.

CAUTION:

The fuser might be hot.

3. Ensure that there is no residual paper in the fuser.
4. Check the printer power source, make sure that it meets printer requirements, and that the printer is the only device using the circuit.
5. Check the connector (J1901) between the fuser and printer. If the connector is damaged, replace the fuser drive assembly.

Part number: RM1-9606-000CN

6. Reconnect the connectors (J302, J303 and J305) on the fuser control PCA and connector (J107) on the DC controller PCA.
7. If the error persists, check the event log for a 10.23.60 or 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.60 or 10.23.70 is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the fuser under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

8. If the error persists, replace the fuser power supply assembly.

Fuser power supply assembly (110V) part number: RL1-4005-000CN

Fuser power supply assembly (220V) part number: RL2-0263-000CN

50.BX.YZ Fuser error

High fuser temperature 3 error occurred.

Recommended action

1. Turn the printer off.
2. Remove and reinstall the fuser, and ensure that it is seated correctly.

CAUTION:

The fuser might be hot.

3. Check the paper type setting in the printer control panel menus and in the print driver, and ensure that the settings match and are correct for the type of paper being used.
4. Check the connector (J1901) between the fuser and printer. If the connector is damaged, replace the fuser drive assembly.

Part number: RM1-9606-000CN

5. Reconnect the connectors (J302, J303 and J305) on the fuser control PCA and connector (J107) on the DC controller PCA.
6. If the error persists, check the event log for a 10.23.60 or 10.23.70 code and replace the fuser.

Important:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

- If a 10.23.60 or 10.23.70 is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the fuser under warranty.

For instructions: [Removal and replacement: Fuser](#)

Fuser (110V) part number: C1N54-67901

Fuser (220V) part number: C1N58-67901

7. If the error persists, replace the fuser power supply assembly.

Fuser power supply assembly (110V) part number: RL1-4005-000CN

Fuser power supply assembly (220V) part number: RL2-0263-000CN

51.WX.YZ, 52.WX.YZ error messages

51.* errors

Errors in the 51.* family are related to the laser scanner.

Recommended action for customers

1. Turn the printer off, and then on.
2. Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

51.00.YZ

An error with the laser/scanner assembly has occurred in the printer.

- **51.00.10:** Beam detect error
- **51.00.19:** Laser malfunction
- **51.00.20:** Black laser/scanner error
- **51.00.21:** Cyan laser/scanner error
- **51.00.22:** Magenta laser/scanner error
- **51.00.23:** Yellow laser/scanner error

Recommended action

1. Turn the printer off, and then on.
2. Check the connections to the laser scanner from the DC controller PCA.
 - Laser malfunction of yellow or magenta:

Reconnect the connector (J1701) of the scanner motor (Y/M), the intermediate connector (J1927), and the connector (J130B) on the DC controller PCA.

- Laser malfunction of cyan or black:

Reconnect the connector (J1702) of the scanner motor (C/K), the intermediate connector (J1928), and the connector (J130B) on the DC controller PCA.

3. If the error persists, replace the laser scanner with the malfunction.

For instructions: See the Repair Service Manual for this product.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-5176-000CN

52.* errors

Errors in the 52.* family are related to the laser scanner.

Recommended action for customers

1. Turn the printer off, and then on.
2. Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Ensure the printer is running the most current version of firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

2. Check all connections on the laser/scanner and from the laser/scanner to the DC controller, and reseal them if necessary.
3. If the error persists, replace the laser scanner.

52.00.00/52.00.20 Scanner Startup/Rotation error

A printer laser/scanner startup (52.00.00) or rotation (52.00.20) error occurred.

Recommended action

1. Turn the printer off, and then on.
2. Check the connections to the laser scanner from the DC controller PCA.
 - o Laser malfunction of yellow or magenta:

Reconnect the connector (J1701) of the scanner motor (Y/M), the intermediate connector (J1927), and the connector (J130B) on the DC controller PCA.

- Laser malfunction of cyan or black:

Reconnect the connector (J1702) of the scanner motor (C/K), the intermediate connector (J1928), and the connector (J130B) on the DC controller PCA.

3. If the error persists, replace the laser scanner with the malfunction.

For instructions: See the Repair Service Manual for this product.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-5176-000CN

54.XX.YZ error messages

54.* errors

Errors in the 54.* family are related to the image-formation system.

- For HP LaserJet printers, they can indicate a problem with the toner cartridges or the transfer unit (color printers only), or they can indicate a problem with a sensor, such as with the laser/scanner.
- For HP PageWide printers, they can indicate a problem with the calibration process.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Check the supplies status page using the Supplies menu on the control panel to verify that toner cartridges, toner collection unit (TCU), or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.

To print a Supplies Status Page:

- a. From the Home screen on the printer control panel, select Administration.
- b. Open the following menus:
 - i. Reports
 - ii. Configuration/Status Pages
- c. Scroll to and select Supplies Status Page.
- d. Select Print to print the page.

To order parts, go to <https://www.hp.com/buy/parts>.

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check the supplies status page to verify that the toner cartridges, TCU, or the transfer belt kit are not past their useful life. Replace the supplies and maintenance parts as necessary.
3. For color printers, inspect the transfer belt for damage. Replace the transfer belt if necessary or instruct the customer to replace it.
4. For color printers, if the error persists, replace the registration assembly.
5. Check the connections between the laser/scanner and the DC controller, and from the laser/scanner to the printer. Reseat them if necessary. If the error persists, replace the laser scanner.

54.00.01 (event log only)

Environment sensor abnormality warning.

Recommended action

1. Turn the printer off, and then on.
2. Reconnect the connector (J9986) of the environment sensor and connector (J115) on the DC controller PCA.
3. If the error persists, replace the environment sensor.

Part number: RK2-4811-000CN

54.0X.0B, 54.0X.0C, 54.0X.0D, or 54.0X.0Y (event log only)


Density sensor out of range error or calibration failure occurred.

- 54.00.0B, 54.00.0C 54.00.0D, 54.00.0E — Black
- 54.01.0B, 54.01.0C 54.01.0D, 54.01.0E — Cyan
- 54.02.0B, 54.02.0C 54.02.0D, 54.02.0E — Magenta
- 54.03.0B, 54.03.0C 54.03.0D, 54.03.0E — Yellow

Recommended action

1. Check the supplies status page to make sure the toner cartridges are not past their useful life.
2. Remove and check the ITB for damage.
3. Make sure the CPR sensor is not contaminated with toner or paper dust, and clean the sensor and area with compressed air, soft brush, or a lint-free cloth.

Cleaning locations

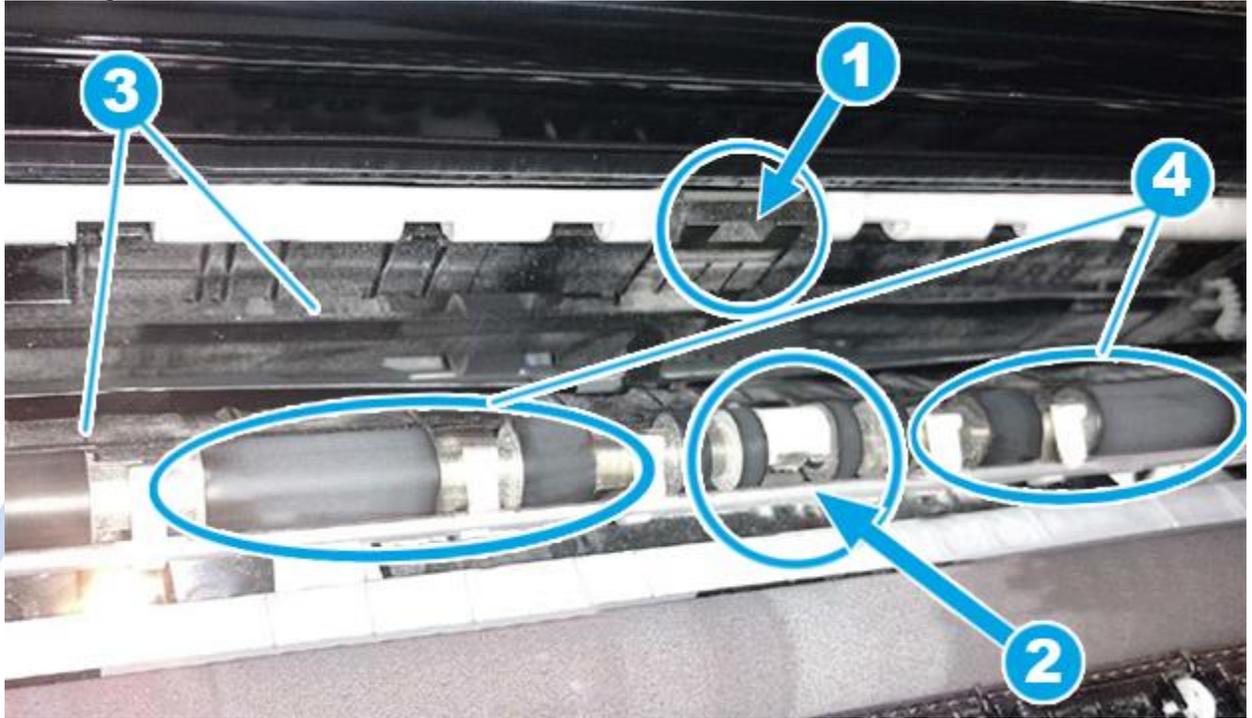

Callout 1: SR2501

Callout 2: Location of media sensor (note the dust on the shaft)

Callout 3: Excessive dust in paper path

Callout 4: Registration rollers are not clean

Area after a thorough cleaning



4. Turn the printer off, and then on.
5. Check the following connectors:
 - (J1904) between the ITB and the printer
 - (J119, J118 and J116) on the DC controller PCA
 - (J1824 and J1931) on the CPR/density sensor assembly
6. If the error persists, replace the CPR/density sensor.

Part number: RM2-7026-000CN

7. If the error persists, check the event log for the 10.22.70 code and replace the ITB.
 - If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part or supply under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

ITB part number: RY7-5211-000CN

OR

Transfer and roller kit part number (contains ITB) RY7-5213-000CN

8. Important:
9. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

54.0F.0z

CPR sensor out of range.

Calibration error color plain registration.

- **54.0F.00** - CPR sensor out of range - Yellow
- **54.0F.01** - CPR sensor out of range - Black
- **54.0F.02** - CPR sensor out of range - Cyan
- **54.0F.03** - CPR sensor out of range - Magenta

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Check the supplies status page to ensure that the toner cartridges are not past their useful life.

Note:

Check the event log for the 10.0X.70 codes for the cartridge (10.01, 02, 03, 04.70). If this error is listed, the customer must replace the specified supply. After an HP supply has reached the very low threshold, the HP premium protection warranty ends and the customer is responsible for replacing the part(s).

3. Remove and check the ITB for damage.

For instructions: [Removal and replacement: ITB Transfer roller](#)

Part number: D7H14-67902

Kit includes ITB, transfer roller and tray rollers.

Note:

HP recommends having replacement supplies available to install when the print quality is no longer acceptable.

4. Make sure the CPR sensor is not contaminated with toner or paper dust, and clean the sensor and area with compressed air, soft brush, or a lint-free cloth.

5. Check the following connectors:
 - (J1904) between the ITB and the printer
 - (J119, J118 and J116) on the DC controller PCA
 - (J1824 and J1931) on the CPR/density sensor assembly
6. If the error persists, replace the CPR/density sensor.

Part number: RM2-7026-000CN

7. If the error persists, check the event log for the 10.22.70 code and replace the ITB.
 - If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part or supply under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

ITB part number: RY7-5211-000CN

OR

Transfer and roller kit part number (contains ITB) RY7-5213-000CN

8. Important:
9. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

54.0C.0X or 54.0D.0X (event log only)


Density sensor measurement abnormality warning.

- 54.0C.00, 54.0D.00 — Black
- 54.0C.01, 54.0D.01 — Cyan
- 54.0C.02, 54.0D.02 — Magenta
- 54.0C.03, 54.0D.03 — Yellow

Recommended action

1. Check the supplies status page to make sure the toner cartridges are not past their useful life.
2. Remove and check the ITB for damage.
3. Make sure the CPR sensor is not contaminated with toner or paper dust, and clean the sensor and area with compressed air, soft brush, or a lint-free cloth.

Cleaning locations

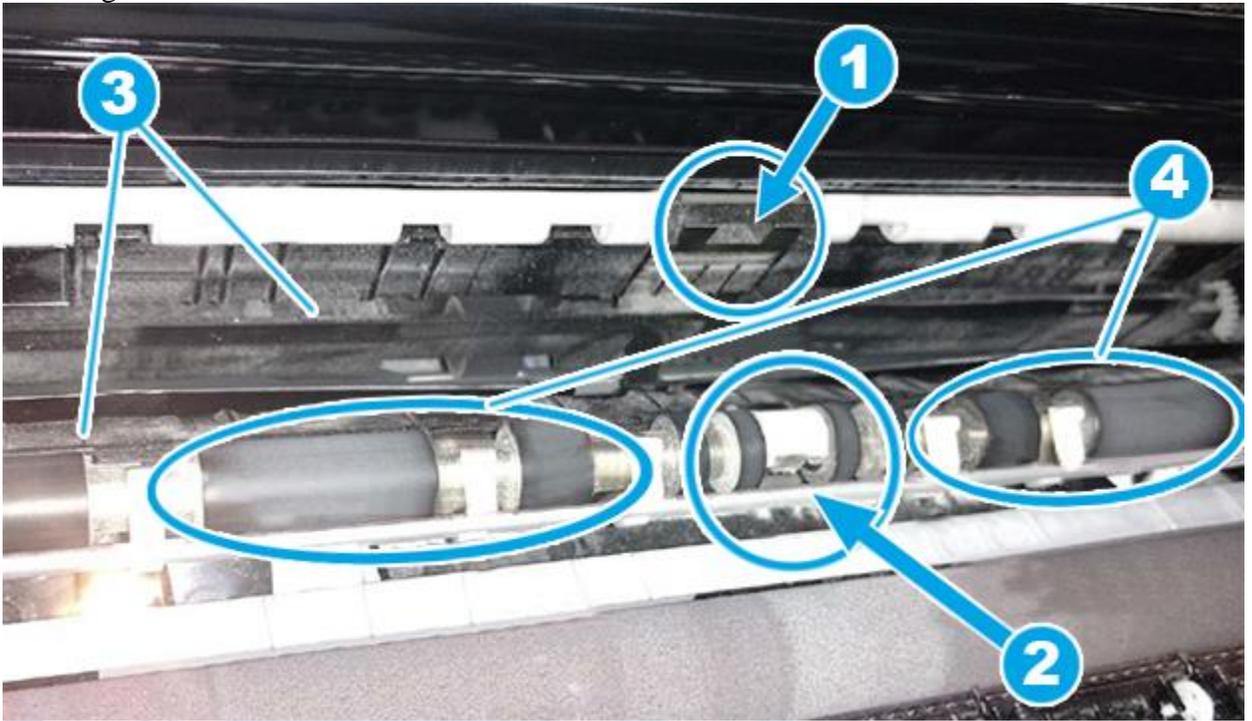

Callout 1: SR2501

Callout 2: Location of media sensor (note the dust on the shaft)

Callout 3: Excessive dust in paper path

Callout 4: Registration rollers are not clean

Area after a thorough cleaning



4. Turn the printer off, and then on.
5. Check the following connectors:
 - (J1904) between the ITB and printer
 - (J119, J118 and J116) on the DC controller PCA
 - (J1824 and J1931) on the CPR/density sensor assembly
6. If the error persists, replace the CPR/density sensor.

Part number: RM2-7026-000CN

7. If the error persists, check the event log for the 10.22.70 code and replace the ITB.
 - If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part or supply under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

ITB part number: RY7-5211-000CN

OR

Transfer and roller kit part number (contains ITB) RY7-5213-000CN

8. Important:
9. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

54.0X.15

Toner level sensor error occurred.

- 54.00.15 — Black
- 54.01.15 — Cyan
- 54.02.15 — Magenta
- 54.03.15 — Yellow

Recommended action

1. Turn the printer off, and then on.
2. Check the “Smart Chip” located on the toner cartridge to make sure it is installed correctly and is not loose.
3. Remove all the cartridges and the ITB, inspect the inside for toner scatter, and then clean the areas with a toner cloth.
4. Vacuum the inside of the printer, especially the back of the printer where the sensors for the cartridges are located.
5. Test the cartridge sensors in the back of the printer.
6. Check the “Light Pipe” at the toner cartridge and the drum cartridge for excessive toner contamination. If excessive toner contamination is observed or blocking, check for one of the following root causes:
 - a. Make sure the internal seal at either the drum or the toner cartridge has been removed.
 - b. Make sure the toner gates are not out of synchronization.
7. If the error persists, replace the toner cartridge or drum cartridge at the same time.
 - Black toner drum part number: CF358A
 - Cyan toner drum part number: CF359A
 - Yellow toner drum part number: CF364A
 - Magenta toner drum part number: CF365A
 - Black toner cartridge part number (M855): CF310A
 - Cyan toner cartridge part number (M855): CF311A
 - Yellow toner cartridge part number (M855): CF312A
 - Magenta toner cartridge part number (M855): CF313A
 - Black toner cartridge part number (M880): CF300A
 - Cyan toner cartridge part number (M880): CF301A
 - Yellow toner cartridge part number (M880): CF302A
 - Magenta toner cartridge part number (M880): CF303A
8. Check the following connectors on the memory tag PCA and make sure the FFCs are not bent or missing a metal connection:
 - Y/M Connectors (J402 and J401)
 - C/K Connectors (J403 and J401)
9. If the error persists, replace the memory tag PCA and the cartridge PCA interface.

Memory tag PCA part number: RM2-7009-000CN

Cartridge PCA interface part number: A2W79-67902

10. If the error persists, replace the DC controller.

For instructions: See the Repair Service Manual for this product.

M855 part number: RM2-7005-000CN

M880 part number: RM2-7006-000CN

54.00.18

The ITB (TOP) sensor malfunctioned.

Recommended action

1. Turn the printer off, and then on.
2. Reconnect the connector (J116) on the DC controller PCA.
3. If the error persists, replace the CPR/density sensor.

Part number: RM2-7026-000CN

54.00.19

The ITB (TOP) sensor abnormality occurred.

Recommended action

1. Turn the printer off, and then on.
2. Reconnect the connector (J116) on the DC controller PCA.
3. If the error persists, replace the CPR/density sensor.

Part number: RM2-7026-000CN

54.06.21 or 54.07.21 (event log only)

Primary laser/scanner beam detected an abnormality.

Secondary laser/scanner beam detected an abnormality.

Recommended action

1. Turn the printer off, and then on.
2. Check for the following possible malfunctions:

- **Laser malfunction of cyan or black:**

Reconnect the connector (J1702) of the scanner motor (C/K), the intermediate connector (J1928), and the connector (J130B) on the DC controller PCA.

- **Laser malfunction of yellow or magenta:**

Reconnect the connector (J1701) of the scanner motor (Y/M), the intermediate connector (J1927), and the connector (J130B) on the DC controller PCA.

3. Replace the laser scanner with the malfunction.

For instructions: See the Repair Service Manual for this product.

For instructions: See the Repair Service Manual for this product.

Part number: RM2-5176-000CN

54.01.05 (event log only)

Media sensor out of range. Media sensor 1 abnormality warning.

Recommended action

1. Check the Supplies Status page to make sure that the toner cartridges are not past their useful life.

Note:

When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

2. Clean the LED emission part of the 2nd transfer assembly with a lint-free cloth. Turn the printer off, and then on.
3. Reconnect the connector (J1955) of the 2nd transfer assembly and connector (J121) on the DC controller PCA.
4. If the error persists, check the event log for active low warning 10.22.70 and replace the 2nd transfer assembly.
 - If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part under warranty.

Part number: RM2-6856-000CN

5. Important:

6. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

54.02.05 (event log only)

Media sensor out of range. Media sensor 2 abnormality warning.

Recommended action

1. Remove the ITB assembly.
2. Clean the media sensor assembly on the ITB assembly with a lint-free cloth.
3. Turn the printer off, and then on.
4. Reinstall the ITB assembly, and then check the connector (J1904) between the ITB assembly and the printer.
5. Reconnect the connector (J116) on the DC controller PCA.
6. If the error persists, check the event log for the 10.22.70 code and replace the ITB.
 - If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
 - If an active low warning is not listed, replace the part or supply under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

ITB part number: RY7-5211-000CN

OR

Transfer and roller kit part number (contains ITB) RY7-5213-000CN

7. Important:
8. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

54.03.05 (event log only)

Media sensor out of range. Media sensor 3 abnormality warning.

Recommended action

1. Remove the ITB assembly.
2. Clean the media sensor on the ITB assembly with a lint-free cloth.
3. Turn the printer off, and then on.
4. Reinstall the ITB assembly, and then check the connector (J1904) between the ITB assembly and the printer.
5. Reconnect the connector (J116) on the DC controller PCA.
6. If the error persists, check the event log for the 10.22.70 code and replace the ITB.

- If a 10.22.70 error is listed, the supply is past very low. Inform the customer that they must order and pay for the replacement.
- If an active low warning is not listed, replace the part or supply under warranty.

For instructions: [Removal and replacement: ITB Transfer roller](#)

ITB part number: RY7-5211-000CN

OR

Transfer and roller kit part number (contains ITB) RY7-5213-000CN

7. Important:
8. When an HP supply has reached the very low threshold, the HP Premium Protection Warranty ends and the customer becomes responsible for the replacement.

54.14.00 (event log only)

CPR sensor abnormality warning.

Recommended action

1. Turn the printer off, and then on.
2. Reconnect the connectors (J1824 and J1931) on the CPR/density sensor assembly and the connectors (J119 and J118) on the DC controller PCA.
3. If the error persists, replace the CPR/density sensor.

Part number: RM2-7026-000CN

55.WX.YZ, 56.WX.YZ error messages

55.* errors

Errors in the 55.* family often indicate a problem with the DC controller.

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Reset the printer:
 - a. Turn the printer off using the power switch, and then wait at least 30 seconds.
 - b. Turn the printer on and wait for it to initialize.
2. Make sure the printer is running the most current version of firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, replace the DC controller.

55.00.01, 55.00.03, or 55.00.04 DC controller error

A DC controller PCA error occurred.

- 55.00.01 (event code)
DC controller memory error.
- 55.00.03 (event code)
DC controller no engine response.
- 55.00.04 (event code)
DC controller communications time-out.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, replace the DC controller.

For instructions: See the Repair Service Manual for this product.

M855 part number: RM2-7005-000CN

M880 part number: RM2-7006-000CN

55.01.06 or 55.02.06 DC controller error

A DC controller PCA error occurred.

The engine is not communicating with the formatter. The communication link between the formatter and the DC controller was lost. This can occur due to a timing error or intermittent connection loss between the formatter and the DC controller.

- 55.01.06 (event code)

NVRAM memory data error warning.

- 55.02.06 (event code)

NVRAM memory access error warning.

Recommended action

1. Turn the printer off, and then on.
2. Check the life remaining on the maintenance kit.
3. Reseat the formatter, DIMMs, and EIO cards.
4. If the error persists, replace the DC controller.

For instructions: See the Repair Service Manual for this product.

M855 part number: RM2-7005-000CN

M880 part number: RM2-7006-000CN

5. If the error persists, replace the formatter.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: Formatter](#)

Part number formatter PCA assembly (M855): A2W77-67902

Part number formatter PCA Assembly (M880): A2W75-67903

Part number formatter PCA Assembly (M855 China/India ONLY): A2W77-67903

Part number formatter PCA Assembly (M880 China/India ONLY): A2W75-67902

56.* errors

Errors in the 56.* family indicate a communication problem with an optional paper tray or other external accessory.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. If any third-party hardware is installed, remove it and try printing again.
3. If an optional paper tray is installed, remove it. Check the connectors on the tray for damage. If the connector is damaged, replace the tray.
4. Reinstall the tray, and make sure it is correctly seated.

56.00.YY Error

An optional paper trays communication error occurred.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, reseal the optional paper trays (HCO and HCI).
3. Check the input connector for damage. If damaged, replace the input connector (drawer connector).

1x550, 3x550 part number: VS1-7257-012CN

3,500/HCI part number: VS1-7258-000CN

57.XX.YZ error messages

57.* errors

Errors in the 57.* family indicate a problem with a fan.

Recommended action for customers

See this support document: [HP LaserJet Enterprise, HP PageWide Enterprise - 57.00.xx Errors](#)

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the printer troubleshooting manual to identify the locations of each fan. Turn the printer off and then on, and listen for noise coming from the area of each fan. Replace any fan that is not making noise.
2. Remove enough parts to access the DC controller or the power supply PCA. Check the connections from each fan to the DC controller or power supply PCA. Reseat them if necessary.
3. With the DC controller or power supply PCA exposed, turn the printer on. Immediately measure the voltage between the connectors for each fan and the DC controller. If the voltage changes from 0V to approximately 24V during the power-on cycle, replace the affected fan. If the voltage remains at 0V, replace the DC controller.

57.00.01 Error To continue turn off then on

Laser/scanner fan (FM-1) malfunction occurred.

Recommended action

1. Turn the printer off, and then on.
2. Reconnect the connector (J1916) of the laser/scanner fan and connector (J134) on the DC controller PCA.
3. Measure the voltage between the connectors (J134-1 and J134-3) on the DC controller PCA immediately after the printer is turned on. If the voltage changes from 0V to approximately 24V, replace the laser/scanner fan.

Part number: RK2-1322-000CN

57.00.02 Error To continue turn off then on

Fuser fan (FM-2) malfunction occurred.

Recommended action

1. Turn the printer off, and then on.
2. Reconnect the connector (J1917) of the fuser fan and connector (J132) on the DC controller PCA.
3. Measure the voltage between the connectors (J132-7 and J132-9) on the DC controller PCA immediately after the printer is turned on. If the voltage changes from 0V to approximately 24V, replace the fuser fan.
4. If the error persists, replace the fuser fan.

Part number: RK2-1378-000CN

57.00.03 Error To continue turn off then on

Cartridge fan (Y/M) (FM-3) malfunction occurred.

Recommended action

1. Turn the printer off, and then on.
2. Measure the voltage between the connectors (J132-4 and J132-6) on the DC controller PCA immediately after the printer is turned on. If the voltage changes from 0V to approximately 24V, or if the error persists, replace the cartridge fan (Y/M).

Part number: RK2-1378-000CN

57.00.04 Error To continue turn off then on

Cartridge fan (C/K) (FM-4) malfunction occurred.

Recommended action

1. Turn the printer off, and then on.
2. Reconnect the connector (J9919) of the cartridge fan (Y/M) and connector (J132) on the DC controller PCA.
3. Measure the voltage between the connectors (J132-1 and J132-3) on the DC controller PCA immediately after the printer is turned on. If the voltage changes from 0V to approximately 24V, or if the error persists replace the cartridge fan (C/K).

57.00.05 Error To continue turn off then on

VOC fan (FM-5) malfunction occurred.

Recommended action

1. Reconnect the connector (J1921) of the VOC fan and connector (J103) on the DC controller PCA.
2. Measure the voltage between the connectors (J103-4 and J103-6) on the DC controller PCA immediately after the printer is turned on. If the voltage changes from 0V to approximately 24V, replace the VOC fan.
3. If the error persists, replace the VOC Fan.

Part number: RM1-3364-000CN

57.00.06 Error To continue turn off then on

Low-voltage power supply fan (FM-6) malfunction occurred.

Recommended action

1. Reconnect the connector (J2) of the low voltage power supply fan.

2. Measure the voltage between the connectors (J2-1 and J2-3) on the DC controller PCA immediately after the printer is turned on. If the voltage changes from 0V to approximately 24V, replace the low voltage power supply (LVPS).

For instructions: See the Repair Service Manual for this product.

Part number: RL1-4003-000CN

3. If the error persists, replace the low voltage power supply (LVPS).

For instructions: See the Repair Service Manual for this product.

Part number: RL1-4003-000CN

57.00.07 Error To continue turn off then on

Cartridge front area cooling fan (FM-7) malfunction occurred.

Recommended action

1. Reconnect the connector (J1934) of the cartridge front area cooling fan and connector (J103) on the DC controller PCA.
2. Measure the voltage between the connectors (J103-1 and J103-3) on the DC controller PCA immediately after the printer is turned on. If the voltage changes from 0V to approximately 24V, or if the error persists, replace the cartridge front area cooling fan.

Part number: RK2-1378-000CN

Note:

The cooling assembly is deep inside the printer and will be difficult to hear.

57.00.08 Error To continue turn off then on

Delivery fan (FM-8) malfunction occurred.

Recommended action

1. Reconnect the connector (J1910) of the delivery fan and connector (J103) on the DC controller PCA.
2. Measure the voltage between the connectors (J103-7 and J103-9) on the DC controller PCA immediately after the printer is turned on. If the voltage changes from 0V to approximately 24V, replace the delivery fan.
3. If the error persists, replace the delivery fan.

Part number: RK2-1382-000CN

57.00.09 Error To continue turn off then on

Fuser edge area cooling fan (rear) (FM-9) malfunction occurred.

Recommended action

1. Reconnect the connector (J9905) of the fuser edge area cooling fan (rear), intermediate connector (J9961), and the connector (J125) on the DC controller PCA.
2. Measure the voltage between the connectors (J125-1 and J125-3) on the DC controller PCA immediately after the printer is turned on.
3. If the voltage changes from 0V to approximately 24V, or if the error persists, replace the rear fuser edge area cooling fan (rear).

Part number: RK2-1378-000CN

57.00.10 Error To continue turn off then on

Fuser edge area cooling fan (front) (FM10) malfunction occurred.

Recommended action

1. Reconnect the connector (J9906) of the fuser edge area cooling fan (front), intermediate connector (J9961), and the connector (J125) on the DC controller PCA.
2. Measure the voltage between the connectors (J125-4 and J125-6) on the DC controller PCA immediately after the printer is turned on. If the voltage changes from 0V to approximately 24V, replace the fuser edge area cooling fan (front).
3. If the error persists, replace the front fuser edge area cooling fan.

Part number: RK2-1378-000CN

57.00.11

FM11 fuser edge area cooling fan (front) FM301/ FM302 duplex fan malfunction occurred.

Recommended action

1. Reconnect the connectors (J1902 and J9946) of the duplex switch back assembly and the connectors (J133 and J128) on the DC controller PCA.
2. If the error persists, replace the duplex switch back assembly.

M855 part number: RM2-0291-000CN

M880 part number: RM2-5061-000CN

57.00.12

FM201 malfunction occurred with the feed area fan.

This fan is located inside of the intermediate paper transportation unit.

Recommended action

1. Remove and reinstall the IPTU.
2. Reconnect the connector (J7008) on the IPTU driver PCA.
3. Measure the voltage between the connectors (J7008-1 and J7008-3) on the IPTU driver PCA immediately after the printer is turned on.
4. If the voltage changes from 0V to approximately 24V, replace the IPTU feed area fan.

Part number: RM1-4394-000CN

5. Replace the IPTU.

Part number: A2W77-67914

58.WX.YZ, error messages

58.* errors

Errors in the 58.* family indicate an electrical problem inside the printer.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.

2. Make sure the printer is connected to a dedicated power outlet and not to a surge protector or other type of extension cord.
3. Check all connections on the DC controller and the power supply. Trace the connections from the DC controller and power supply to the sensors and other components, and reseal them if necessary.
4. If the error persists, replace the DC controller or the power supply.

58.00.02 Environmental sensor malfunction

The printer has experienced an environmental sensor error.

CN1 environment sensor.

Recommended action

1. Turn the printer off, and then on.
2. Reconnect the connector (J9986) of the environment sensor and the connector (J115) on the DC controller PCA.
3. If the error persists, replace the environmental sensor.

Part number: RK2-4811-000CN

4. If the error persists, elevate the case using the Standard Support Process.

58.00.04 Error To continue turn off then on

Low voltage power supply unit malfunction occurred.

Recommended action

1. Turn the printer off, and then on.
2. Determine whether the area the printer is located in is subject to power quality issues. If so, wait for the power to stabilize.
3. Check the connector (J121) on the DC controller PCA.
4. If the error persists and the connector is not damaged, replace the low voltage power supply (LVPS).

For instructions: See the Repair Service Manual for this product.

Part number: RL1-4003-000CN

5. If the error persists, replace the DC controller.

For instructions: See the Repair Service Manual for this product.

M855 part number: RM2-7005-000CN

M880 part number: RM2-7006-000CN

6. If the error persists, elevate the case using the Standard Support Process.

58.0X.04 – 24V Power Supply error

24V power supply error occurred during operation.

- 58.01.04 —24V power supply error during operation.
- 58.02.04 — 24V power supply error during boot or wake.

Recommended action

1. Turn the printer off, and then on.

Note:

This error might be caused by source power-related issues.

Determine if the area where the printer is located has experienced brown outs or is subject to power quality issues.

2. Ensure that the printer is plugged into a dedicated power outlet. Check to see if there are other products on the voltage line which might be drawing power and causing the issue.
3. Check the connector (J121) on the DC controller PCA.
4. If the error persists and the connector is not damaged, replace the low voltage power supply (LVPS).

For instructions: See the Repair Service Manual for this product.

Part number: RL1-4003-000CN

5. If the error persists, elevate the case using the Standard Support Process.

59.WX.YZ error messages

59.* errors

Errors in the 59.* family indicate a problem with one of the motors or with the lifter drive assembly for one of the trays.

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.


1. Turn the printer off, and then on.
2. Check all connections on the main control board of the printer, (DC controller, Engine control board ECB) each motor, and to the paper feeder drive PCA (for an optional paper feeder). Reseat them if necessary.


59.00.01

ITB motor (M1) start up error or ITB motor (M1) abnormal rotational error.

Recommended action

1. Turn the printer off, and then on.
2. Check the connections shown in the following image:

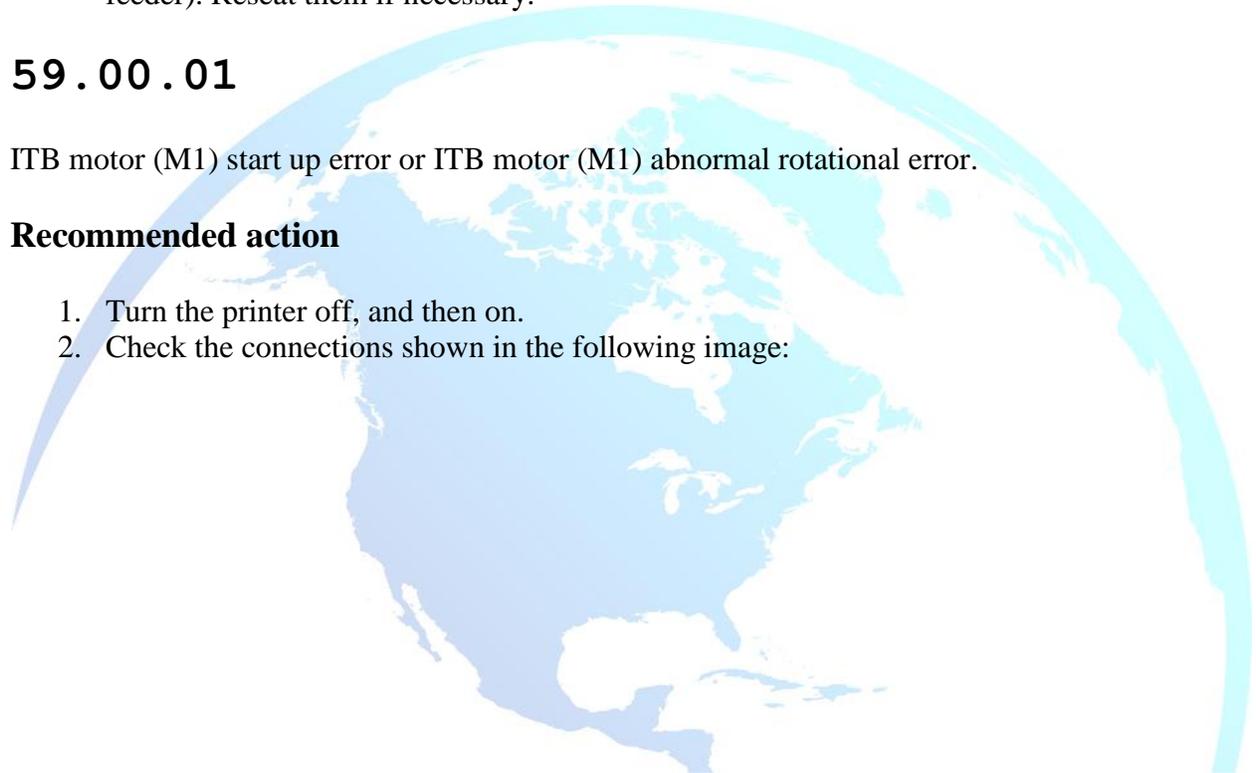

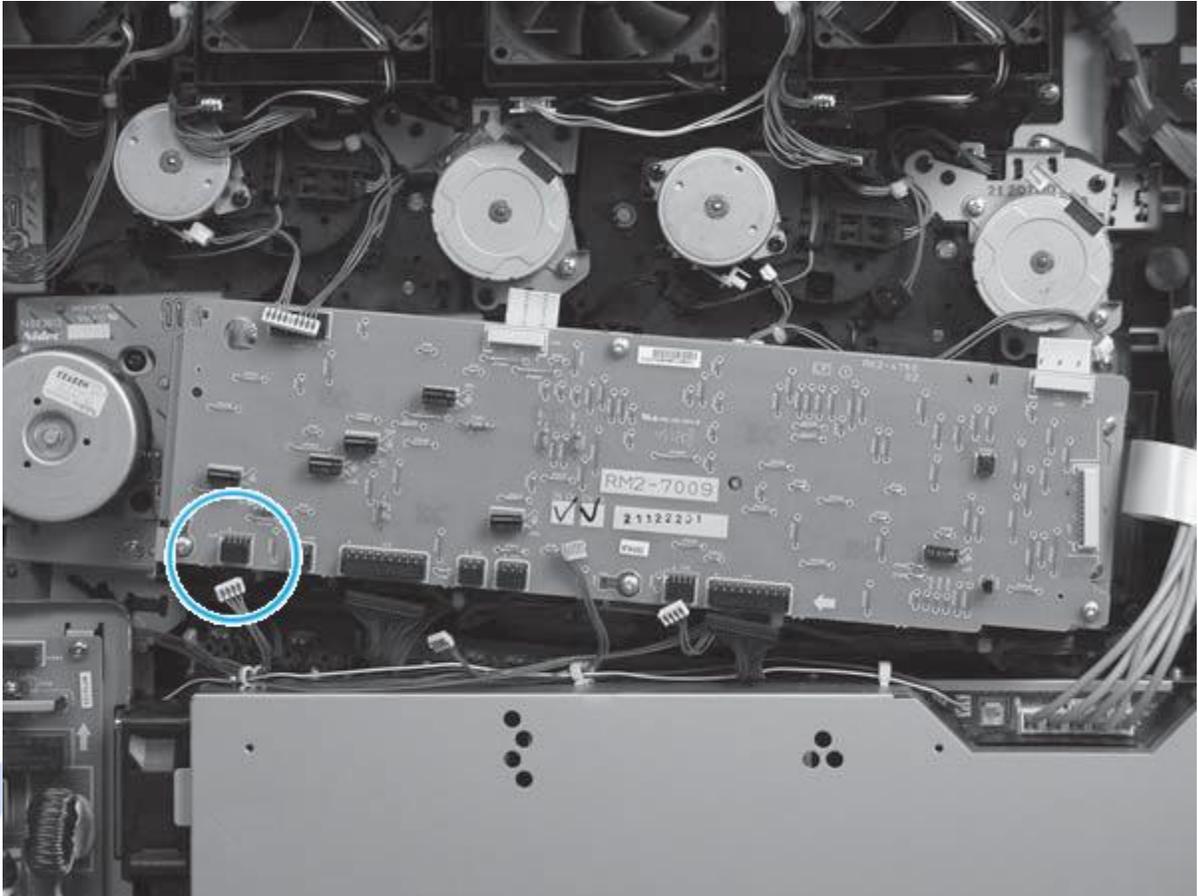

3. Remove the back cover, check the connector (J424) at the memory tag PCA, make sure there are no broken or bent pins, and that the connector is seated correctly.
4. If the error persists, replace the following assemblies:
 - Shutter gear holder assembly (contains the M17 motor that moves the shutters) part number: RM1-9857-000CN
 - Memory tag PCA (controls and contains the (J424) connector) part number: RM2-7009-000CN

59.00.90 or 59.00.A0

ITB motor (M1) start up error or ITB motor (M1) abnormal rotational error.

Recommended action

1. Use the ITB motor (M1) drive test in the component test to verify that the ITB motor is functioning correctly.
2. Check the connector (J1710) on the ITB motor and the connector (J105) on the DC controller PCA, and then test again.
3. If the error persists, replace the ITB motor.

Part number: RM1-4519-000CN

59.00.C0

Developer alienation motor (M18 C/K - M19 Y/M) error.

Recommended action

1. Reconnect the intermediate connector (J1929) of the developer home position sensor and the connector (J131) on the DC controller PCA.
2. Reconnect the connectors (J1718 and J1719) of the developer alienation motor, the connectors (J422 and J425) on the cartridge driver PCA, and the connector (J142) on the DC controller PCA.
3. Perform sensor and drive tests.
 - a. Run the manual sensor test to verify that the developer home position sensor is functioning correctly.
 - b. Run the developer alienation drive test in the actuator drive mode to verify that the developer alienation drive is functioning correctly.
4. If either (or both) test fails, replace the main drive assembly (includes the toner cartridge drive assembly).

Part number: A2W77-67908

59.00.F0

T1 alienation mechanism failure.

Recommended action

1. Run the manual sensor test to verify that the ITB home position sensor is functioning correctly.
2. If the test fails, replace the main drive assembly.

Part number: A2W77-67908

3. Reconnect the connector (J2010) of the ITB home position sensor, the connectors (J423 and J412) on the cartridge driver PCA, and the connector (J142) on the DC controller PCA.
4. Run the T1 roller alienation drive test in the actuator drive mode to verify that the T1 roller alienation drive is functioning correctly.
5. Reconnect the connector (J1716) of the T1 roller alienation motor, the connectors (J421 and J411) on the cartridge driver PCA, and the connector (J141) on the DC controller PCA.
6. If the T1 roller alienation drive test fails, or if the error persists, replace the ITB alienation drive assembly.

Part number: RM1-3280-000CN

59.0X.50 or 59.0X.60

Drum motor startup error.

59.05.50 or 59.05.60 Black

59.06.50 or 59.06.60 Cyan

59.07.50 or 59.07.60 Magenta

59.08.50 or 59.08.60 Yellow

Recommended action

1. Run the drum motor drive test in the actuator drive mode to verify that the drum motor is functioning correctly.
2. If the test fails, reconnect the connector on the drum motor to the connector on the DC controller PCA, and then test again.
 - o Black drum motor connector (J1715) and DC controller PCA connector (J138B).
 - o Cyan drum motor connector (J1714) and DC controller PCA connector (J138B).
 - o Magenta drum motor connector (J1712) and DC controller PCA connector (J138A).
 - o Yellow drum motor connector (J1713) and DC controller PCA connector (J138A).
3. If the error persists, replace the drum motor.

Part number: RM1-9614-000CN

59.0X.70

Developer motor abnormal rotation.

59.05.70 Black (K)

59.06.70 Cyan (C)

59.07.70 Magenta (M)

59.08.70 Yellow (Y)

59.05.70 or 59.06.70

1. Reconnect the connector (J2024) of the toner-replenish motor rotation sensor (C/K), the intermediate connector (J1930), and the connector (J135) on the DC controller PCA.
2. Reconnect the connectors (J426 and J411) on the cartridge driver PCA, the connector (J141) on the DC controller PCA, and the connector (J1721) on the toner-replenish motor (C/K).
3. Replace the toner replenish motor (C/K).

Part number: RK2-4814-000CN

4. Replace the toner cartridge (cyan or black).
 - o Black toner cartridge part number (M855): CF310A
 - o Cyan toner cartridge part number (M855): CF311A
 - o Black toner cartridge part number (M880): CF300A
 - o Cyan toner cartridge part number (M880): CF301A

59.07.70 or 59.08.70

1. Reconnect the connector (J2023) of the toner-replenish motor rotation sensor (Y/M), the intermediate connector (J1929), and the connector (J131) on the DC controller PCA.
2. Reconnect the connectors (J425 and J411) on the cartridge driver PCA, the connector (J141) on the DC controller PCA, and the connector (J1720) on the toner-replenish motor (Y/M).
3. Replace the toner replenish motor (Y/M).

Part number: RK2-4814-000CN

4. Replace the toner cartridge (yellow or magenta).
 - o Yellow toner cartridge part number (M855): CF312A
 - o Magenta toner cartridge part number (M855): CF313A
 - o Yellow toner cartridge part number (M880): CF302A
 - o Magenta toner cartridge part number (M880): CF303A

59.0x.80

Developer motor failure.

59.05.80 Black (K)

59.06.80 Cyan (C)

59.07.80 Magenta (M)

59.08.80 Yellow (Y)

59.05.80 or 59.06.80

1. Reconnect the connector (J2024) of the toner-replenish motor rotation sensor (C/K), intermediate connector (J1930) and connector (J135) on the DC controller PCA.
2. Reconnect the connectors (J426 and J411) on the cartridge driver PCA, the connector (J141) on the DC controller PCA, and the connector (J1721) of the toner-replenish motor (C/K).
3. Replace the toner replenish motor (C/K).

Part number: RK2-4814-000CN

4. Replace the toner cartridge (cyan or black).
 - o Black toner cartridge part number (M855): CF310A
 - o Cyan toner cartridge part number (M855): CF311A
 - o Black toner cartridge part number (M880): CF300A
 - o Cyan toner cartridge part number (M880): CF301A

59.07.80 or 59.08.80

1. Reconnect the connector (J2023) of the toner-replenish motor rotation sensor (Y/M), the intermediate connector (J1929), and the connector (J131) on the DC controller PCA.
2. Reconnect the connectors (J425 and J411) on the cartridge driver PCA, the connector (J141) on the DC controller PCA, and the connector (J1720) of the toner-replenish motor (Y/M).
3. Replace the toner replenish motor (Y/M).

Part number: RK2-4814-000CN

4. Replace the toner cartridge (yellow or magenta).
 - o Yellow toner cartridge part number (M855): CF312A
 - o Magenta toner cartridge part number (M855): CF313A
 - o Yellow toner cartridge part number (M880): CF302A
 - o Magenta toner cartridge part number (M880): CF303A

59.A2.02

Media input source 2 lifter motor malfunction.

Recommended action

1. Run the manual sensor test to verify that the cassette media surface sensor is functioning correctly.
2. If the test fails, make sure the intermediate connector (J1920) and the connector (J112) on the DC controller PCA are securely connected, and then test again.
3. If the error persists, replace the cassette pickup assembly.

Part number: RM1-9599-000CN

4. If the error persists, replace the cassette lifter drive.

Part number: RM1-3222-000CN

59.A3.03

Media input source 3 lifter motor malfunction.

1x500-sheet/3x500-sheet paper deck

1. Run the manual sensor test to verify that the cassette 1 media surface sensor is functioning correctly.
2. If it fails, reconnect the connector (J8122) on the PD controller PCA, and then test again.
3. If the error persists, replace the paper pickup assembly.

Part number: RM2-0275-000CN

4. If the error persists, replace the stepping motor (M112, M122, M132).

Part number: RK2-1331-000CN

3,500-sheet paper deck

1. Run the manual sensor test to verify that the right cassette lift-up media-surface sensor is functioning correctly.
2. If the test fails, reconnect the connector (J3003) on the HCI controller PCA, and then test again.
3. If the error persists, replace the right cassette paper pickup assembly.

Part number: RM1-8869-000CN

4. If the error persists, replace the right cassette lifter drive assembly.

Part number: RM1-8879-000CN

59.A4.04

Media input source 4 lifter motor malfunction.

1x500-sheet/3x500-sheet paper deck

1. Run the manual sensor test to verify that the cassette 2 media surface sensor is functioning correctly.
2. If the test fails, replace the paper pickup assembly.

Part number: RM2-0275-000CN

3. Reconnect the connector (J8122) on the PD controller PCA.
4. If the error persists, replace the stepping motor (M112, M122, M132).

Part number: RK2-1331-000CN

3,500-sheet paper deck

1. Run the manual sensor test to verify that the right cassette lift-up media-surface sensor is functioning correctly.
2. If the test fails, replace the left cassette pickup assembly.

Part number: RM1-8876-000CN

3. If the error persists, reconnect the connector (J3013) on the HCI controller PCA.
4. If the error persists, replace the left lifter drive assembly.

Part number: RM1-8879-000CN

59.A5.05

Media input source 5 lifter motor malfunction.

3x500-sheet paper deck only.

Recommended action

1. Run the manual sensor test to verify that the cassette 3 media surface sensor is functioning correctly.
2. If the sensor test fails, check the connector (J8132) on the DC controller PCA for correct seating and a secure connection, and then test again.
3. If the error persists and the connector is not damaged, replace the cassette 3 pickup assembly.

Part number: RM2-0275-000CN

4. If the error persists, replace the cassette 3 lifter drive assembly.

Part number: RM2-0275-000CN

60.00.0Y, 62.00.00 error messages

60.* errors

Errors in the 60.* family are related to one of the optional trays.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

Note:

You can determine the tray number from the last digit in the error number. For example:

- 60.00.02 or 60.01.02 = Tray 2
 - 60.00.03 or 60.01.03 = Tray 3
1. Open the failing tray and remove all paper from the tray.
 2. Close the tray to check if the error persists.
 3. Reload the paper and test the printer.
 4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Use the Tray/Bin Manual Sensor test to verify that the sensors for each tray are functioning correctly.
2. Check all connectors on the paper feeder PCA.
3. Replace the optional paper feeder.

60.00.02 Tray 2 lifting error

Tray 2 lifter motor error.

Recommended action

1. Run the manual sensor test to verify that the cassette media surface sensor in tray 2 is functioning correctly.
2. If the test fails, make sure the intermediate connector (J1920) and the connector (J112) on the DC controller PCA are securely connected, and then test again.
3. If the error persists, replace the cassette pickup assembly.

Part number: RM1-9599-000CN

4. If the error persists, replace the lifter drive assembly.

Part number: RM1-3222-000CN

60.00.03 Tray 3 lifting error

Tray 3 lifter motor error.

1x500-sheet/3x500-sheet paper deck

1. Run the manual sensor test to verify that the HCI cassette 1 media surface sensor is functioning correctly.
2. If the test fails, reconnect the connector (J8122) on the PD controller PCA, and then test again.
3. If the error persists, replace the cassette 1 pickup assembly.

Part number: RM2-0275-000CN

4. If the error persists, replace the cassette 1 lifter drive assembly.

Part number: RK2-1331-000CN

3,500-sheet paper deck

1. Run the manual sensor test to verify that the HCI right cassette lift-up media-surface sensor is functioning correctly.
2. If the test fails, reconnect the connector (J3003) on the HCI controller PCA, and test again.
3. If the error persists, replace the right cassette paper pickup assembly.

Part number: RM1-8869-000CN

4. If the error persists, replace the right cassette lifter drive assembly.

RM1-8879-000CN

60.00.04 Tray 4 lifting error

Tray 4 lifter motor error.

1x500-sheet/3x500-sheet paper deck

1. Run the manual sensor test to verify that the cassette 2 media surface sensor is functioning correctly.
2. If the test fails, reconnect the connector (J8122) on the PD controller PCA, and then test again.
3. If the error persists, replace the cassette 2 pickup assembly.

Part number: RM2-0275-000CN

4. If the error persists, replace the cassette 2 lifter drive assembly.

Part number: RK2-1331-000CN

3,500-sheet paper deck

1. Run the manual sensor test to verify that the HCI left cassette lift-up media-surface sensor is functioning correctly.
2. If the test fails, reconnect the connector (J3013) on the HCI controller PCA, and then test again.
3. If the error persists, replace the left cassette pickup assembly.

Part number: RM1-8876-000CN

4. If the error persists, replace the left cassette lifter drive assembly.

Part number: RM1-8879-000CN

60.00.05 Tray 5 lifting error

Tray 5 lifter motor error.

3,500-sheet paper deck

1. Run the manual sensor test to verify that the HCI cassette 3 media surface sensor is functioning correctly.
2. If the test fails, reconnect the connector (J8132) on the PD controller PCA, and then test again.
3. If the error persists, replace the cassette 3 pickup assembly.

Part number: RM1-8876-000CN

4. If the error persists, replace the HCI cassette 3 lifter drive assembly.

Part number: RM1-8879-000CN

62.* errors

Errors in the 62.* family indicate a problem with the print engine.

Recommended action for customers

1. Turn the printer off, and then on.

2. Upgrade the firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Check all connectors on the formatter. Reseat them if necessary.
3. Upgrade the printer firmware.
4. If the error persists print the event log from the control panel, or access it from the HP Embedded Web Server (EWS), then elevate the case using the Standard Support Process.

Note:

To access the EWS, open a Web browser, and in the address line, enter the printer IP address.

62.00.00 No system To continue turn off then on

Internal system failure.

Recommended action

1. Turn the printer off, and then on.
2. Reload the firmware.
3. Perform a firmware upgrade.
4. If the error persists, replace the hard disk drive (HDD).

For instructions: [Removal and replacement: HDD](#)

Part number: A2W75-67905

65.W0.AZ error messages

65.* errors

Errors in the 65.* family are related to output accessories.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Verify the output accessory is correctly connected to the printer.
3. If the error persists, replace the output accessory.

65.W0.AZ Output accessory Failure

Output accessory is disconnected.

An external paper handling accessory connection has been interrupted.

- 65.40.A0 : Punch unit is disconnected
- 65.50.A0 : Folding unit is disconnected
- 65.80.A0 : Stapler/Stacker is disconnected
- 65.80.A1 : Stapler/Stacker unit connection was interrupted
- 65.90.A0 : Booklet maker is disconnected

Recommended action

1. Make sure that the latest firmware updates are installed for the printer engine and the finisher.
2. Make sure that the finisher is grounded correctly.
 - Make sure that the finisher is latched and locked to the engine by tightening the thumbscrew inside the front door.
 - Make sure that the grounding-frame assembly (the bar with the wheel located between the engine and the finisher) is in the down position with the wheel touching the floor and that the grounding plate is not damaged.

Note:

The grounding frame assembly is in the up position when the finisher is shipped. It must be lowered when the finisher is installed.

3. Make sure that the communication cable from the finisher to the engine is installed correctly.
4. Make sure that all packing materials have been removed from the paper handling accessory.
5. Check the connectors on the PCAs for damage, correct seating, and secure connection.
6. If the error persists, and none of the previous steps corrected the problem, replace the finisher controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.WX.YZ error messages

66.* errors

Errors in the 66.* family are related to output accessories.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, contact your HP-authorized service or support provider, or contact HP support at www.hp.com/go/contactHP.

1. Turn the printer off, and then on.
2. Verify the output accessory is correctly connected to the printer.
3. If the error persists, replace the output accessory.

66.00.20

Output device failure, over current error.

Recommended action

1. Turn the printer off, and then on.
2. Make sure that the finisher is grounded correctly.
3. If the error persists, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.00.40

NVRAM error occurred.

The checksum for the finisher stacker controller PCA has an NVRAM error when the power is turned on.

Recommended action

1. Turn the printer off, and then on.
2. Make sure that the finisher is grounded correctly.
 - Make sure that the finisher is latched and locked to the engine by tightening the thumbscrew inside the front door.
 - Make sure that the grounding-frame assembly (the bar with the wheel located between the engine and the finisher) is in the down position with the wheel touching the floor and that the grounding plate is not damaged.

Note:

The grounding-frame assembly is in the up position when the finisher is shipped. It must be lowered when the finisher is installed.

3. Turn the printer off, and then on.
4. If the error persists, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

If the original memory chip is no longer available, the chip shipped on the new stacker controller PCA is blank (does not contain the required information) and will continue to cause this error. If the original chip is not available, the following alignment procedures **must** be followed to correctly configure the memory chip on the new PCA:

- Alignment position
- Staple position
- Swing Plate Adjustment

Go to: [HP LaserJet Enterprise M806/M830mfp and Color LaserJet Enterprise M855/M880mfp - Poor Stapling due to misaligned stack in output device](#)

66.00.50

This is a CAN-CPU sequence error.

Recommended action

1. Turn the printer off, and then on.
2. Make sure that the finisher is grounded correctly.
3. If the error persists, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.00.77

Device communication failure. The communication between the print engine and the finisher has been interrupted or lost.

Recommended action

1. Make sure that the latest firmware updates are installed for the engine and the finisher.
2. Make sure that the finisher is grounded correctly.
 - Make sure that the finisher is latched and locked to the engine by tightening the thumbscrew inside the front door.
 - Make sure that the grounding-frame assembly (the bar with the wheel located between the engine and the finisher) is in the down position with the wheel touching the floor and that the grounding plate is not damaged.

Note:

The grounding-frame assembly is in the up position when the finisher is shipped. It must be lowered when the finisher is installed.

3. Make sure that the communication cable from the finisher to the printer is installed correctly.
4. Check the connectors on the stacker controller PCA for damage, correct seating, and secure connection.
5. If the error persists, and none of the previous steps correct the problem, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.00.79

The printer has lost JetLink communication with the output device.

Recommended action

1. Turn off the printer, and then disconnect the finisher.
2. If the error was caused by exchanging finishers while the printer was still on, perform the following steps. If not, skip to the next step.
 - a. Make sure that the finisher is designed to be used with the printer.
 - b. Reconnect the finisher to the printer.
 - c. Turn the printer on.
3. Make sure that the grounding-frame assembly (the bar with the wheel located between the engine and the finisher) is in the down position with the wheel touching the floor and that the grounding plate is not damaged.

Note:

The grounding-frame assembly is in the up position when the finisher is shipped. It must be lowered when the finisher is installed.

4. Reconnect the finisher to the printer.
5. Inspect and reconnect the JetLink cable (power and communication cable) from the finisher to the printer.
6. Turn the printer on.
7. If the error persists, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.00.8Z

There is an issue with paper delivery. The specific message varies depending on the cause, but the solution for each message is the same.

- 66.00.80 : Delivery notice with PageID = 0x00
- 66.00.81 : Delivery notice with proper PageInfo
- 66.00.82 : Paper delivered with unexpected timing
- 66.00.83 : PageInfo (change) without PageInfo (new)

Recommended action

1. Follow the instructions in the control panel help.
2. Turn the printer off, and then on.
3. If the error persists, either downgrade or upgrade the printer's firmware bundle to a firmware level that contains a different output device firmware version from what is currently on the output device. This can be determined by the "Readme" file for the printer's firmware.

Note:

The firmware will not be overwritten on the output device if it has the same output device version of firmware in the new printer firmware being loaded. Since there is no way of knowing if it is a firmware issue on the output device or the printer firmware causing the miscommunication, it is best to make sure that both are changed to a different version so that both are overwritten. If you need to downgrade first and want to have the latest firmware on the devices, you can now upgrade to the latest version.

4. If the error persists, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.12.46

The communication between the stacker-controller board and the saddle-stitcher-controller board is lost or interrupted.

Recommended action

1. Make sure that the finisher is grounded correctly.
 - Make sure that the finisher is latched and locked to the engine by tightening the thumbscrew inside the front door.
 - Make sure that the grounding-frame assembly (the bar with the wheel located between the engine and the finisher) is in the down position with the wheel touching the floor and that the grounding plate is not damaged.

Note:

The grounding-frame assembly is in the up position when the finisher is shipped. It must be lowered when the finisher is installed.

2. Check the wiring at the sensors.
3. Check the connectors (J730 and J22) on the stacker controller PCA and the saddle-stitcher controller PCA for damage, correct seating, and secure connection.
4. Replace the saddle-stitcher controller PCA.

Part number: RM2-7586-000CN

5. If the error persists, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.40.YZ

Punch unit failure. The specific message varies depending on the cause, but the solution for each message is the same.

- 66.40.40 : Punch NVRAM error
- 66.40.46 : Punch slide motor error
- 66.40.50 : Punch unit CPU sequence error. Punch unit micro controller unable to start punch unit
- 66.40.83 : Punch motor failure

Recommended action

1. Follow the instructions in the control panel help.
2. Turn the printer off, and then on.

3. If the error persists, replace the punch controller PCA.

Part number: RM2-7592-000CN

66.50.00

An error has occurred in the folding unit.

Recommended action

1. Follow the instructions in the control panel help.
2. Turn the printer off, and then on.
3. If the error persists, replace the saddle controller PCA.

Part number: RM2-7586-000CN

66.60.16

Stacker gear change motor M110 error.

The speed-change motor M110 and sensor PI117 are associated with this error

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, verify J3 on stacker controller PCA is seated correctly.
3. Replace speed change motor (M110), operation tray assembly.

Part number: RM2-5309-000CN

66.60.25

Stacker shutter motor error.

The shutter home-position sensor (PI113) indicates no change when the stack-ejection motor (M102) is activated for three seconds, indicating the shutter is not moving.

When the shutter clutch (CL101) and stack-ejection lower-roller clutch (CL102) are on, the shutter moves up (closed) when the stack-ejection motor (M102) turns forward and moves down (open, delivery enabled) when the motor turns backwards.

Recommended action

1. Inspect the shutter for damage. If the shutter does not move freely, replace the shutter assembly (upper guide wall).

Part number: RC4-2455-000CN

2. Remove the lower guide (grate-shaped) and check sensor PI113 for damage. If damaged, replace the shutter home position sensor.

Part number: FM2-1401-000CN

3. Make sure that the sensor is securely fastened to the chassis.
4. Check for the correct alignment of the shutter mounted on the back of the grate-shaped lower guide and on the left mechanism on the finisher chassis.
5. Check the connectors (J6 and J19) on the stacker controller PCA for damage, correct seating, and a secure connection.
6. Check CL101 during operation, make sure that it is functioning correctly and that it activates prior to the error. If CL101 does not activate, replace the stack-ejection lower-roller clutch.

Part number: 4H3-0370-000CN

7. If the error persists, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.60.27

Stacker align motor error (front) M103.

The aligning plate either does not leave or it does not return to the aligning-plate front-home-position.

In order to neatly align the paper stack for either stapling or offsetting to take place, the front and rear aligning plates move to align each sheet of paper when it enters the processing tray.

Recommended action

1. Turn the printer off, and then on.
2. Make sure that there is no paper stuck in the jogger assembly.

3. If the error persists, run the component test on each of the alignment motors (M103 and M104).
4. If the motor test fails, check the connector (J4A) on the stacker controller PCA and the intermediate connector (J1032) to the motor (M103).
5. If the error persists and the connectors are not damaged, replace the operation tray assembly.

Part number: RM2-5309-000CN

6. If the error persists, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.60.28

Stacker align motor error (Rear) M104.

The aligning plate either does not leave or it does not return to the aligning-plate front-home-position.

In order to neatly align the paper stack for either stapling or offsetting to take place, the front and rear aligning plates move to align each sheet of paper when it enters the processing tray.

Recommended action

1. Turn the printer off, and then on.
2. Make sure that there is no paper stuck in the jogger assembly.
3. If the error persists, run the component test on each of the alignment motors (M103 and M104).
4. If the motor test fails, check the connector (J4A) on the stacker controller PCA and the intermediate connector (J1032) to the motor (M104).
5. If the error persists and the connectors are not damaged, replace the operation tray assembly.

Part number: RM2-5309-000CN

6. If the error persists, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.60.31

Stapler/Stacker failure. This finisher error occurs when output bin 1 did not activate the home-position sensor (PI116).

This error can occur under one of the following conditions:


- When the output bin 1 motor safety switch is on.
- When the tray 1 lower lift motor (M107) fails.
- When the output bin 1 shift motor (M107) is driven for 20 seconds.
- When output bin 1 does not move when output bin 1 shift motor (M107) is driven for 4 seconds.
- When output bin 1 switch (MSW103) is activated while output bin 1 is operating.

Recommended action

1. Check the output device for any obvious issues.
2. If no issues are noted, check the output bin type that is installed.
 - If the following new counter-measure tray is installed, skip to the next step.
 - If it is not installed, replace the output bin with the new counter-measure tray (stack upper tray assembly).

Part number: RM2-5324-010CN


3. New counter-measure tray

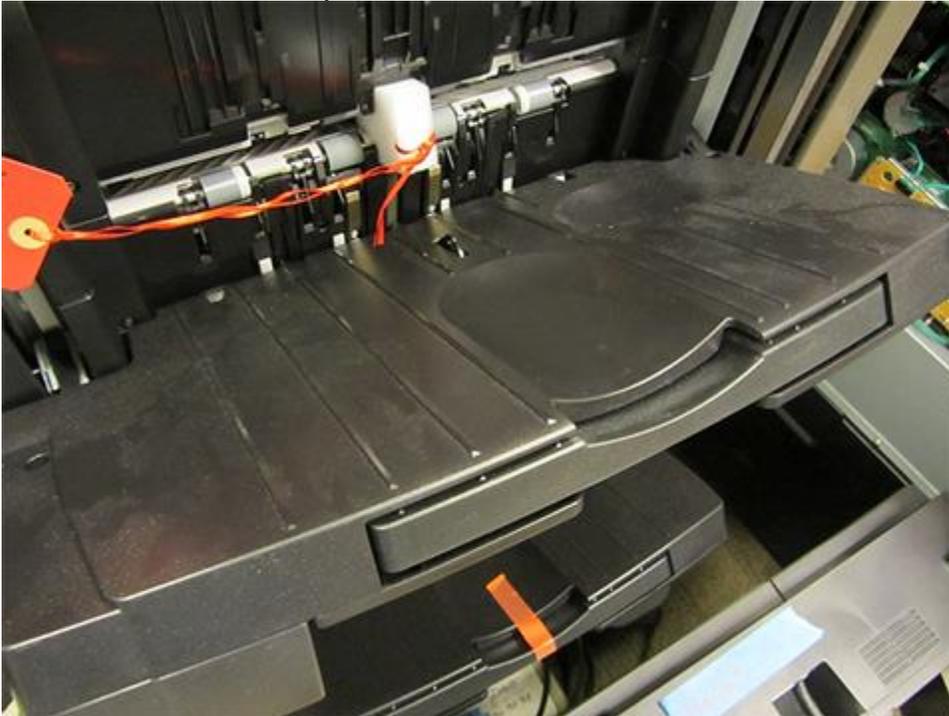

4. Manually release output bin 1, position it at the midpoint of the travel area, and then test to see if the error has cleared.

Note:

Use a small flat-blade screwdriver to slide the raised portion of the clutch toward the spring to release the clutch and lower the bin.

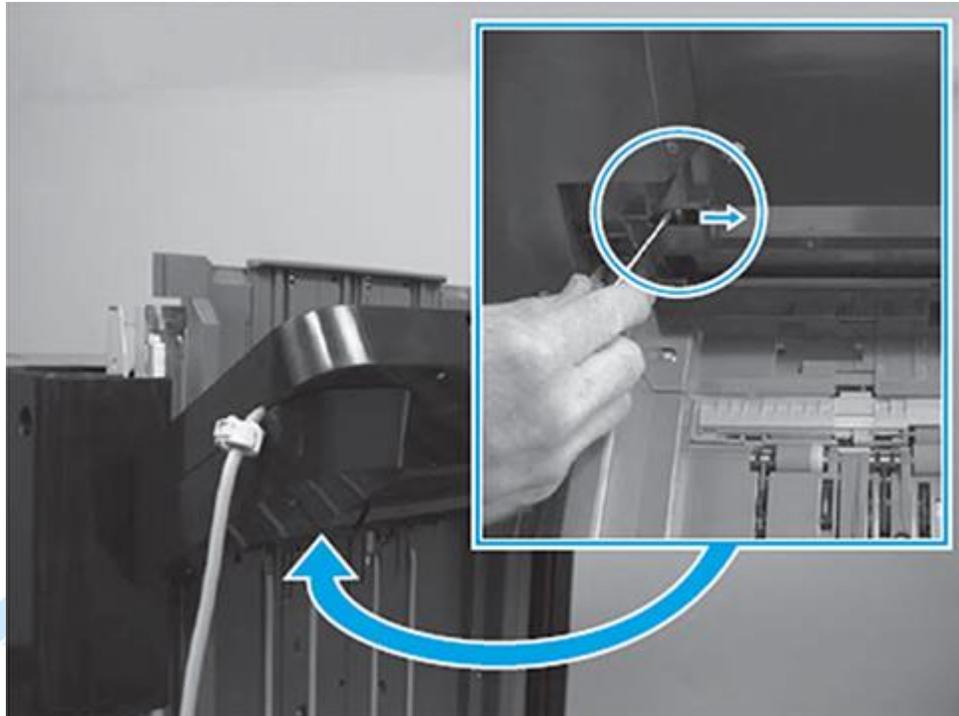

Release bin

5. If the error persists, use the DIP switch (DIPSW) settings on the stacker controller PCA to test the output bin 1 shift motor M107.
6. If the output bin 1 **does not move during the test**, check the output bin tracks for damage, and if damaged, replace the rails.

Part number: FC5-5436-000CN

7. If the output bin 1 **moves during the test**, check the paper-surface sensor flag.
 - a. Make sure the paper-surface sensor flag is installed correctly (especially if it was removed or replaced recently).

Note:

The four tabs under the clips must be inserted into the slots behind the roller shaft of the lower stack ejection roller.

- b. Make sure that the paper-surface sensor flag is not damaged, moves freely, and is aligned correctly with the PI114 sensor body.
- c. Make sure that when the top edge of the output bin engages the sensor arm that the sensor flag moves into the sensor PI114.
- d. Make sure that the sensor is securely fastened to the chassis.
- e. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
- f. Check the wiring at the sensor.
- g. If the error persists, replace sensor PI114.

Part number: 4G3-0934-000CN

8. If the error persists, check the intermediate connectors (J1040 and J7) on the stacker controller PCA for damage, correct seating, and secure connection.
9. If the rails are in good condition, and/or if the error persists, replace the output bin 1 assembly.

Part number: RM2-5324-010CN

Note:

The output bin 1 assembly includes the output bin 1 shift motor (M1070), output bin 1 switch (MSW103), output bin 1 area sensors, and the output bin 1 area sensor PCA.

10. If the error persists, and the previous steps did not correct the problem, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.60.32

Stapler/Stacker failure. This finisher error occurs when output bin 2 did not activate the home-position sensor (PI115).

This error can occur under one of the following conditions:

- When the output bin 2 motor fails.
- When the tray 2 lower lift motor (M108) fails.
- When the output bin 2 shift motor (M108) is driven for 20 seconds.
- When no paper is detected by the output bin 2 paper sensor (PI112).
- When the output bin 2 upper limit is reached by PS983, PS982, PS981 on the tray 2 area sensor PCA.


Recommended action

1. Check the output device for any obvious issues.
2. If no issues are noted, check the output bin type that is installed.
 - If the following new counter-measure tray is installed, skip to the next step.

- If it is not installed, replace the output bin with the new counter-measure tray (stack lower tray assembly).

Part number: RM2-5339-010CN


3. New counter-measure tray

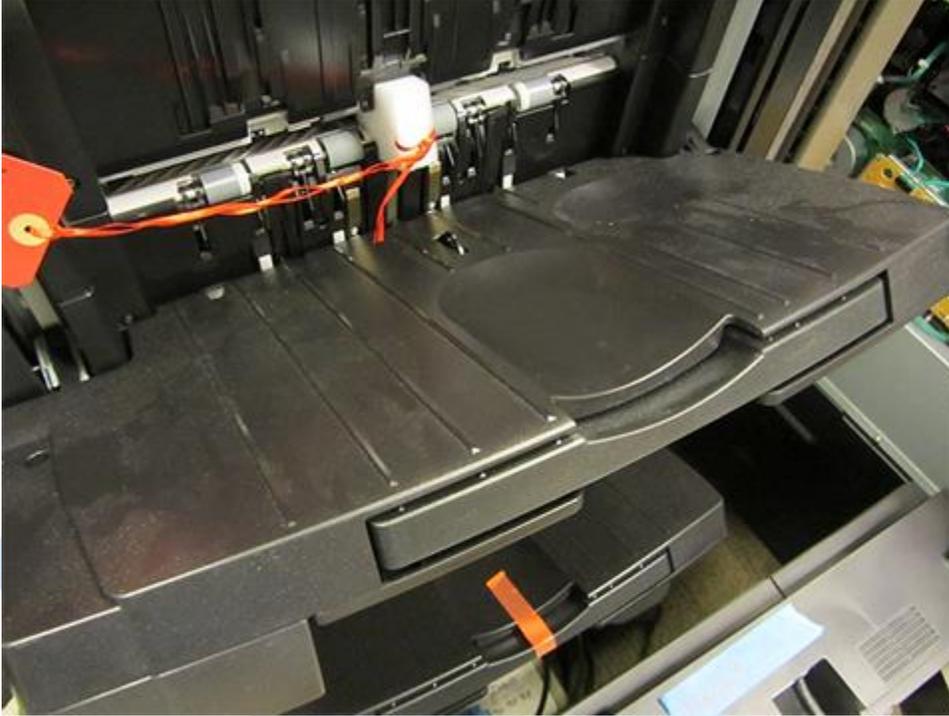

4. Manually release output bin 1, position it at the midpoint of the travel area, and then test to see if the error has cleared. This will release output bin 2.

Note:

Use a small flat-blade screwdriver to slide the raised portion of the clutch toward the spring to release the clutch and lower the bin.

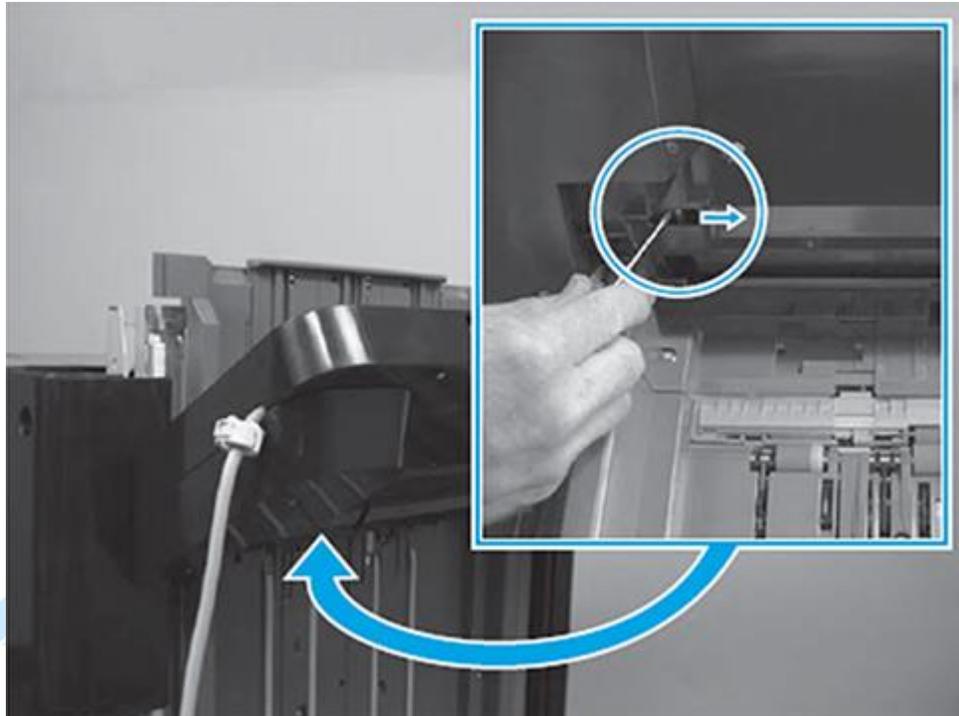

Release bin

5. If the error persists, use the DIP switch (DIPSW) settings on the stacker controller PCA to test the output bin 2 shift motor M108.
6. If the output bin 2 **does not move during the test**, check the output bin tracks for damage, and if damaged, replace the rails.

Part number: FC5-5436-000CN

7. If the output bin 2 **moves during the test**, check the paper-surface sensor flag.
 - a. Make sure the paper-surface sensor flag is installed correctly (especially if it was removed or replaced recently).

Note:

The four tabs under the clips must be inserted into the slots behind the roller shaft of the lower stack ejection roller.

- b. Verify that the paper-surface sensor flag is not damaged, moves freely, and is aligned correctly with the PI115 sensor body.
- c. Verify that when the top edge of the output bin engages the sensor arm that the sensor flag moves into the sensor PI115.
- d. Make sure that the sensor is securely fastened to the chassis.
- e. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
- f. Check the wiring at the sensor.
- g. If the error persists, replace sensor PI115.

Part number: 4G3-0934-000CN

8. If the error persists, check the intermediate connectors (J1040 and J8) on the stacker controller PCA for damage, correct seating, and secure connection.
9. If the rails are in good condition, and/or if the error persists, replace the output bin 2 assembly.

Part number: RM2-5339-010CN

Note:

The output bin 2 assembly includes the output bin 2 shift motor (M108), output bin 2 area sensors, and the output bin 2 area sensor PCA.

10. If the error persists, and the previous steps did not correct the problem, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.60.33

Stapler/Stacker failure. This finisher error occurs when output bin 1 or 2 does not activate the home-position sensor (PI114 or PI115).

This error can occur under one of the following conditions:

- When the stacker-roller lower lift motor (M107) fails.
- When the output bin shift motor (M107 or M108) is driven for 20 seconds.


Recommended action

1. Check the output device for any obvious issues.
2. If no issues are noted, check the bin tray type that is installed.
 - If the following new counter-measure tray is installed, skip to the next step.
 - If it is not installed, replace the output bin with the new counter-measure tray (stack lower tray assembly or stack upper tray assembly).

Output bin 1 (upper) part number: RM2-5324-010CN

Output bin 2 (lower) part number: RM2-5339-010CN


3. New counter-measure tray

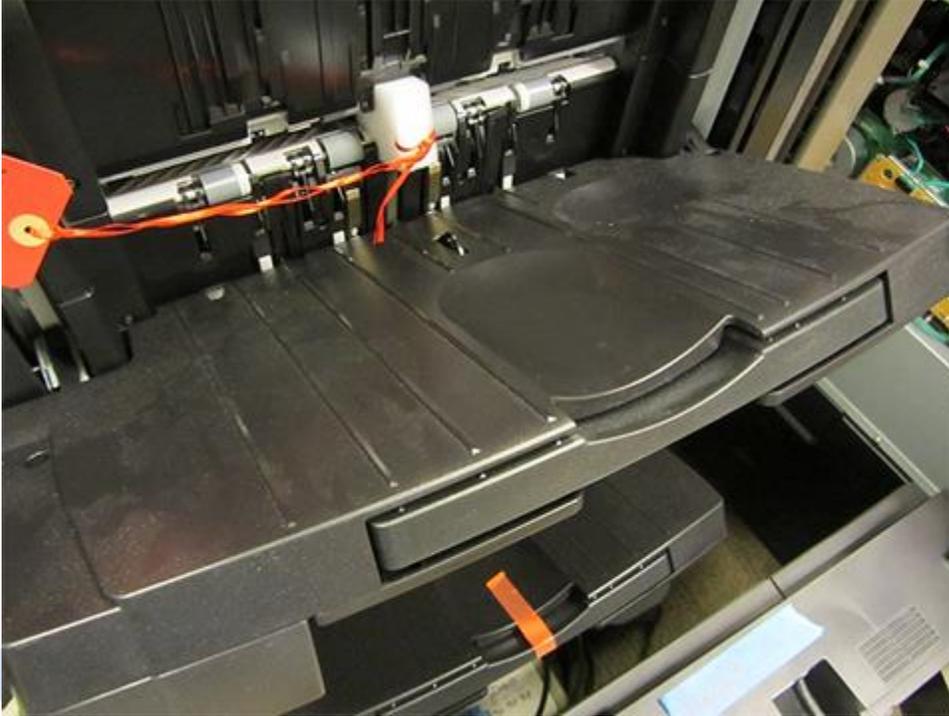

4. If the counter-measure trays were already installed, manually release output bin 1, position it at the midpoint of the travel area, and then test to see if the error has cleared.

Note:

Use a small flat-blade screwdriver to slide the raised portion of the clutch toward the spring to release the clutch and lower the bin.

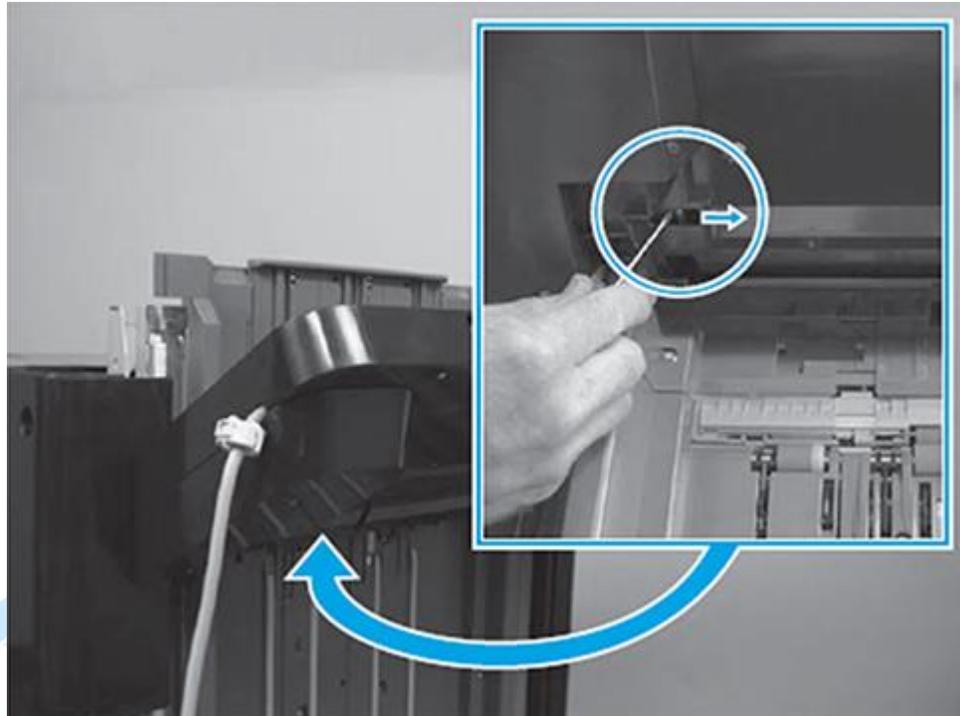

Release bin

5. If the error persists, use the DIP switch (DIPSW) settings on the stacker controller PCA to test the output bin 1 shift motor M107.
6. If the output bin 1 **does not move during the test**, check the output bin tracks for damage and if damaged, replace the rails.

Part number: FC5-5436-000CN

7. If the output bin 1 **moves during the test**, check the paper-surface sensor flag.
 - a. Make sure that the paper-surface sensor flag is installed correctly (especially if it was recently removed or replaced).

Note:

The four tabs under the clips must be inserted into the slots behind the roller shaft of the lower stack ejection roller.

- b. Make sure that the paper-surface sensor flag is not damaged, moves freely, and is aligned correctly with the sensor body.
- c. Make sure that when the top edge of the output bin engages the sensor arm that the sensor flag moves into the sensor (PI114 or PI115).
- d. Make sure that the sensor is securely fastened to the chassis.
- e. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
- f. Check the wiring at the sensor.
- g. If the error persists, replace the sensor assembly.

Part number: 4G3-0934-000CN

8. If the error persists, check the intermediate connectors on the stacker controller PCA for damage, correct seating, and secure connection.
9. If the error persists, replace the output bin stack assemblies.

Output bin 1 (upper) part number: RM2-5324-010CN

Output bin 2 (lower) part number: RM2-5339-010CN

10. If the error persists, and the previous steps did not correct the problem, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.60.34

Stacker assist motor error.

In order to improve stacking performance when ejecting copies, a trailing-edge assist guide is used in addition to the stack-ejection roller to support the rear end of the stack during stack ejection.

The error occurs when the stacker trailing-edge guide does not leave the home position (PI109) after the stack trailing-edge motor (M109) has been turned on for three seconds.

Recommended action

1. Use the DIP switch (DIPSW) settings on the stacker controller PCA to test the trailing edge motor M109 (stack trailing-edge assist motor).
2. If the test fails, check the connector (J4) between the stacker controller PCA and the operation tray assembly, and then test again.
3. If the test fails and the connector is not damaged, replace the operation tray assembly.

Part number: RM2-5309-000CN

4. Use the DIP switch (DIPSW) settings on the stacker controller PCA to test the PI109 sensor.
5. If the test fails, replace the assist sensor assembly.

Part number: FM2-1396-000CN

6. If the error persists, replace the stack lower tray assembly (Tray 2).

Part number: RM2-5339-010CN

7. If the error persists, and none of the previous steps corrected the problem, replace the stacker unit.
 - Stapler/Stacker part number: A2W80-67901
 - Stapler/Stacker 2/4 hole punch part number: A2W82-67901
 - Booklet maker with finisher part number: A2W83-67901
 - Booklet maker/Finisher with 2/3 hold punch part number: A2W84-67901
 - Booklet maker/Finisher with 2/4 hold punch part number: CZ999-67901

66.60.48

Stacker-CPU communication error.

The finisher's stacker controller PCA has had an internal communication problem between the two processors on the board.

Recommended action

1. Make sure that the finisher is grounded correctly.
2. Ensure that the finisher is latched and locked to the engine by tightening the thumbscrew inside the front door.
3. Ensure that the grounding frame assembly (the bar with the wheel located between the engine and the finisher) is in the down position with the wheel touching the floor.

66.60.50

Stacker-CPU sequence error.

The finisher's stacker controller PCA has had an internal sequence problem.

Recommended action

1. Make sure that the finisher is grounded correctly.
2. Ensure that the finisher is latched and locked to the engine by tightening the thumbscrew inside the front door.
3. Ensure that the grounding-frame assembly (the bar with the wheel located between the engine and the finisher) is in the down position with the wheel touching the floor.

66.80.01

The finisher experienced a Y-align malfunction.

In order to neatly align the paper stack for either stapling or offsetting to take place, the front and rear aligning plates move to align each sheet when it enters the processing tray.

The aligning plate either did not leave the home position or when it did, it did not return to the aligning-plate front-home-position sensor.

Recommended action

1. Turn the printer off, and then on.
2. Make sure that there is no paper stuck in the jogger assembly.
3. If the error persists, run the component test on each of the alignment motors (M103 and M104).
4. If the motor test fails, check the connector (J4A) on the stacker controller PCA and the intermediate connector (J1032) to the motors.
5. If the error persists and the connectors are not damaged, replace the operation tray assembly.

Part number: RM2-5309-000CN

6. If the error persists, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.80.02

The finisher experienced a jogger malfunction.

In order to neatly align the paper stack for either stapling or offsetting to take place, the front and rear aligning plates move to align each sheet when it enters the processing tray.

The aligning plate either did not leave the home position or when it did, it did not return to the aligning-plate front-home-position sensor.

Recommended action

1. Turn the printer off, and then on.
2. Make sure that there is no paper stuck in the jogger assembly.

3. If the error persists, run the component test on each of the alignment motors (M103 and M104).
4. If the motor test fails, check the connector (J4A) on the stacker controller PCA and the intermediate connector (J1032) to the motors.
5. If the error persists and the connectors are not damaged, replace the operation tray assembly.

Part number: RM2-5309-000CN

6. If the error persists, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.80.03

The finisher experienced a stapler mobility motor M105 malfunction.

Recommended action

1. Use the finisher component test (DIPSW) to test the upper stapler-shift motor M105.
2. If the stapler unit moves correctly, skip to the next step. If the stapler unit does not move correctly or moves erratically, perform the following steps:
 - a. Check the flat-flexible cable (FFC) for damage (dents, folds, and/or tears).
Replace the FFC as needed.

Part number: 4G3-1777-000CN

- b. Check the FFC connectors and cable mounting areas.
3. Use the finisher component test (DIPSW) to test the stapler-shift home-position sensor PI110.
4. If the sensor does not change state when the stapler unit is moved from the home position, perform the following steps:
 - a. Make sure that the sensor is securely fastened to the chassis.
 - b. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
 - c. Check the wiring at the sensor.
5. If the error persists, check the connectors (J5 and J6) on the stacker controller PCA for correct seating and secure connection.
6. If the error persists and the connectors are not damaged, replace the stapler assembly.

Part number: 4G3-0938-000CN

Note:

The stapler assembly includes the stapler-shift home position sensor PI110, stapler unit, shift-position-plate assembly, and the flat-flexible cable (FFC).

66.80.21

Lift up malfunction occurred.

Recommended action

Turn the printer off, and then on.

66.80.22

A lift down malfunction occurred.

Recommended action

Turn the printer off, and then on.

66.80.23

A lift sensor malfunction occurred.

Recommended action

Turn the printer off, and then on.

66.80.33

An output roller malfunction occurred.

Recommended action

Turn the printer off, and then on.

66.80.35

The finisher had a malfunction when self-priming.



Recommended action

Turn the printer off, and then on.

66.80.36

The stapler/stacker upper-stapler motor (M41) failed.

The stapler did not leave the stapler home position (PI120) after the staple motor (M41) is driven for 0.4 seconds, or it does not return to the stapler home position after the staple motor has detected a motor-lock condition and the motor is driven backwards for 0.4 seconds, attempting to return to the home position.

The stapler-safety switch (MS103) assures that the stapler motor (M41) is disabled when it senses a finger might be in the stapler.

Recommended action

1. Use the DIP switch (DIPSW) settings on the stacker controller PCA to test the upper stapler-shift motor M41.
 - o If the stapler unit moves correctly, skip to the next step.
 - o If the stapler unit does not move correctly or moves erratically, perform the following steps:
 - c. Check the flat-flexible cable (FFC) for damage (dents, folds, and/or tears). Replace the FFC if needed.

Part number: 4G3-1777-000CN
 - d. Check the FFC connectors and cable mounting areas.
2. Use the DIP switch settings on the stacker controller PCA to test the stapler-shift home-position sensor PI120.
3. If the sensor does not change state when the stapler unit is moved from the home position, perform the following steps:
 - . Make sure that the sensor is securely fastened to the chassis.
 - a. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
 - b. Check the wiring at the sensor.
4. If the error persists, check the connector (J5) on the stacker controller PCA for correct seating and secure connection.
5. If the error persists, replace the stapler assembly.

Part number: 4G3-0938-000CN

Note:

The stapler assembly includes the stapler-shift home position sensor PI120, stapler unit, shift-position-plate assembly, and the flat-flexible cable (FFC).

66.80.38

A stacker stapler mechanism failed.

The stapler-alignment-interference sensor (PI116) activated, signaling that the stapler unit is not in the correct position for stapling to occur. This is to prevent damage to stapler from occurring when stapler is positioned over one of the three stoppers when the signal to staple has been sent.

Recommended action

1. Use the DIP switch (DIPSW) settings on the stacker controller PCA to test M41 and verify that the upper stapler-shift motor moves correctly.
 - o If the stapler unit moves correctly, skip to the next step.
 - o If the stapler unit does not move correctly or moves erratically, perform the following steps:
 - c. Check the flat-flexible cable (FFC) for damage (dents, folds, and/or tears). Replace the FFC if needed.

Part number: 4G3-1777-000CN
 - d. Check the FFC connectors and cable mounting areas.
2. If the stacker controller PCA was recently replaced, adjust the staple alignment and staple position.
3. If the stapler is not positioned over a stopper when this error occurs, perform the following steps:
 - . Make sure that the stapler unit is mounted correctly and securely fastened to the base.
 - a. Make sure that the sensor is not obstructed or damaged. Make sure that the sensor flag is not damaged, moves freely, and is aligned correctly with the sensor body.
 - b. If the error persists, replace the stapler subassembly.

Part number: 4G3-0939-000CN

Note:

The stapler subassembly includes the stapler unit and base.

66.80.46

A stacker upper stapler shift motor failure (M105) error.

This error can occur under one of these conditions:

- The stapler did not leave the stapler-shift home-position sensor (PI110) after the stapler-shift motor (M105) has driven for five seconds.
- When the stapler fails to return to the stapler-shift home-position sensor (PI110) after the stapler-shift motor (M105) has driven for 20 seconds.

Recommended action

1. Use the DIP switch settings on the stacker controller PCA to test the upper stapler-shift motor M105.
 - o If the stapler unit moves correctly, skip to the next step.
 - o If the stapler unit does not move correctly or moves erratically, perform the following steps:
 - a. Check the flat-flexible cable (FFC) for damage (dents, folds, and/or tears). Replace the FFC if needed.

Part number: 4G3-1777-000CN
 - b. Check the FFC connectors and cable mounting areas.
2. Use the DIP switch settings on the stacker controller PCA to test the stapler-shift home-position sensor PI110.
 - o If the stapler unit moves correctly, skip to the next step.
 - o If the sensor does not change state when the stapler unit is moved from the home position, perform the following steps:
 - a. Make sure that the sensor is securely fastened to the chassis.
 - b. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
 - c. Check the wiring at the sensor.
3. If the error persists, check the connectors (J6 and J1040) on the stacker controller PCA for damage, correct seating, and secure connection.
4. If the error persists, replace the stapler assembly.

Part number: 4G3-0938-000CN

Note:

The stapler assembly includes the stapler-shift home position sensor PI110 stapler unit, shift-position-plate assembly, and the flat-flexible cable (FFC).

66.80.5X

66.80.5X System error (firmware error) including the following error codes:

- 66.80.51 System error (firmware error)
- 66.80.55 System error 5 (firmware error)
- 66.80.56 System error 6 (firmware error)
- 66.80.57 System error 7 (firmware error)

- 66.80.58 System error 8 (firmware error)
- 66.80.59 System error 9 (firmware error)

Recommended action

Turn the printer off, and then on.

66.80.60

System error 10 (inter-page delay mismatch).

Recommended action

Turn the printer off, and then on.

66.80.61

System error 11 (lifter task trouble).

Recommended action

Turn the printer off, and then on.

66.80.62

System error 12 (inter-page delay mismatch).

Recommended action

Turn the printer off, and then on.

66.80.63

System error 13 (firmware error).

Recommended action

Turn the printer off, and then on.

66.80.64

System error 14 (firmware error).



Recommended action

Turn the printer off, and then on.

66.80.65

System error 15 (firmware error).

Recommended action

Turn the printer off, and then on.

66.80.70

Page-info in flush.

Recommended action

Turn the printer off, and then on.

66.80.71

Flush request in PDLV.

Recommended action

Turn the printer off, and then on.

66.80.72

Delivery notice error occurred.

Recommended action

Turn the printer off, and then on.

66.80.73

Flush request in checking paper path.

Recommended action

Turn the printer off, and then on.



66.80.74

Checking paper path start in PDLV.

Recommended action

Turn the printer off, and then on.

66.80.75

Flush request in flush.

Recommended action

Turn the printer off, and then on.

66.80.76

Non-flush complete.

Recommended action

1. Follow the instructions on the control panel.
2. Turn the printer off, and then turn it on.

66.90.10

A booklet interlock switch error occurred.

There are three switches in the booklet-maker finisher: SW1 (the saddle-guide switch also known as the inlet-door switch), SW3 (the booklet-ejection-door switch), and MS31 (the front-door switch). The stapler/stacker finisher only has one switch, MS31 for the front door of the finisher. All three switches detect if the associated door or guide plate is open or closed. Each one of the switches also has a sensor (SW1/PI9, SW3/PI3, and MS31/PI102) that acts as a backup and detects the same information as the switches.

The error occurs when all the doors and guides are closed and there is a mismatch in readings between the sensors and the switches. For example, the front door finisher door is closed, PI102 senses the door is closed, but MS31 senses the door is still open.

Associated finisher door and guide switches and sensors are as follows:

- Saddle-guide switch SW1 and saddle-guide sensor PI9.
- Booklet-ejection-door switch SW3 and booklet-ejection-door sensor PI3.

- Front-door switch MS31 and front-door sensor PI102.

Recommended action

1. Use the DIP switch settings on the stacker controller PCA to test the following sensors and isolate which switch and sensor is causing the error.
 - SW1/PI9
 - SW3/PI3 (MSW3)
 - MS31/PI102 (MSW101)
2. If a sensor test fails, perform the following steps:
 - a. Check the following sensor connectors for correct seating and secure connection:
 - Stack controller PCA
 - J719 (MS31)
 - J707 (PI102)
 - Saddle-stitcher controller PCA
 - J4 (SW1)
 - J10 (PI9)
 - J4 (SW3)
 - J11 (PI3)
 - b. Check the wiring at the switches and sensors.
 - c. Make sure that the sensors are securely fastened to the chassis.
 - d. Clean the sensors by gently blowing clean air into the sensor to remove dust and debris.
 - e. Test the sensor(s) again.
3. If the sensor test fails again and the connectors are not damaged, replace the part with the damaged sensor or switch.
 - If the **SW1/PI9** saddle-guide switch (inlet-door switch) and saddle-guide sensor is damaged, replace the photo interrupter.

Part number: WG8-5593-000CN
 - If the **SW3/PI3** (MSW3) booklet-ejection-door switch and booklet-ejection-door sensor is damaged, replace the Delivery door switch or Delivery switch mount assembly.

Part number: RM2-5633-000CN
 - If the **MS31/PI102** (MSW101) front-door detection switch and front cover open/close sensor is damaged, replace the Sensor switch assembly.

Part number: FM2-1417-000CN
4. If the error persists, check the tabs that activate the switches and sensors on the doors and guides, and then make sure that they are aligned correctly with the switches and sensors. If not, or if the tabs are damaged, replace the door or the cover.

- If the **SW1/PI9** inlet door or inlet cover is damaged, replace the Inner upper cover assembly.

Part number: RM2-5305-000CN

- If the **SW3/PI3** (MSW3) booklet-ejection door (delivery door) is damaged, replace the Inner lower cover assembly.

Stapler/Stacker part number: RC4-2474-000CN

Booklet maker part number: RM2-5304-000CN

- If the **MS31/PI102** (MSW101) front cover is damaged, replace the Front door assembly.

Stapler/Stacker part number: A2W80-67903

Booklet maker part number: A2W84-67903

5. If the error persists, replace the PCA (stacker controller PCA or saddle-stitcher controller PCA) that is associated with the failed switch/sensor.

Saddle-stitcher controller PCA part number: RM2-7586-000CN

Stacker controller part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.90.29

A booklet staple motor error (rear) occurred.

The booklet-maker stitch-staplers do not move to different locations in relation to the paper like the main stapler. The only movement is through the movement of the rotary cam located on the stapler unit, during the actual stapling of the booklet. The stitch-home-position switch (SW5) is part of the rear-stitch stapler unit and senses the stapler opening and closing during stapling by the motion of the rotary drive cam. Like SW5, the stitch motor (M6) is also part of the overall stitch stapler unit and replacement requires the replacement of the saddle-stapler assembly.

This error can occur under one of these conditions:

- When the rear booklet-maker-stapler stitching-home-position sensor (SW5) does not turn off when the stitch motor (rear) (M6) has driven forward for 0.5 seconds.

Recommended action

1. Check the rear-stitch stapler unit for jammed or loose staples, and clear any jammed staples.
2. Make sure that HP-approved staples are in use and retest the stapler.
3. If the error persists, replace the staple cartridge.

Part number: CF367-67914

Note:

Replace both the front and rear cartridges at the same time so that the staple low sensors will detect the level of staples in the cartridges.

4. If the error persists, check the staple unit for damage, and verify that the wiring at the front of the saddle-stitch stapler and the saddle-stapler assembly are not damaged, and correct the seating.
5. If no damage is found, skip to the next step. If the staple unit is damaged, replace the saddle-stapler assembly.

Part number: RM2-6269-000CN

Part description: Saddle Stapler Assembly

6. Retest the stapler.
7. If the error persists, perform the following steps:
 - a. Check the connector (J8) on the saddle-stitcher controller PCA for correct seating and secure connection.
 - b. Make sure that the connector inside the finisher that engages with the saddle-stitch-stapler assembly is not damaged and remove any foreign material.
 - c. Make sure the saddle-stitch-stapler assembly is seated correctly.
 - d. Retest the stapler.
8. If the error persists, replace the saddle-stitcher controller PCA.

Part number: RM2-7586-000CN

66.90.30

A booklet staple motor error (front) occurred.

The booklet-maker stitch-staplers do not move to different locations in relation to the paper like the main stapler. The only movement is through the movement of the rotary cam located on the stapler unit, during the actual stapling of the booklet. The stitch-home-position switch (SW7) is

part of the front-stitch stapler unit and senses the stapler opening and closing during stapling by the motion of the rotary drive cam. Like SW7, the stitch motor (M7) is also part of the overall stitch stapler unit and replacement requires the replacement of the saddle-stapler assembly.

This error can occur under one of these conditions:

- When the front booklet-maker-stapler stitching-home-position sensor (SW7) does not turn on when the stitch motor (front) (M7) has driven forward for 0.5 seconds.
- When the front booklet-maker-stapler stitching-home-position sensor (SW7) does not turn off when the stitch motor (front) (M7) has driven forward for 0.5 seconds.

Recommended action

1. Check the front-stitch stapler unit for jammed or loose staples, and clear any jammed staples.
2. Make sure that HP-approved staples are in use and retest the stapler.
3. If the error persists, replace the staple cartridge.

Part number: CF367-67914

Note:

Replace both the front and rear cartridges at the same time so that the staple low sensors will detect the level of staples in the cartridges.

4. If the error persists, check the staple unit for damage, and verify that the wiring at the front of the saddle-stitch stapler and the saddle-stapler assembly are not damaged, and correct the seating.
5. If no damage is found, skip to the next step. If the staple unit is damaged, replace the saddle-stapler assembly.

Part number: RM2-6269-000CN

Part description: Saddle Stapler Assembly

6. Retest the stapler.
7. If the error persists, perform the following steps:
 - a. Check the connector (J8) on the saddle-stitcher controller PCA for correct seating and secure connection.
 - b. Make sure that the connector inside the finisher that engages with the saddle-stitch-stapler assembly is not damaged and remove any foreign material.
 - c. Make sure the saddle-stitch-stapler assembly is seated correctly.
 - d. Retest the stapler.
8. If the error persists, replace the saddle-stitcher controller PCA.

Part number: RM2-7586-000CN

66.90.41

A booklet nip paper-fold motor (M2) occurred.

The paper-fold motor (M2), which is located in the booklet making area of the finisher, drives the rotation of the folding rollers to create desired fold in the paper.

This error can occur under one of these conditions:

- When the number of pulses by the paper-fold-motor clock sensor (PI4) is less than the expected standard value.
- When the status of the paper-fold home-position sensor (PI21) does not change when the paper-fold motor (M2) has driven for three seconds.

Recommended action

1. Check the area around the folding rollers for a jam.
2. Use the DIP switch settings on the stacker controller PCA to test the paper-fold motor M2.
3. If the folding rollers **rotate correctly**, perform the following steps:
 - a. Check sensor PI4 and sensor PI21 for damage.
 - b. Make sure that the sensor flags are not damaged, move freely, and are aligned correctly with the PI48 and PI21 sensor bodies.
 - c. Make sure that the sensors are securely fastened to the chassis.
 - d. Carefully clean each sensor body with a clean, lint-free cloth, or gently blow clean air across each sensor to remove dust and debris.
 - e. Check the connectors (J3 and J18) on the saddle-stitcher controller PCA for damage, correct seating, and a secure connection.
 - f. Check the wiring at the PI4 and PI21 sensors.
 - g. If the error persists, replace the motor mount assembly (contains sensor PI4).

Part number: FM0-1686-000CN

4. If the folding rollers **do not rotate correctly**, perform the following steps:
 - a. Check the folding-roller gears and connecting gears between the paper-fold motor M2 and the folding rollers for damage, and replace the gears if needed.
 - b. Check the folding rollers for wear and damage, and replace the rollers if needed.
 - c. If the error persists, replace the motor-mount assembly.

Part number: FM0-1686-000CN

Note:

The motor-mount assembly includes the paper-fold motor M2 and the paper-fold motor-clock sensor PI4.

5. If the error persists, replace the saddle-stitcher controller PCA.

Part number: RM2-7586-000CN

66.90.42

A booklet paper-positioning-plate motor (M4) error occurred.

The paper-positioning-plate motor (M4), located in the booklet making area of the finisher, controls the up and down positioning of the stacked paper for stitch stapling and folding.

This error can occur under one of these conditions:

- When the paper-positioning-plate home-position sensor (PI7) does not turn on when the paper-positioning-plate motor (M4) has driven for 1500 pulses.
- When the paper-positioning-plate home-position sensor (PI7) does not turn off when the paper-positioning-plate motor (M4) has driven for 300 pulses.

Recommended action

1. Use the DIP switch settings on the stacker controller PCA to test the paper-positioning-plate motor M4.

During the test, observe the movement of the booklet-maker-guide plate, and make sure it is not obstructed or damaged.

2. Remove the booklet-maker output bin to gain access to the paper-position-plate home-position sensor PI7 and delivery door.
3. Remove the plate that holds PI7, and then carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
4. Make sure that the sensor is securely fastened to the plate.
5. Check the wiring at the sensor.
6. If the error persists, replace sensor PI7 and the positioning-plate assembly together.
7. If the error persists, replace the stacker controller PCA.

Part number: RM2-7582-000CN

Important:

Any time the stacker controller PCA is replaced, the memory chip containing the finisher's settings **must** be removed and transferred from the old board to the new board. When doing so, observe the polarity of the chip to make sure that the polarity notch on the chip is facing downward.

66.90.43

A booklet paper guide motor M3 error occurred.

The guide motor (M3), located in the booklet-making area of the finisher, and controls the position of the guide plate. The guide plate is positioned in front of the folding rollers as the paper stack is being stapled, allowing the bottom edge of the paper to smoothly pass by the folding rollers. When the stacked paper is lowered to the folding position, the guide motor (M3) lowers the guide plate out of the way to allow the paper stack to be pushed into the folding rollers.

This error can occur under these conditions:

- When the guide-home-position sensor (PI13) does not turn on when the guide motor (M3) has driven for 700 pulses.
- When the guide-home-position sensor (PI13) does not turn off when the guide motor (M3) has driven for 50 pulses.

Recommended action

1. Carefully clean the sensor body by gently blowing clean air across the sensor to remove dust and debris.
2. Make sure that the sensor is securely fastened to the plate.
3. Check the wiring at the sensor.
4. Check sensor PI13 for damage. If damaged, replace the Guide home position sensor PI13.

Part number: FM6-2283-000CN

5. If the sensor is not damaged, and/or the error persists, replace the guide motor M3 and the Guide home position sensor PI13 together.

Guide motor part number: 4G3-0725-000CN

Guide sensor part number: FM6-2283-000CN

6. If the error persists, check the guide, gears, and gear tracks on the front and rear frame for damage.
7. If any components are damaged, and the previous steps did not resolve the error, replace the saddle stapler assembly.

Part number: RM2-6269-000CN

Part description: Saddle Stapler Assembly

66.90.44

A booklet alignment motor (M5) error occurred.

The alignment motor (M5), located in the booklet making area of the finisher, drives the two alignment plates that adjust the side edges of the stacked paper so that the sheets of paper in the stack is perfectly aligned with one another.

This error can occur under these conditions:

- When the aligning-plate home-position sensor (PI5) does not turn on when the aligning-plate motor (M5) has driven for 500 pulses.
- When the aligning-plate home-position sensor (PI5) does not turn off when the aligning-plate motor (M5) has driven for 50 pulses.

Recommended action

1. Observe the alignment plates during a booklet-maker stacking operation.
2. If the alignment plates move during the operation, perform the following steps:
 - a. Check sensor PI5 for damage.
 - b. Make sure that the sensor flag is not damaged, moves freely, and is aligned correctly with the sensor body.
 - c. Make sure that the sensor is securely fastened to the plate.
 - d. Carefully clean the sensor body by gently blowing clean air across the sensors to remove dust and debris.
 - e. If the alignment plates or the alignment-plates drive gear has been removed or replaced, make sure that the plates are aligned correctly with each other on the drive gear.
3. If the alignment plates do not move during the operation, perform the following steps:
 - a. Remove motor M5 and check the gears between the motor and alignment plates for damage, and replace the gears if needed.
 - b. Check the connector (J7) on the saddle-stitcher controller PCA for damage, correct seating, and a secure connection.
 - c. Check the wiring at the M5 motor.
 - d. If the alignment plates or the alignment-plates drive gear has been removed or replaced, make sure that the plates are aligned correctly with each other on the drive gear.
 - e. If the error persists, replace the alignment motor M5.

Part number: 4K1-1103-000CN

66.90.45

A booklet push motor error occurred.

This error can occur under one of these conditions:

- When the paper-pushing-plate home-position sensor (PI14) does not turn on when the paper-pushing-plate motor (M8) has driven for 0.3 seconds.

- When the paper-pushing-plate home-position sensor (PI14) does not turn off when the paper-pushing-plate motor (M8) has driven for 80 ms.
- When the paper-pushing-plate leading-edge-position sensor (PI15) does not turn off when the paper-pushing-plate motor (M8) has driven for 80 ms.
- When the number of pulses detected by the paper-pushing-plate-motor clock sensor (PI1) is less than the expected standard value.
- When the paper-pushing-plate leading-edge-position sensor (PI15) does not turn on when the paper-pushing-plate motor (M8) has driven for 0.3 seconds.

Recommended action

1. Open the front finishing door, and then activate the front-door switch (MSW31) and front-door sensor (PI32) so that the finisher will operate with the front door open.
2. Turn the engine and finisher power off to clear the error, and then turn the power on.

Warning:

Operating the finisher with the front door open exposes moving parts that can cause serious injury. Be very careful operating the finisher with the front door open.

3. Observe the paper-pushing plate motor M8 (located in the lower-right front corner of the finisher), associated gears, and the paper-pushing plate for the correct motion.
 - If motor M8 **does not rotate**, replace the motor-mount assembly.

Part number: FM0-1686-000CN

Note:

The motor-mount assembly includes the paper-pushing-plate motor M8.

- If motor M8 **does rotate, but the paper-pushing plate does not move or moves erratically**, check the drive gears and paper-pushing plate for wear or damage. Replace components as necessary.
 - If motor M8 **does rotate and the paper-pushing plate moves correctly**, the plate movement sensors might have failed. Perform the following steps:
 - d. Inspect the paper-pushing-plate home-position sensor PI14, pushing-plate leading-edge-position sensor PI15, and paper-pushing-motor clock sensor PI1.
 - e. Check the sensors (PI14, PI15, and PI1) for damage, and make sure that the sensors are securely fastened to the chassis.
 - f. Check the connectors (J6, J9, and J23) on the saddle-stitcher controller PCA for damage, correct seating, and a secure connection.
4. If the error persists, replace the saddle-stitcher controller PCA.

Part number: RM2-7586-000CN

A booklet paper-pushing-plate motor (M8) error occurred.

This error can occur under one of these conditions:

- When the paper-pushing-plate home-position sensor (PI14 or PI 15) does not turn on when the paper-pushing-plate motor (M8) has been driven for 0.3 seconds.
- When the paper-pushing-plate home-position sensor (PI14 or PI15) does not turn off when the paper-pushing-plate motor (M8) has been driven for 80 ms.
- When the number of pulses detected by the paper-pushing-plate-motor clock sensor (PI14 or PI15) is less than expected standard value.

Recommended action

1. Open the front finishing door, and activate the front-door switch (MSW31) and front-door sensor (PI32) so that the finisher will operate with the front door open.
2. Turn the printer and finisher power off to clear the error, and then turn the power on.

Warning:

Operating the finisher with the front door open exposes moving parts that can cause serious injury. Be very careful operating the finisher with the front door open.

3. Use the control-panel menus to begin a booklet making operation. Observe the paper-pushing plate motor M8 (located in the lower-right front corner of the finisher), associated gears, and the paper-pushing plate for the correct motion.

Note:

The motor-mount assembly includes the paper-pushing-plate motor M8.

4. If motor M8 does rotate but the paper-pushing plate does not move or moves erratically, check the drive gears and paper-pushing plate for wear or damage. Replace components as necessary.
5. If motor M8 does rotate and the paper-pushing plate moves correctly, the plate movement sensors might have failed.
6. Inspect the paper-pushing-plate home-position sensor PI14, pushing plate leading-edge-position sensor PI15, and paper-pushing-motor clock sensor PI1.
7. Check the sensors (PI14, PI15, and PI1) for damage, and make sure that the sensors are securely fastened to the chassis.
8. Check the connectors (J6, J9, and J23) on the saddle-stitcher controller PCA for damage, correct seating, and secure connection.
9. If the error persists, and **only** if none of the previous steps correct the problem, then replace the saddle-stitcher controller PCA.

Part number: RM2-7586-000CN

66.90.50

A booklet-CPU sequence error occurred.

Recommended action

1. Follow the instructions in the control panel help.
2. Turn the printer off, and then on.
3. If the error persists, replace the booklet maker.

Part number: A2W83-67901

69.XX.YZ error messages

69.11.YZ

A duplexer error occurred.

Recommended action

1. Turn the printer off, and then on.
2. If the error persists, replace the duplexer.

M855 part number: A2W77-67913

M880 part number: A2W75-67911

70.WX.YZ error messages

70.* errors

Messages in the 70.* family indicate a problem with the DC controller or Main board PCA (ECB) depending on your printer.

Recommended action for customers

1. Turn the printer off, and then on.
2. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Replace the DC controller or the Main board PCA (ECB) as needed.

70.00.00 Error To continue turn off then on

The printer experienced a DC controller failure.

Recommended action

1. Turn the printer off, and then on.
2. Check if a card reader is installed. Remove the card reader, if installed, and then check if the error persists.
3. If the error persists, replace the DC controller.

For instructions: See the Repair Service Manual for this product.

M855 part number: RM2-7005-000CN

M880 part number: RM2-7006-000CN

80.WX.YZ, 82.WX.YZ error messages

80.* errors

Errors in the 80.* family indicate a problem with an external I/O device, such as a Jetdirect card, an EIO card, or an external hard disk.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Reload the printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. For 82.* errors, reload the printer firmware.
4. Replace the formatter.

80.0X.YZ Embedded Jetdirect Error

An Embedded HP JetDirect print server critical error has occurred.

- 80.01.80 : (event log) No heartbeat
- 80.01.81 : (event log) Reclaim timeout
- 80.01.82 : (event log) Invalid data length
- 80.01.8B : (event log) Invalid max outstanding packet header field
- 80.01.8C : (event log) Invalid channel mapping response
- 80.03.01 : (event log) No PGP buffers
- 80.03.02 : (event log) Channel table full
- 80.03.03 : (event log) Producer index not reset
- 80.03.04 : (event log) Consumer index not reset
- 80.03.05 : (event log) Queue position size too small
- 80.03.06 : (event log) Transport overflow
- 80.03.07 : (event log) No overflow packets
- 80.03.08 : (event log) Invalid identify response
- 80.03.09 : (event log) Invalid channel map return status
- 80.03.10 : (event log) Invalid reclaim return status
- 80.03.12 : (event log) Datagram invalid buffer
- 80.03.13 : (event log) Max stream channels
- 80.03.14 : (event log) Max datagram channels
- 80.03.15 : (event log) Card reset failed
- 80.03.16 : (event log) Self-test failure
- 80.03.17 : (event log) Unknown PGP packet
- 80.03.18 : (event log) Duplicate I/O channel

Recommended action

1. Turn the printer off, and then on.
2. Remove the RJ45 cable.
3. Turn the printer off, and then on.
4. Reconnect the RJ45 cable. If the error is present only with the RJ45 cable connected, try another cable or check the network settings.
5. If the error persists, replace the formatter.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: Formatter](#)

Part number formatter PCA assembly (M855): A2W77-67902

Part number formatter PCA Assembly (M880): A2W75-67903

Part number formatter PCA Assembly (M855 China/India ONLY): A2W77-67903

Part number formatter PCA Assembly (M880 China/India ONLY): A2W75-67902

81.WX.YZ EIO Error To continue turn off then on

An external I/O card has failed on the printer.

Recommended action

1. Turn the printer off, and then on.
2. Remove the RJ45 cable.
3. Turn the printer off, and then on.
4. Reconnect the RJ45 cable. If the error is present only with the RJ45 cable connected, try another cable or check the network settings.
5. If the error persists, replace the formatter.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: Formatter](#)

Part number formatter PCA assembly (M855): A2W77-67902

Part number formatter PCA Assembly (M880): A2W75-67903

Part number formatter PCA Assembly (M855 China/India ONLY): A2W77-67903

Part number formatter PCA Assembly (M880 China/India ONLY): A2W75-67902

82.* errors

Errors in the 82.* family indicate a problem with an external I/O device, such as a Jetdirect card, an EIO card, or an external hard disk.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. Reload the printer firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, reconnect the network cable, and then turn the printer on.
2. Try another network cable.
3. For 82.* errors, reload the printer firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

4. Replace the formatter.

82.73.46, 82.73.47

A hard disk or compact flash disk cleaning failed.

This error is usually caused by a failure of the disk hardware.

Recommended action for customers

1. Turn the product off, and then on.
2. Reload the printer firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Use the Format Disk item in the Preboot menu.

For the steps to perform a Format Disk procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

3. Reload the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

98.0X.0Y error messages

98.* errors

Errors in the 98.* family are related to data corruption in the firmware.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Turn the printer off, and then on.
2. Download and install the most current version of the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the Format Disk item in the Preboot menu.

For the steps to perform a Format Disk procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

4. Reload the firmware.

98.00.01 or 98.01.00 Corrupt data in firmware volume

Data corruption has occurred in the firmware volume.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Use the Format Disk item in the Preboot menu.

For the steps to perform a Format Disk procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

3. Reload the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.02 Corrupt data in the solutions volume

Data corruption has occurred in the solutions volume.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Use the Format Disk item in the Preboot menu.

For the steps to perform a Format Disk procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

3. Reload the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.03 Corrupt data in the configuration volume

Data corruption has occurred in the configuration volume.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Turn the printer off, and then on.
2. Download and install the latest firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

1. Turn the printer off, and then on.
2. Download the firmware again, and then attempt the upgrade again.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. Use the Format Disk item in the Preboot menu.

For the steps to perform a Format Disk procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

4. Reload the firmware.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

98.00.04 Corrupt data in the job data volume

Data corruption has occurred in the job data volume.

Recommended action

1. Turn the printer off, and then on.
2. Make sure the printer is running the most current version of firmware.

Go to [HP FutureSmart - Latest Firmware Versions](#).

3. Rerun the file erase function.
4. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

98.01.YZ Error messages

Partition manager error. Create extended partition failed or failed to format secondary disk or unable to format partition.

Recommended action

1. Turn the printer off, and then on.
2. Download the firmware again, and try the upgrade again.
3. If the error persists, run the Erase and Unlock option in the Preboot menu.

Warning:

The Format Disk option performs a disk initialization on the entire disk. The operating system, firmware files, and third-party files (among other files) will be completely lost. If you are uncomfortable performing this step, please contact HP Customer Support.

For steps to enter the PreBoot Menu and perform the test go to: [HP Color LaserJet Enterprise Flow MFP M880 and HP Color LaserJet Enterprise M855 - Preboot menu options](#)

4. Reload the firmware.

For instructions on loading firmware, go to: [HP LaserJet Enterprise - Update firmware using a USB flash drive or the Embedded Web Server \(EWS\)](#)

98.02.YZ Error messages

Partition manager error. Unable to wipe drive or drive was not found.

Recommended action

1. Turn the printer off, and then on.
2. Download the firmware again, and try the upgrade again.
3. If the error persists, run the Erase and Unlock option in the Preboot menu.

Warning:

The Format Disk option performs a disk initialization on the entire disk. The operating system, firmware files, and third-party files (among other files) will be completely lost. If you are uncomfortable performing this step, please contact HP Customer Support.

For steps to enter the PreBoot Menu and perform the test go to: [HP Color LaserJet Enterprise Flow MFP M880 and HP Color LaserJet Enterprise M855 - Preboot menu options](#)

4. Reload the firmware.

For instructions on loading firmware, go to: [HP LaserJet Enterprise - Update firmware using a USB flash drive or the Embedded Web Server \(EWS\)](#)

98.03.YZ Error messages

Partition manager error. Corrupt data in one of these volumes: data, config, firmware, or solutions.

Recommended action

1. Turn the printer off, and then on.
2. Download the firmware again, and try the upgrade again.
3. If the error persists, run the Erase and Unlock option in the Preboot menu.

Warning:

The Format Disk option performs a disk initialization on the entire disk. The operating system, firmware files, and third-party files (among other files) will be completely lost. If you are uncomfortable performing this step, please contact HP Customer Support.

For steps to enter the PreBoot Menu and perform the test go to: [HP Color LaserJet Enterprise Flow MFP M880 and HP Color LaserJet Enterprise M855 - Preboot menu options](#)

4. Reload the firmware.

For instructions on loading firmware, go to: [HP LaserJet Enterprise - Update firmware using a USB flash drive or the Embedded Web Server \(EWS\)](#)

99.WX.YZ error messages

99.* errors

Errors in the 99.* family are related to the firmware upgrade process.

Recommended action for customers

Use the following general troubleshooting steps to try to resolve the problem.

1. Make sure the connection to the network is good, and then try the firmware upgrade again.
2. If the error persists, try using the USB upgrade method.

For more information, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

3. If the error persists, contact your HP-authorized service or support provider, or contact customer support at www.hp.com/go/contactHP.

Recommended action for call-center agents and onsite technicians

Use the following general troubleshooting steps to try to resolve the problem. If the error persists, elevate the case using the Standard Support Process.

1. Make sure the connection to the network is good, and then try the upgrade again.
2. Try using the USB upgrade method.
3. If the error persists, run the Format Disk process from the Preboot menu.

For the steps to perform a Format Disk procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

4. If the error persists, replace the hard disk drive.

Note:

Do NOT replace the formatter board, it will not resolve the issue.

99.00.01 Upgrade not performed file is corrupt

A remote firmware upgrade (RFU) was not performed.

This is a CRC error in the firmware image (bad image).

Recommended action

Download the firmware upgrade file, and then attempt the upgrade again.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

99.00.02 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header number and size. It indicates a problem with the network environment, not the product.

Recommended action

The most common cause is an issue with the network environment.

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.

Note:

If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For more information, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

99.00.03 Upgrade not performed error writing to disk

A remote firmware upgrade (RFU) was not performed.

This is a disk error. It might indicate a problem or a hard disk drive failure.

Recommended action

1. Download the RFU file, and then try the upgrade again.
2. If the error persists, run the Clean Disk process from the Preboot menu.
3. Download the firmware from the Preboot menu.
4. If the error persists, check the connections to the hard disk drive and try the upgrade again.
5. If the error persists, replace the hard disk drive (HDD).

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: HDD](#)

Part number: A2W75-67905

99.00.04 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading the header.

The most common cause is an issue with the network environment.

Recommended action

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.

Note:

If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For more information, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

99.00.05 Upgrade not performed timeout during receive

A remote firmware upgrade (RFU) was not performed.

The issue is an I/O timeout when reading image data.

The most common cause is an issue with the network environment.

Recommended action

1. Make sure that there is a good network connection to the product, and then attempt the firmware upgrade again.

Note:

If the upgrade is being performed over the network, check the link light on the ethernet connection on the printer formatter. Make sure that one light is solid and the other is blinking, which signals that data is passing over the ethernet connection. This is an indication of a good physical connection.

2. If the error persists, use the USB upgrade method.

For more information, go to [HP Enterprise, HP Managed - Update the printer firmware](#).

99.00.06 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

This is an unexpected read error when reading the header number and size.

Recommended action

1. Download the RFU file, and then try the upgrade again.
2. If the error persists, replace the hard disk drive (HDD).

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: HDD](#)

Part number: A2W75-67905

99.00.07 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

This is an unexpected read error when reading the rest of the header.

Recommended action

1. Download the RFU file, and then try the upgrade again.
2. If the error persists, replace the hard disk drive (HDD).

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: HDD](#)

Part number: A2W75-67905

99.00.08 Upgrade not performed error reading upgrade

A remote firmware upgrade (RFU) was not performed.

This is an unexpected read error when reading image data.

Recommended action

1. Download the RFU file, and then try the upgrade again.
2. If the error persists, replace the hard disk drive (HDD).

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: HDD](#)

Part number: A2W75-67905

99.00.09 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled.

Recommended action

Resend the remote firmware upgrade (RFU).

99.00.10 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the header number and size.

Recommended action

Resend the remote firmware upgrade (RFU).

99.00.11 Upgrade canceled by user

A remote firmware upgrade (RFU) was not performed.

The RFU was canceled when reading the rest of the header, after reading the header number and size.

Recommended action

Resend the remote firmware upgrade (RFU).

99.00.12 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 1, but the header size does not match version 1 size.

Recommended action

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

Go to [HP FutureSmart - Latest Firmware Versions](#).

2. Resend the RFU.

99.00.13 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The header number is 2, but the header size does not match version 2 size.

Recommended action

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

Go to [HP FutureSmart - Latest Firmware Versions](#).

2. Resend the RFU.

99.00.14 Upgrade not performed the file is invalid

A remote firmware upgrade (RFU) was not performed.

The file is invalid.

Recommended action

1. Download the remote firmware upgrade (RFU) file again.

Make sure that you download the file for the correct printer model.

Go to [HP FutureSmart - Latest Firmware Versions](#).

2. Resend the RFU.

99.00.2x

There is a compatibility issue with the firmware.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99.00.20 (event log)

The bundle is not for this product.

- 99.00.21 (event log)

The bundle is not signed with the correct signature, or the signature is invalid.

- 99.00.22 (event log)

The bundle header version is not supported by this firmware.

- 99.00.23 (event log)

The package header version is not supported by this firmware.

- 99.00.24 (event log)

The format of the bundle is invalid.

- 99.00.25 (event log)

The format of the package is invalid.

- 99.00.26 (event log)

A CRC32 check did not pass.

- 99.00.27 (event log)

An I/O error occurred while downloading the bundle.

Recommended action

1. **99.00.27 only:** Turn the product off, and then on.
2. Download the correct firmware file, and then resend the firmware upgrade.

Go to: [HP FutureSmart - Latest Firmware Versions](#)

3. If the error persists, try installing the upgrade by another method (USB or Embedded Web Server).

99.01.xx

A firmware install error has occurred.

The specific message varies depending on the cause, but the solution for each message is the same.

- 99.01.00
- 99.01.10
- 99.01.20
- 99.01.21

Recommended action

Reload the firmware.

99.02.01

Firmware installation was successful.

Recommended action

No action necessary.

99.02.09

Firmware upgrade cancelled by user.

Recommended action

No action necessary.

99.05.56

Firmware install error.

Recommended action

1. Turn the printer off and reseal the formatter.
2. Perform a Format Disk from the Preboot menu.
3. Reload the firmware.
4. If the error persists, replace either the SSM or the hard drive.
5. If the error persists, replace the formatter.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: Formatter](#)

Part number formatter PCA assembly (M855): A2W77-67902

Part number formatter PCA Assembly (M880): A2W75-67903

Part number formatter PCA Assembly (M855 China/India ONLY): A2W77-67903

Part number formatter PCA Assembly (M880 China/India ONLY): A2W75-67902

99.07.YZ Firmware install error (MFP - fax only)

Fax modem firmware install error occurred.

- **99.07.00** Unexpected fax modem firmware installer error. Firmware installation failed. The finisher installer encountered an error during installation.
- **99.07.10** An error occurred accessing the repository during the fax modem firmware install. Firmware installation failed. The fax modem installer encountered an error in the repository.
- **99.07.21** The fax modem could not be reset. Firmware installation failed. The fax modem installer failed to download flash to the modem.
- **99.07.20** The fax modem firmware installer could not connect to the fax modem. Firmware installation failed. The fax modem installer encountered an error while detecting or initializing modem.
- **99.07.22** Firmware installation failed. The fax modem installer failed to download firmware to the modem.
- **99.07.23** Fax modem reset failed.

Recommended action

1. Turn the printer off.
2. Verify that the fax card is installed correctly on the formatter.
3. Ensure that the fax card is aligned correctly with the slot on the formatter chassis and is firmly seated against the formatter board.
4. Turn the printer on.
5. If the error persists, download and reinstall the firmware.
6. If the error persists, perform a `Format Disk` procedure using the `Preboot` menu.
 - a. Turn the printer off, and then on.
 - b. The HP logo displays on the printer control panel. When a "1/8" with an underscore displays below the HP logo, touch the logo to open the Pre-boot menu.
 - c. Use the arrow buttons on the touchscreen to navigate the pre-boot menu.
 - d. Use the down arrow to highlight `Format Disk`, and then touch the `OK` button.
 - e. Touch the `OK` button again.
 - f. Touch the `Back` button to highlight `Continue`, and then touch the `OK` button.

The printer will continue to boot to Ready state.

7. If the error persists, replace the fax kit.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

Part number: A2W77-67910

99.09.60 Unsupported disk

This is a Preboot menu error.

The hard disk drive currently installed is not recognized or supported by the printer.

Recommended action

Replace the hard disk drive (HDD) with the correct part for this printer.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: HDD](#)

Part number: A2W75-67905

99.09.61 Unsupported disk

The hard disk drive installed is not support in this printer.

The hard disk drive (HDD) is not encrypted and the printer is configured for an encrypted HDD.

Recommended action

Note:

Do NOT replace the formatter board, it will not resolve this error.

Access the Preboot menu, and then select Lock Disk to lock the disk.

- a. Access the Preboot menu
- b. Turn the product on.

- c. Touch the HP logo that displays in the center of the touchscreen until the Preboot menu item opens.
- d. Use the arrow buttons on the touchscreen to navigate the Preboot menu.
- e. Touch the OK button to select a menu item.

99.09.62 Unknown disk

This error indicates that there is an encryption mismatch between the HDD and the formatter.

This typically happens because an HDD was swapped into a device from another device.

Recommended action

Note:

Do NOT replace the formatter board, it will not resolve this error.

1. Use the Preboot menu to unlock the disk.
 - a. Access the Preboot menu
 - b. Turn the product on.
 - c. Touch the HP logo that displays in the center of the touchscreen until the Preboot menu item opens.
 - d. Use the arrow buttons on the touchscreen to navigate the Preboot menu.
 - e. Touch the OK button to select a menu item.
2. If a disk is to be reused in a different product, execute the Erase and Unlock procedure from the Preboot menu, and then reload the firmware.
 - a. From the Preboot menu, open the following menus:
 - Administration (select 3)
 - Manage Disks (select 6)
 - Boot Device (select 6)
 - Erase / Unlock (select 2)
3. If the previous steps did not resolve the issue, replace the hard disk drive.

99.09.63 Incorrect disk

This error indicates that the expected encrypted hard disk drive is not present.

This is expected behavior when installing a new hard disk drive in a device where the previous hard disk drive was encrypted.

Recommended action

Load the firmware to a new hard disk drive, and then lock the disk to this printer.

Important:

Do not replace the formatter board. It will not resolve this error.

99.09.64 Disk Nonfunctional

A fatal hard disk drive failure has occurred.

Recommended action

1. Check whether or not the eMMC is being used as a temporary mass storage solution as an option (eMMC must be present).
2. Enable the eMMC from the preboot menus.
3. Turn the printer off.
4. If the hard disk is damaged, inform the customer that the hard disk drive must be removed to continue.
5. Turn the printer on.

Note:

The boot sequence is expected to stop at 99.39.67 eMMC Not Bootable.

6. Provide instructions to download firmware (This will automatically download to eMMC).
7. During the download to eMMC, the firmware will clear the data migration bit.
8. If the error persists, replace the hard disk drive (HDD).

Important:

Do not replace the formatter board. It will not resolve this error.

For instructions: [Removal and replacement: HDD](#)

Part number: A2W75-67905

99.09.65 Disk data error

Disk data corruption has occurred.

Recommended action

Note:

Do NOT replace the formatter board, it will not resolve this error.

Use the Format Disk procedure from the Preboot menu, and then resend the remote firmware upgrade (RFU).

For the steps to perform a Format Disk procedure, go to [HP LaserJet Enterprise Printers - Performing a Partial Clean or Format Disk Procedure](#).

99.09.66 No boot device

A hard disk drive is not installed in the printer.

Recommended action

1. Determine the customer's intended boot device (hard disk drive or eMMC).
2. Install a compatible hard disk drive or eMMC.
3. If a compatible hard disk drive or eMMC is installed, reseal the hard disk drive or eMMC to make sure that it is seated correctly.
4. If the error persists, replace the hard disk drive (HDD) or replace the eMMC.

Important:

Do not replace the formatter, the DC controller, and the hard disk drive during a single product servicing. Doing so might cause the printer to become unstable or inoperable.

For instructions: [Removal and replacement: HDD](#)

HDD part number: A2W75-67905

eMMC part number: B5L32-67901

Note:

Do not replace the formatter board. It will not resolve this error.

Note:

The device will remain unusable until a new eMMC is installed.

99.09.67 Disk is not bootable please download firmware

This is an error indicating that there is no firmware installed on the disk.

This is usually the result of installing a new disk or performing a Clean Disk operation from the Preboot menu.

Recommended action

1. Press any button to continue to the main Preboot menu.

2. Press the Help button to see the help text for the error.
3. Select the Administration menu.

Note:

If there is a password assigned to the administrator, a prompt to enter the printer displays. Enter the password to continue.

4. Select the Download option, and then download the latest firmware. The user can now download a new firmware bundle to the printer.
5. If the download to the hard disk drive fails, perform the following steps:
 - a. Check whether or not the eMMC is being used as a temporary mass storage solution as an option (eMMC must be present).
 - b. Instruct the customer to enable eMMC from the preboot menus.
 - c. Turn the printer off.
 - d. Inform the customer that the broken hard disk drive must be removed to continue.
 - e. Turn the printer on. The boot sequence is expected to stop at 99.39.67 eMMC Not Bootable.
 - f. Provide instructions to download firmware. This will automatically download to eMMC.
 - g. During the download to eMMC, the firmware will clear the data migration bit.
 - h. Replace the hard disk drive (HDD).

Important:

Do not replace the formatter board. It will not resolve this error.

For instructions: [Removal and replacement: HDD](#)

Part number: A2W75-67905

99.39.64 eMMC Nonfunctional

The eMMC is not functioning.

Recommended action

Replace the eMMC.

Note:

The device will remain unusable until a new eMMC is installed.

Part number: B5L32-67901

99.39.67 eMMC Not Bootable

Data on the eMMC cannot be secured or encrypted.

When the hard disk drive is installed all data on the eMMC is automatically migrated to the hard disk drive and erased from the eMMC. As long as the hard disk drive is installed, the eMMC is non-functional.

Cause: The customer completed the data migration and reinstalled the blank eMMC.

Recommended action

1. Download the firmware to the eMMC.
2. If the download fails, replace the eMMC.

Part number: B5L32-67901

Note:

Do not replace the formatter board. It will not resolve this error.

Note:

The device will remain unusable until a new eMMC is installed.

